

Literature review

Infection prevention and control (IPC) for safe healthcare water systems

Version 1.0

29 July 2024

Key information

Document title:	Literature review - Infection prevention and control (IPC) for safe healthcare water systems
Date published/issued:	29 July 2024
Date effective from:	29 July 2024
Version/issue number:	1.0
Document type:	Literature review
Document status:	Final

Document information

Information	Description
Description:	This literature review examines the available professional literature on the infection prevention and control (IPC) aspects/impacts of the water system.
Purpose:	To inform the infection prevention and control (IPC) aspects/impacts of the water system in the National Infection Prevention and Control Manual in order to facilitate the prevention and control of healthcare associated infections/incidents in NHSScotland health and care settings.
Target Audience:	All NHS staff (including contractors and service delivery partners) involved in the prevention and control of infection in NHSScotland.
Update/review schedule:	Updated as new evidence emerges with changes made to recommendations as required. Review will be formally updated every 3 years with next review in 2027.
Cross reference:	National Infection Prevention and Control Manual
Update level:	<p>Practice – The implications for practice are formulated based on a review of the available professional scientific literature on the infection prevention and control (IPC) aspects/impacts of the water systems.</p> <p>Research – The implications for research are formulated based on a review of the available professional scientific literature on the infection prevention and control (IPC) aspects/impacts of the water systems.</p>

Contact

ARHAI Scotland Infection Control team:

Telephone: 0141 300 1175

Email: NSS.ARHAInfectioncontrol@nhs.scot

Version history

This literature review will be updated in real time if any significant changes are found in the professional literature or from national guidance/policy.

Version	Date	Summary of changes
1.0		Final for publication

Approvals

Version	Date Approved	Name
1.0		ARHAI Scotland Infection Control in the Built Environment & Decontamination (ICBED) Working Group
1.0		ARHAI Scotland Community Infection Prevention & Control (CIPC) Working Group

Abbreviation list

Acronym	Definition
AGREE	Appraisal of Guidelines Research & Evaluation
ARHAI Scotland	Antimicrobial Resistance and Healthcare Associated Infection Scotland
BS	British Standard
BSI	British Standards Institution
CDC	Centers for Disease Control and Prevention (United States of America)
CF	Cystic Fibrosis
CFU	Colony Forming Unit
CPHM	Consultant in Public Health Medicine
CRE	Carbapenem-resistant Enterobacteriaceae
CRO	Carbapenem-resistant organism
CVC	Central Venous Catheter
ECDC	European Centers for Disease Control and Prevention
ERCP	Endoscopic Retrograde Cholangiopancreatography
HAI	Healthcare Associated Infection
HAI-SCRIBE	Healthcare Associated Infection System (for) Controlling Risk In the Built Environment
HCU	Heater Cooler Unit
HFS	Health Facilities Scotland
HIIAT	Healthcare Infection Incident Assessment Tool
HPSC	Health Protection Surveillance Centre
HP	Health Protection
HSE	Health and Safety Executive (UK)
ICBED	Infection Control in the Built Environment and Decontamination
ICD	Infection Control Doctor
ICM	Infection Control Manager
ICU	Intensive Care Unit
IMT	Incident Management Team
IPC	Infection Prevention and Control
ISO	International Organization for Standardization
NIPCM	National Infection Prevention and Control Manual
NNU	Neonatal Unit
NTM	Non-tuberculous Mycobacteria

Acronym	Definition
ORT	Outbreak Reporting Tool
PAG	Problem Assessment Group
PD	Published Document
POU	Point-Of-Use
SGHSCD	Scottish Government Health and Social Care Department
SHTM	Scottish Health Technical Memorandum
SIGN	Scottish Intercollegiate Guidelines Network
TMV	Thermostatic Mixer Valve
TVC	Total Viable Count
UKAS	United Kingdom Accreditation Service
UTI	Urinary Tract Infection
WHO	World Health Organization
WSG	Water Safety Group
WSP	Water Safety Plan

Contents

1 Objectives	9
2 Methodology	12
3 Discussion	13
3.1 Implications for practice	13
3.1.1 General information about water-associated organisms in healthcare settings:.....	13
1. Which organisms associated with healthcare water systems are responsible for colonisation/infection of patients?	13
2. How do healthcare water system-associated organisms survive in the environment?.....	18
3. What are the causes/sources of environmental contamination with healthcare water system-associated organisms?	21
4. Which patient populations are considered as being at increased risk of colonisation/infection with a healthcare water system-associated organism?.....	29
5. What types of infection can healthcare water system-associated organisms cause?	30
6. What are the incubation periods of healthcare water system-associated organisms?	31
7. What is the period of communicability for healthcare water system-associated organisms?	32
8. What are the known transmission routes of healthcare water system-associated organisms?	32
9. Which healthcare procedures present an increased risk of transmission of healthcare water system-associated organisms?	34
3.1.2 Prevention and control of healthcare water system-associated infection:.....	36
10. What are the microbiological water testing requirements at commissioning?	36

11. What are the responsibilities of the IPC team in regards to water safety at commissioning?	37
12. Is routine water testing to detect healthcare water system-associated organisms recommended?	38
13. What are the recommended microbiological limits for healthcare water system-associated organisms?.....	41
14. How frequently should routine water testing be conducted?	44
15. When should routine water testing frequency be increased?....	45
16. Where should routine water samples be taken from (which outlets, how many samples)?	47
17. When should water samples from further back in the system be taken?.....	50
18. Who should water test results be reported to?.....	51
19. How should routine water test results be interpreted?	51
20. What are the water testing requirements following a positive water test result (in the absence of clinical cases)?.....	54
21. What action(s) (remedial and/or clinical) should be taken following a positive water test result (in the absence of clinical cases)?	55
22. Is routine environmental testing for healthcare water system-associated organisms recommended?	57
23. Are there any specific actions required if an outlet tests positive pre-flush but negative post-flush?.....	58
24. Are there any recommended methods for the removal of healthcare water system contamination?.....	59
25. What flushing regimes are recommended for healthcare settings?	66
26. Who should be responsible for flushing?	67
27. What actions can be undertaken to reduce the risk of infection/colonisation associated with direct water usage?.....	68
28. What actions can be undertaken to reduce the risk of infection/colonisation associated with indirect water usage?	77
29. What actions can be undertaken to facilitate the earliest possible detection and preparedness for clinical cases of water-associated colonisation or infection?	80

3.1.3 Outbreak/incident management	82
30. How should water-associated incidents be assessed and reported locally and nationally?	82
31. What are the water testing requirements during a water-associated incident/outbreak?	83
32. What are the environmental testing requirements when investigating healthcare water system-associated incidents/outbreaks?	84
33. How and by whom should water-associated incidents be investigated?	87
34. Should point-of-use (POU) filters be fitted in response to water-associated incidents/outbreaks?	88
35. When can POU filters be removed?	90
3.1.4 Organisational Management:	91
36. Whose responsibility is it to carry out any of the above actions?	91
3.2 Implications for research	92
References	95
Appendices	113
Appendix 1: Specific standards relating to water systems	113
Appendix 2: Levels of Evidence	117
Appendix 3: PRISMA Flow Diagram	118
Appendix 4: Excluded studies	119

1 Objectives

The aim is to review the extant scientific literature regarding the Infection prevention and control (IPC) for safe healthcare water systems to inform evidence-based recommendations for practice.

The specific objectives of the review are to determine:

General information about water-associated organisms in healthcare settings

1. [Which organisms associated with healthcare water systems are responsible for colonisation/infection of patients?](#)
2. [How do healthcare water system-associated organisms survive in the environment?](#)
3. [What are the causes/sources of environmental contamination with healthcare water system-associated organisms?](#)
4. [Which patient populations are considered as being at increased risk of colonisation/infection with a healthcare water system-associated organism?](#)
5. [What types of infection can healthcare water system-associated organisms cause?](#)
6. [What are the incubation periods of healthcare water system-associated organisms?](#)
7. [What is the period of communicability for healthcare water system-associated organisms?](#)
8. [What are the known transmission routes of healthcare water system-associated organisms?](#)
9. [Which healthcare procedures present an increased risk of transmission of healthcare water system-associated organisms?](#)

Prevention and control of healthcare water system-associated infection

10. [What are the microbiological water testing requirements at commissioning?](#)
11. [What are the responsibilities of the IPC team in regards to water safety at commissioning?](#)
12. [Is routine water testing to detect healthcare water system-associated organisms recommended?](#)
13. [What are the recommended microbiological limits for healthcare water system-associated organisms?](#)
14. [How frequently should routine water testing be conducted?](#)
15. [When should routine water testing frequency be increased?](#)
16. [Where should routine water samples be taken from \(which outlets, how many samples\)?](#)
17. [When should water samples from further back in the system be taken?](#)
18. [Who should water test results be reported to?](#)
19. [How should routine water test results be interpreted?](#)
20. [What are the water testing requirements following a positive test result \(in the absence of clinical cases\)?](#)
21. [What actions \(remedial and/or clinical\) should be taken following a positive test result \(in the absence of clinical cases\)?](#)
22. [Is routine environmental testing for healthcare water system-associated organisms recommended?](#)
23. [Are there any specific actions required if an outlet tests positive pre-flush but negative post-flush?](#)

24. [Are there any recommended methods for the removal of healthcare water system contamination?](#)
25. [What flushing regimes are recommended for healthcare settings?](#)
26. [Who should be responsible for flushing?](#)
27. [What actions can be undertaken to reduce the risk of infection/colonisation associated with direct water usage?](#)
28. [What actions can be undertaken to reduce the risk of infection/colonisation associated with indirect water usage?](#)
29. [What actions can be undertaken to facilitate the earliest possible detection and preparedness for clinical cases of water-associated colonisation or infection?](#)

Outbreak/incident management

30. [How should water-associated incidents be assessed and reported locally and nationally?](#)
31. [What are the water testing requirements during a water-associated incident/outbreak?](#)
32. [What are the environmental testing requirements when investigating healthcare water system-associated incidents/outbreaks?](#)
33. [How and by whom should water-associated incidents be investigated?](#)
34. [Should point-of-use \(POU\) filters be fitted in response to water-associated incidents/outbreaks?](#)
35. [When can POU filters be removed?](#)

Organisational management

36. [Whose responsibility is it to carry out any of the above actions?](#)

2 Methodology

This targeted literature review was produced using a defined methodology as described in the [National Infection Prevention and Control Manual: Development Process](#). Database searches were performed on 20 December 2022. This review screened for evidence on both non-acute (including care homes) and acute healthcare settings. However, most of the evidence was specific to acute settings. When evidence on non-acute settings is included, this is specifically highlighted. In addition to the exclusion criteria outlined in the NIPCM Development Process the following evidence was excluded from this review:

- studies without a strong epidemiological link between patient and environmental samples (not showing a link via molecular typing)
- evidence specific to dental unit waterlines (as this is covered in [Literature Review and Recommendations: Management of Dental Unit Waterlines](#))

In total, 2808 individual pieces of evidence were retrieved using the search strategy described in Appendix 5 of the [NIPCM methodology](#). Details regarding the screening process are summarised in a PRISMA flowchart presented in [Appendix 3](#) (adapted from: Moher D, Liberati A, Tetzlaff J, Altman DG, The PRISMA Group (2009).

Preferred Reporting Items for Systematic Reviews and Meta-Analyses: The PRISMA Statement. PLoS Med 6(7): e1000097).

Consultation was received in addition to the ARHAI Scotland Working Groups from the following individuals:

- Tim Wafer (The Water Solutions Group)
- Dr Susanne Surman-Lee (Leegionella Ltd)
- Dennis Kelly (Pro LP Consulting Ltd)
- Dr Michael Weinbren

Engineering colleagues in Health Facilities Scotland (HFS) were consulted throughout the process.

3 Discussion

3.1 Implications for practice

3.1.1 General information about water-associated organisms in healthcare settings:

1. Which organisms associated with healthcare water systems are responsible for colonisation/infection of patients?

In total, 95 pieces of evidence were identified in relation to this research question which includes 80 outbreak studies¹⁻⁸⁰ (graded SIGN50 level 3), eight surveillance studies (graded SIGN50 level 3),⁸¹⁻⁸⁸ one systematic literature review (graded SIGN50 level 2+),⁸⁹ one cohort study (SIGN50 level 3),⁹⁰ one before and after study (SIGN50 level 3),⁹¹ two case reports (SIGN50 level 3)^{92, 93} and two guidance documents (SIGN50 level 4).^{94, 95}

Studies were included if the environmental source of the infection and/or colonisation incident could be linked to patient cases by molecular typing as this provides some rigour to outbreak studies. Studies were excluded if microbial typing was not performed. Molecular typing assesses the genetic material present in microorganisms, allowing comparison of the microorganisms present in clinical and environmental samples. A range of typing methods were described in the literature, and these included pulsed-field gel electrophoresis (PFGE), amplified fragment length polymorphism (AFLP), repetitive-element polymerase chain reaction (rep-PCR), random amplification of polymorphic DNA (RAPD), variable-number tandem repeat (VNTR) typing, single locus sequence typing (SLST), multi-locus sequence typing (MLST), and whole genome sequencing (WGS). It is important to note that these methods vary widely in terms of discriminatory power. Another limitation is the limited availability of typing for some microorganisms. A more general limitation of environmental investigations is that a true link between patient cases and the environment can be overlooked if there is multi-species or multi-strain involvement; this is due to the limitations of sampling technique and microbiological analysis. When isolating microorganisms from environmental samples, multiple

colonies may be present on the sampling plate, however usually only one or two colonies are selected for identification – this is due to time and financial restrictions. This sampling technique limitation is common to all environmental outbreak studies and is a challenge to the accurate interpretation of results. The epidemiological concept of time, place and person is challenging to apply to environmental outbreaks if a cluster of infection or colonisation occurs over a lengthy time period and involves multiple seemingly unrelated microbial species.⁵³ The retrospective nature of outbreak studies often prevents an accurate analysis of events occurring at the point of exposure. Consequently, even when an environmental source is identified, the exact transmission event that led to infection or colonisation in the patient may remain unconfirmed and this was the case for much of the evidence identified for this research question. Conducting a case-control study as part of an outbreak investigation can add rigour, however very few of the outbreak studies included these.^{8, 15, 37, 60, 66, 69, 75} There is no ‘standard’ reporting structure for outbreak studies therefore there is inconsistency in the type of information and level of detail provided. There is likely a risk of publication bias associated with this body of evidence as not all outbreaks that occur in healthcare settings are published in scientific journals.

The most frequently reported organisms within this body of evidence were gram-negative organisms, the majority being *Pseudomonas aeruginosa* (*P. aeruginosa*) (n=33 reports) or other *Pseudomonas* species (n=4 reports),^{52, 54, 67, 70} followed by Enterobacteriaceae (n=26 reports). Other gram-negative bacteria (non-Enterobacteriaceae, non-*Legionella* species) were described in 10 reports.^{17, 18, 23, 36, 39, 52, 53, 66-68} These microorganisms are often described in the literature as opportunistic pathogens, meaning that while the organism may be ever-present in the environment (including water) and rarely cause harm to healthy individuals, vulnerability (for example immune impairment) in certain patient groups provides the opportunity for colonisation/infection. Guidance from the United States of America (US) Centers for Disease Control and Prevention (CDC) describes the following gram-negative bacteria as clinically important opportunistic organisms present in tap water: *Legionella* species, *P. aeruginosa*, *Burkholderia cepacia* (*B. cepacia*), *Ralstonia pikettii*, *Stenotrophomonas maltophilia* (*S. maltophilia*), and *Sphingomonas* species.⁹⁴

Non-tuberculous Mycobacteria (NTM) were described in 21 reports.^{1, 3, 4, 6, 7, 9, 25, 26, 31, 43, 71-75, 78, 79, 87, 93, 95, 96} Guidance from the CDC describes healthcare water as the source of patient infection and/or colonisation with the following NTM: *M. abscessus*, *M. avium* complex, *M. chelonae*, *M. fortuitum*, *M. marinum*, *M. ulcerans*, and pseudo-outbreaks involving *M. chelonae*, *M. fortuitum*, *M. gordonae*, *M. kansasii*, *M. terrae*, and *M. xenopi*.⁹⁴ A limitation of the CDC guidance is that much of the evidence referenced was published prior to the year 2000 (the exclusion criteria for this literature review) and therefore may not reflect current practice in healthcare settings.⁹⁴

Infection with *Legionella* species was described in four reports.^{2, 5, 8, 92}

One report described infection with the fungus *Fusarium solani* linked to contaminated water tanks at a hospital in Brazil where taps and drains tested positive.⁷⁷

There were 16 reports that detailed incidences/outbreaks that occurred in the UK. These involved the following microorganisms.

- In England: Enterobacteriaceae (*Escherichia coli* (*E. coli*) and *Klebsiella* species)^{61, 81} *P. aeruginosa*,^{10, 11, 83, 91} *Pseudomonas fluorescens* (*P. fluorescens*),⁷⁰ *S. maltophilia*,¹³ and *Mycobacterium chimaera* (*M. chimaera*).^{87, 95}
- In Scotland: *Pseudomonas* species (*P. aeruginosa*, *P. fluorescens*, *P. putida*),⁵² NTM (*M. mucogenicum*, *M. chelonae*, *Mycobacterium* spp.),^{9, 26} Enterobacteriaceae (*E. cloacae*, *K. oxytoca*, *K. pneumoniae*, *Pantoea* species, *Serratia marcescens*),⁵² *Chrysonomonas indologenes*,⁵² *Acinetobacter ursingii*,⁵² *S. maltophilia*,⁵² and *Cupriavidus pauculus* (*C. pauculus*).⁵³
- *P. aeruginosa* was reported in both Wales,⁴⁴ and Northern Ireland.⁹⁷

It must be noted that the volume of literature identified for each organism may not be a reflection of the true clinical or environmental risk occurring or burden experienced in healthcare settings. There is a paucity of evidence regarding spontaneous patient cases as well as evidence that sheds light on the environmental prevalence of these microorganisms in healthcare settings and whether this varies geographically. Active screening of patients in two surgical ICUs at a hospital in China, undertaken to gain

knowledge of *P. aeruginosa* colonisation/infection patterns in absence of an outbreak, revealed 9.2% (55/595) spontaneous healthcare-associated patient cases of *P. aeruginosa* colonisation/infection.⁸²

During development of this literature review, stakeholders requested that the microorganisms identified in literature associated with healthcare water that cause infection and/or colonisation in patients be summarised (where possible) according to their most likely source. Sources included: microbial proliferation within the water, microbial proliferation/contamination of plumbing parts/wastewater infrastructure, contaminated water-based equipment, and patients. Further detail regarding determination of source is provided in the research question '[What are the causes/sources of environmental contamination with healthcare water system-associated organisms?](#)'.

Microbial proliferation within the water

Twelve outbreak studies detail infection incidents where microbial proliferation within the water system preceded patient colonisation or infection.^{2-9, 78, 79, 92, 93} The organisms involved included NTM and *Legionella* species. These NTMs included *M. fortuitum*, *M. mucogenicum*, *M. simiae*, *M. abscessus*, *M. chelonae*, and *M. phocaicum*. The *Legionella* species included *Legionella pneumophila* serogroup 5, serogroup 1 and *L. pneumophila* (serogroup unspecified). One of the 12 outbreak studies was a pseudo-outbreak involving NTM *M. simiae* where positive clinical samples were obtained but in the absence of clinical colonisation or infection in the patient.⁴ In pseudo-outbreaks, the clinical samples are effectively contaminated by a contaminated water source, often via diagnostic equipment.

Microbial proliferation/contamination of plumbing parts/wastewater infrastructure

Sixty-three outbreak studies describe microbial proliferation/contamination of plumbing systems/infrastructure. Most of these outbreak studies (n=32) involved patient colonisation and/or infection with *P. aeruginosa*,^{10, 11, 13-16, 19-22, 24, 28, 30, 32-35, 38, 44, 45, 47, 51, 52, 54, 55, 82-86, 90, 91} (two of these also involved *Pseudomonas putida*).^{52, 54}

Other microorganisms included Enterobacteriaceae, detailed in 23 reports (including *Klebsiella* species (*K. pneumoniae*, *K. oxytoca*), *Enterobacter* species (*E. cloacae*,

E. aerogenes), *Citrobacter* species (*C. freundii*, *C. koseri*), *E. coli*, *Serratia marcescens*, *Pantoea agglomerans*, and *Raoultella planticola*),^{12, 27, 29, 37, 40-42, 46, 48-50, 52, 56-65, 81} *B. cepacia*,^{17, 23} *Acinetobacter* species (*A. baumannii*,^{18, 36, 39, 66} *A. ursingii*),⁵² *C. pauculus*,^{52, 53} *Chrysonomonas indologenes*,⁵² *S. maltophilia*,⁵² and NTMs including *M. fortuitum*, *M. mucogenicum*, *M. canariensis*, *M. chelonae*, *M. chimaera*, and *M. gordonae*.^{1, 25, 26, 31, 43, 96} Four of these 63 outbreak studies were pseudo-outbreaks where positive clinical samples were obtained but in the absence of clinical colonisation or infection in the patient; the microorganisms involved were *P. aeruginosa*, *M. chimaera*, *M. gordonae* and *M. fortuitum*.^{1, 31, 33, 43}

Antibiotic resistance was reported in 38 outbreak studies and one systematic literature review, all involving gram-negative microorganisms.^{12, 14, 15, 18-20, 27, 29, 30, 35-42, 44, 46, 48-51, 55-62, 64-66, 76, 80, 82, 84, 89} Many of these had resistance against the beta lactam group of antibiotics including extended-spectrum beta-lactamase-producing organisms (ESBLs) and carbapenem-resistant organisms (CROs) or carbapenem-resistant Enterobacteriaceae (CRE).

All of the Enterobacteriaceae identified in these outbreak studies, as well as *P. aeruginosa*, are commensal microorganisms meaning they can be found naturally in the human intestinal tract. Therefore, it is possible that patients could introduce these bacteria into healthcare settings, where they can contaminate or 'seed' the environment and/or indirectly transmit to other patients. Further analysis of the source of environmental contamination is covered in the research question '[What are the causes/sources of environmental contamination with healthcare water system-associated organisms?](#)'.

Contaminated water-based equipment

In 13 outbreak studies, contamination of water-based equipment was responsible for colonisation and/or infection in patients, where the following microorganisms were involved: *P. aeruginosa*,⁶⁹ *P. putida*,⁶⁷ *P. fluorescens*,⁷⁰ *Stenotrophomonas maltophilia*,^{67, 68} *Serratia marcescens*,⁶⁹ ESBL *Klebsiella oxytoca*,^{76, 80} *M. chimaera*,^{71, 87, 95} *M. chelonae*,⁷²⁻⁷⁴ and *M. fortuitum*.⁷⁵ Infection incidents in multiple countries (including England) involving *M. chimaera* were identified to be associated with water heater-cooler units used during cardiac surgery.^{71, 87, 95}

In summary, below is a list of the microorganisms associated with healthcare water systems identified in the literature (those with an asterisk (*) were identified in published UK incidents and outbreaks):

- *Acinetobacter* species (spp.) (*A. baumannii*, *A. ursingii**)
- *Burkholderia* spp. (*B. cepacia*)
- *Chryseomonas indologenes**
- *Cupriavidus pauculus**
- Enterobacteriaceae (*C. freundii*, *C. koseri*, *E. aerogenes*, *E. cloacae**, *E. coli**, *K. pneumoniae**, *K. oxytoca**, *Pantoea* spp. *, *P. agglomerans**, *S. marcescens**, *R. planticola*)
- *Fusarium solani*
- *Legionella* spp. (*L. pneumophila**)
- Nontuberculous mycobacteria (NTM)* (*M. avium* complex, *M. abscessus*, *M. canariasense*, *M. chelonae**, *M. chimaera**, *M. fortuitum*, *M. gordonae*, *M. kansasii*, *M. marinum*, *M. mucogenicum**, *M. simiae*, *M. phocaicum*, *M. terrae*, *M. ulcerans*, *M. xenopi*)
- *Pseudomonas* spp. (*P. aeruginosa**, *P. putida**, *P. fluorescens**)
- *Stenotrophomonas maltophilia**
- *Sphingomonas* spp.

2. How do healthcare water system-associated organisms survive in the environment?

In total, 14 studies were identified to answer this research question which includes eight outbreak studies,^{5, 7, 13, 21, 59, 61, 68, 98} two non-systematic reviews^{99, 100} and three guidance documents^{94, 101, 102} that were deemed expert opinions (including one Scottish¹⁰¹) and one surveillance study.¹⁰³ In accordance with SIGN 50 methodology, nine are considered level 3 evidence (eight outbreak studies^{5, 7, 13, 21, 59, 61, 68, 98} and one surveillance study¹⁰³) and five are considered level 4 evidence (expert opinions).^{94, 99-102}

Many of the organisms identified in the literature (*Legionella* species, NTMs, *Pseudomonas* species) are naturally occurring in water, including drinking water and usually posing no threat to healthy persons. If allowed to proliferate within a healthcare water system, the risk of infection increases. The CDC reports that NTM, *Pseudomonas* spp. and other gram-negative, non-fermentative bacteria have minimal nutritional requirements and can tolerate the very low nutrient levels found in disinfected healthcare water systems.^{94, 99} Moreover, tolerance of high temperatures (50-55°C) may allow certain species (for example NTM, *Legionella* spp.) to survive in hot water systems if they are not maintained above 55°C.^{5, 94, 99, 101} Some organisms cannot tolerate high temperatures and are more frequently associated with cold water lines and taps.⁹⁴

Routine chlorination is standard practice in healthcare to ensure water quality. Chlorine dioxide may also be added to water as a decontamination treatment in response to contamination issues. Some organisms, particularly NTM, have a high resistance to chlorination with the ability to tolerate free chlorine concentrations of 0.05–0.2 mg/L (0.05–0.2 ppm) found at the tap.^{94, 98, 99} Subsequently, chlorine resistant organisms can persist in the environment despite ongoing routine chemical treatment.⁹⁸ Disinfection can also contribute to selection for proliferation and persistence, as disinfection kills off competitors consequently selecting for those organisms that can grow on low nutrient levels resulting from disinfection.⁹⁹

A number of outbreak studies reported low residual chlorine levels at the tap which was hypothesised as a contributory factor to the survival of organisms in the water system.^{7, 103} Low residual chlorine levels may be due to insufficient flow and/or low usage at the outlet.

The major determinant for survival and persistence of healthcare water system-associated organisms is the formation of biofilms within the water distribution system, where they can form on most surfaces including pipe work, tanks, taps and filters. NTM cells, for example, have a lipid-rich hydrophobic outer membrane which promotes their attachment to particulates in the water allowing them to form biofilms in water systems.^{94, 99} Biofilms create a protective environment for growth, trapping nutrients, and providing resistance to chemical disinfectants and physical removal.⁹⁴ This provides a reservoir within a water system from which organisms can continue to contaminate water systems and components, even after attempts at targeted

disinfection and/or mechanical removal. A *P. aeruginosa* outbreak at an intensive care unit (ICU) was linked to biofilms within sink traps.²¹ It was shown that biofilm reactivation can occur by addition of artificial nutrient broth after removing, sealing and filling the whole sink trap with water for up to six weeks. The biofilms also resisted decontamination with hydrogen peroxide. Even without visual evidence of biofilm, an indicator of biofilm existence is the persistent contamination of a water outlet even after repeated disinfection.^{59, 61, 68} This may occur when biofilm detaches/sloughs off from pipework and is then detected at the outlet.

Protozoa, unicellular eukaryotic microorganisms that are ubiquitous in various environments including water, can ingest bacteria such as *Legionella* spp. and NTMs; the ability of these bacteria to survive within protozoa protects them from the effects of biocides and other disinfection strategies.^{94, 99, 100, 102}

Many water system-associated organisms have the ability to survive on wet or damp surfaces therefore allowing widespread contamination of healthcare environments in damp areas, such as sinks and drains.¹³ Once the organisms are established within these environments, they may persist for a long period of time.

In conclusion, many of the organisms identified in water system-associated infection incidents and outbreaks are ubiquitous to naturally occurring water sources and naturally possess some physical and biological properties that facilitate their survival and persistence within healthcare water systems. These include the ability to survive on low nutrient levels, resistance to high water temperatures, relative resistance to disinfection, survival within protozoa and the ability to form biofilms and/or survive in biofilms within the water distribution system.

3. What are the causes/sources of environmental contamination with healthcare water system-associated organisms?

In total, 97 pieces of evidence were identified in relation to this research question which includes 81 outbreak studies,^{1-51, 53-80, 93, 96} five guidance documents that were deemed expert opinion (including one Scottish¹⁰⁴),^{94, 95, 105, 106} nine surveillance studies,^{81-87, 90, 107} one systematic review⁸⁹ and one case report.⁹² In accordance with SIGN 50 methodology, one was graded SIGN50 level 2 evidence (systematic review),⁸⁹ 91 were graded level 3 evidence (81 outbreak studies,^{1-51, 53-80, 93, 96, 108} seven surveillance studies,^{81-84, 86, 87, 107} two prospective studies,^{85, 90} one case report⁹²) and five were graded level 4 evidence.^{94, 95, 104-106}

The causes of proliferation within the water system are usually related to a failure of (one or more) controls including temperature control, chemical control, water flow or pressure that allows these organisms (some of which are naturally found in water) to survive and accumulate, often within biofilms. More detail regarding survival is provided in the research question '[How do healthcare water system-associated organisms survive in the environment?](#)'. Biofilms can act as a reservoir for a multitude of microorganisms facilitating their survival within water systems, and providing protection from control measures such as heat and chlorine.⁶⁶ Biofilm formation within water systems was reported frequently in outbreak studies.^{7, 24, 26, 29, 31, 34, 37, 48, 51, 59, 61, 66, 68, 74, 76, 94, 104, 105}

There are two possible sources of contamination (entry of microorganisms to water systems) prior to proliferation; exogenous organisms that originate from within the water itself, and endogenous organisms that originate from the patient.

Patients as the source (endogenous source)

All of the Enterobacteriaceae identified in these outbreak studies, as well as *P. aeruginosa*, are commensal microorganisms meaning they can be found naturally in the human intestinal tract. Therefore, it is possible that patients could introduce these bacteria into healthcare settings, where they can contaminate or 'seed' the environment and/or indirectly transmit to other patients. In three prospective surveillance studies, attempts were made to determine the contribution of patients (endogenous source) versus environmental (exogenous) sources to transmission of

P. aeruginosa.^{82, 85, 86} A French multi-centre study compared patient samples (screened regularly from admission) with pre-flush tap water samples to determine whether patient-to-patient transmission had occurred (deemed possible when a similar strain was isolated in more than two patients hospitalised during an overlapping time period in the absence of a matched water sample).⁸⁵ Possible patient-to-patient transmission was identified for 50.5% (86/170) of patients and an exogenous origin from tap water for 17.1% (29/170) of patients. It was not possible to draw conclusions for 55 patients because the same strain types were shared by many patients and tap water samples. When isolating microorganisms from environmental samples, multiple colonies may be present on the sampling plate, however usually only one or two colonies are selected for identification – this is due to time and financial restrictions. Due to the limitations of sampling technique and microbiological analysis of water samples, the role of water sources in transmission described in this study may have been underestimated. Further, no additional environmental sites, for example drains or other water-based equipment, were sampled. A prospective surveillance study undertaken in two Chinese intensive care units (ICUs) found that 17.6% (6/34) of colonisations/infections with *P. aeruginosa* were most likely due to patient-to-patient transmission and 50% (17/34) from endogenous flora (diagnostic clinical sample identical to rectum and/or throat sample of the same patient).⁸² Analysis of environmental samples showed that 64.7% (11/17) of exogenous sourced cases were associated with contaminated sink drains; none of the strains recovered from tap water matched patient strains. This suggests that the plumbing infrastructure rather than the water was the main environmental reservoir in these settings. A third prospective surveillance study, conducted in an ICU in France, demonstrated that both patients and the tap water (pre-flush samples) were reservoirs for transmission to subsequent patients, six patients were colonised with *P. aeruginosa* on admission.⁸⁶ These three prospective surveillance studies highlight the difficulties in determining both the source of contamination and the subsequent direction of transmission (patient-to-patient, environment-to-patient, patient-to-environment) when investigating water-system associated colonisations and infections.^{82, 85, 86}

Inappropriate practices and behaviours of healthcare staff, patients and visitors can increase the risk of patient seeding of the environment. Practices identified in the

literature (4 outbreak studies) included the disposal of organic matter (food/drinks, body fluids/waste material) and residual antibiotics into sinks (some of which were designated for hand-washing only).^{58, 60, 62, 84} Introduction of organic matter into sinks provides the nutrients to maintain biofilms.

Environmental source (Exogenous source)

Analysis of the literature identified for this research question allowed categorisation of the location of environmental contamination into system-wide (deeper within the system), and/or isolated to drains and distal outlets. Separate to the water system itself, water-based equipment can also act as an environmental reservoir for ongoing transmission.

Water system contamination

Fifteen outbreak studies detail infection incidents where widespread water system contamination was identified (rather than isolated to distal ends/outlets).^{1-9, 52, 53, 78, 79, 92, 93} The organisms involved included NTM and *Legionella* species. Two of the 15 outbreak studies were pseudo-outbreaks involving NTMs where positive clinical samples were obtained but in the absence of clinical colonisation or infection in the patient.^{1, 4} Generally, in pseudo-outbreaks the clinical samples are effectively contaminated by a contaminated water source, often via diagnostic equipment.^{1, 4}

A number of outbreak studies involving NTMs detail the presence of the outbreak species in the incoming mains water supplied by the region.^{1, 3, 109} Widespread water system contamination is often evident where multiple outlets and samples from further back in the system, as well as from non-outbreak areas of the healthcare setting, test positive.⁹³ Proliferation of NTMs was reported after a generator failure caused a decrease in water pressure, allowing stagnant water (created during construction work) to flow into the water system of an oncology department; this was associated with subsequent cases of *M. mucogenicum* bloodstream infections.⁷⁹ Stagnation creates the conditions for biofilm to develop on pipework and fittings. Investigation of a *Legionella pneumophila* pneumonia outbreak found the hot-water distribution system was unbalanced, with parts of the hot and cold-water pipes in close proximity without thermal protection.⁹² *Legionella* was identified at inlet and outlet points, suggesting widespread contamination in the system. Further,

thermostatic mixing valves at the sinks contained stagnant water where a lime deposit was found. These combined failures are likely to have supported proliferation of the Legionellae throughout the water. Health Protection Scotland (HPS) and the UK Health and Safety Executive (HSE) guidance advise that a risk of *Legionella* proliferation exists when the water temperature in all or some parts of the system is between 20-45°C.^{104, 106} Improvements to water system infrastructure can have unintended consequences if knowledge of the whole system is lacking. This was one of the issues causing a *Legionella* outbreak where instantaneous water heaters were installed within a hospital water system to improve temperature control. However, the change in the water system infrastructure resulted in an increased mixing of water flow between two adjacent departments (each served by separate water recirculation loops).⁸ Poor management and unidentified dead-legs within one of these loops had created stagnant water which then flowed into the haemato-oncology department when the system was restructured. Further to these structural modifications, changes were made to operation of the copper-silver ionization water disinfection system used by the facility, which required temporarily opening bypass valves. Investigators stated this likely resulted in an influx of sediment into the system. A week after these changes, the first of 13 cases of *Legionella pneumoniae* were identified.⁸ Similar engineering control failures were highlighted in an outbreak involving *Mycobacterium abscessus*, where whole system contamination was suspected.⁷ Mitigations included a programme of routine flushing, removal of aerators, improvements to water recirculation to ensure increased mixing, faster delivery of hot water to outlets and increased chloramine levels throughout the water system. Ineffective heat exchangers were associated with an outbreak of *Legionella pneumophila* where temperature fluctuations combined with flow rates at heat exchangers being well below the maximum designed flow rate of 230 litres per minute (leading to stagnation) preceded the infections.⁵ High *Legionella* spp. counts persisted despite hyperchlorination and heat treatment, suggesting a persistent biofilm at the heat exchangers. Inadequate chlorination was associated with a *Legionella* outbreak on a haemato-oncology unit in America; although the total chlorine measured in the water (1.2 parts per million (ppm)) at the point of entry to the system was within acceptable limits, the residual chlorine levels in the cold water at distal outlets dropped to undetectable levels (<0.1 ppm).² This is likely to have allowed Legionellae to survive and grow. Inadequate chlorination was also

highlighted as a contributing factor in a pseudo-outbreak involving NTM (*M. simiae*), where widespread contamination within the system (pipes, heat exchangers, sinks, drinking fountains, ice machines) was identified.⁴

In some cases, more complex factors related to the design and construction of water systems may contribute to the risk of contamination. Widespread water system contamination at a Scottish hospital was linked to a multi-species outbreak of bloodstream infections.^{9, 52, 53} In an outbreak study of a neonatal ICU, a delay between completion of construction work and the commissioning caused water to remain stagnant for three months and the subsequent biofilm development was the possible cause of the outbreak.³⁴ Poor commissioning planning is an example of inadequate management of the water system whereby a filled system does not become operational for some time leading to stagnation of water which favours biofilm development. Poor practice around construction and commissioning featured in a number of outbreak studies^{8, 34, 52, 79} and is likely an underreported factor considering the age of some healthcare estate.

There is a paucity of evidence that sheds light on the environmental prevalence of these microorganisms in healthcare settings outwith outbreak situations and whether this varies geographically. An environmental surveillance study to determine the presence of *Cupriavidus* spp. in healthcare water systems across the UK found *Cupriavidus* spp. in four out of the 10 tested hospitals as well as a range of gram-negative bacteria in all 10 hospitals.⁸⁸ Another surveillance study aiming to investigate the prevalence of NTMs in hospital water supplies in Iran found that 128 (64.6%) of 198 tap water samples, taken from various departments in six hospitals, were positive for NTM species.¹⁰⁷ The most common strains identified were *M. gordonae* (24 isolates), followed by *M. kansasii* (18 isolates), *M. simiae* (18 isolates), *M. fortuitum* (12 isolates), and *M. chelonae* (4 isolates). However, both studies did not report patient infection/colonisation rates at the studied hospitals and thus it is not known if the *Cupriavidus* spp and NTM found in the water supply was posing a clinical risk. Whilst it is likely that there are distinct regional/geographic trends in terms of presence of NTM in public water supplies, it is unclear how geographic and environmental factors influence the prevalence of certain species and the risk of nosocomial NTM infection/colonisation.

The outbreak studies discussed above highlight the complexity of water systems and the myriad factors that can collectively increase (or decrease) the risk of naturally occurring microorganisms proliferating. In two outbreak studies, although widespread contamination of the water system was identified, the contributing factors at the local level were not reported in detail.^{3, 109}

Distal outlet/drain contamination

Sixty reports describe microbial proliferation/contamination of the plumbing infrastructure mainly at distal outlets and/or drains. Most of these outbreak studies (n=31) involved patient colonisation and/or infection with *P. aeruginosa*,^{10, 11, 13-16, 19-22, 24, 28, 30, 32-35, 38, 44, 45, 47, 51, 52, 54, 55, 82-86, 90, 91} (two of these also involved *Pseudomonas putida*).^{52, 54} Other microorganisms included Enterobacteriaceae, detailed in 22 reports (including *Klebsiella* species (*K. pneumoniae*, *K. oxytoca*), *Enterobacter* species (*E. cloacae*, *E. aerogenes*), *Citrobacter* species (*C. freundii*, *C. koseri*), *E. coli*, *Serratia marcescens*, *Pantoea agglomerans*, and *Raoultella planticola*).^{12, 27, 29, 37, 40-42, 46, 48-50, 56-65, 81} Other gram-negative organisms included *B. cepacia*,^{17, 23} *Acinetobacter* species (*A. baumannii*,^{18, 36, 39, 66} *A. ursingii*),⁵² *Chrysonomonas indologenes*,⁵² and *S. maltophilia*.⁵² NTMs were detailed in 4 reports (*M. mucogenicum*, *M. fortuitum*, *M. canariense*, *M. chelonae*, *M. chimaera*).^{25, 26, 31, 96} Two of these 60 outbreak studies were pseudo-outbreaks where positive clinical samples were obtained but in the absence of clinical colonisation or infection in the patient; the microorganisms involved were *P. aeruginosa* and *M. chimaera*.^{31, 33}

From the literature, taps were identified as plumbing system reservoirs contaminated with *P. aeruginosa* in 11 reports^{10, 11, 24, 30, 35, 44, 54, 83, 85, 90, 91} with NTMs (*M. mucogenicum*, *M. chimaera*) in 2 reports^{25, 31} and *A. baumannii* in two reports.^{36, 66} Two of these studies also identified positive samples from shower water.^{54, 83} Sensor operated taps were specifically mentioned in four studies.^{24, 25, 31, 44} An investigation of a *P. aeruginosa* outbreak on a NICU in Northern Ireland found that sensor taps had significantly greater odds of having at least one component positive for *P. aeruginosa* compared with non-sensor taps ($p < 0.05$).²⁴ Complex flow straighteners were present in the sensor taps (and not in the non-sensor taps), and it was unclear whether the higher rates of positivity associated with sensor taps were due to the design of the flow straighteners or another factor specific to sensor taps.

Flow straighteners within taps were found to be contaminated in five studies.^{24, 31, 53, 66, 78} Flow straighteners have the potential to allow build-up of organic debris and provide the structural support for biofilm development.

Showers were implicated in three outbreaks involving NTMs,^{26, 96} and *P. aeruginosa*.⁸³

Sink drains were reported as environmental reservoirs of Enterobacteriaceae in 18 reports^{12, 27, 29, 37, 40-42, 46, 48-50, 58, 60-64, 81} and reservoirs for *P. aeruginosa* in 20 reports^{13, 14, 82, 15, 16, 20-22, 28, 32-34, 38, 45, 47, 51, 55, 56, 84, 86} Three of the Enterobacteriaceae outbreaks also involved contaminated shower drains,^{29, 42, 48} a fourth had contaminated toilets³⁷ and another had positive samples identified from patient mattresses.⁴⁹ One study involved a water dispenser that was located next to the contaminated sink.⁶⁰ Four of the *P. aeruginosa* outbreaks reported biofilm development in the pipework attached to the drain.^{14, 16, 28, 32} Shower and tap water,⁴⁵ and shower drains and toilets⁵¹ were involved in a few of these *P. aeruginosa* outbreaks. In addition to the 18 reports involving sink drains, shower drains were identified as the reservoir for Enterobacteriaceae in one outbreak,⁵⁷ and toilets in another.⁵⁹ Additional gram-negative organisms located in sink drains associated with outbreaks included *Burkholderia* species,¹⁷ and *A. baumannii*,^{18, 39} *Burkholderia cepacia* was discovered in tap water and on the inside of taps in an outbreak of multiple cases of bloodstream infection.²³

Design features of water fittings can facilitate transmission of organisms from their environmental reservoirs to external surroundings. Two key sink design features mentioned in literature that can facilitate splashing and/or surface and hand contamination from a contaminated drain are the depth of the sink basin (shallow) and the tap positioning relative to the sink drain (direct water flow onto the drain which creates splashing).^{21, 30, 62, 105} These poor design features, coupled with poor clinical practice such as storage, preparation, and handling of items (for example drug preparation) within splash zones of water outlets,^{3, 10, 14, 39, 63} are risk factors for dissemination of contamination from outlets and drains.

The reuse of a cleaning brush to clean down all the sink drains in a hospital ICU, without disinfection of the brush between sinks, likely facilitated environmental

spread between drains during an outbreak of carbapenem-resistant bacteria in Australia.⁶²

An open floor drain was identified as the source of an outbreak of carbapenem-resistant *P. aeruginosa* in a urology ward in Spain;¹⁹ it should be noted that open floor drains are not a common fixture in NHSScotland premises.

One report described infection with the fungus *Fusarium solani* where taps and drains tested positive at a hospital in Brazil. Although water tanks were visually dirty, sampling was not conducted to confirm whether contamination was system wide.⁷⁷

Water-based equipment

Contaminated water-based equipment was identified in the literature as a source for ongoing transmission in 15 reports, this included cardiac water heater coolers,^{71, 87, 95} automated endoscope reprocessors,^{1, 67, 73} laparoscopy equipment,⁷⁴ haemodialysis wall boxes,⁶⁹ chilled water dispensers,^{43, 68, 70} a tea dispenser,⁶⁵ mesotherapy equipment,⁷² ice machines,⁷⁵ clothes washing machine,⁷⁶ and neonatal incubators.⁸⁰ In neonatal incubators, steam cleaning as part of cleaning was facilitating contamination of the incubators and mattresses due to residual moisture left after steaming.⁸⁰ The CDC also list equipment such as automated endoscope reprocessors and ice machines.⁹⁴ Whilst the CDC state that hydrotherapy tanks and pools can pose a risk, the evidence cited for this is all pre-2000 (mainly from the 1980s and 1990s).

In conclusion, whilst it is acknowledged that the source of contamination may be the incoming water supply (many organisms are ubiquitous in the water supply), or the patient, the causes for proliferation are commonly a failure of design and/or management of healthcare water distribution systems and associated components, fittings and equipment (such as lack of temperature, chemical control, flow or usage) that allows incoming organisms to survive and accumulate. This is compounded by multiple factors such as the inadequate design and/or management of water systems, and inadequate cleaning/decontamination protocols. Inappropriate practices and behaviours of healthcare staff, patients and visitors can present a risk of environmental seeding (transfer of patient isolates to the environment) and encourage survival of water system-associated organisms within the water system. Infection incidents involving Enterobacteriaceae and *P. aeruginosa* were

predominantly linked to drains and point of use outlets. The potential involvement of patients in seeding the environment, effectively acting as the source, is difficult to determine in outbreak studies but cannot be discounted considering that these organisms are human commensals. Whilst it is challenging to determine the original source of plumbing infrastructure contamination, the evidence demonstrates that these fittings and fixtures can act as environmental reservoirs for ongoing transmission.

A major limitation of this evidence base is that most studies do not report on patient colonisation at admission (possibly because such surveillance is not routine). Further, environmental testing beyond the tap water was often not conducted during outbreak studies, therefore limiting knowledge as to the extent of wider system contamination. Again, there is a risk of publication bias as studies that did not utilise molecular typing were excluded. The variety of discriminatory power in the different typing methods of included evidence is another limitation.

4. Which patient populations are considered as being at increased risk of colonisation/infection with a healthcare water system-associated organism?

In total, 41 pieces of evidence were identified in relation to this research question which includes 39 outbreak studies,^{2, 3, 7-14, 17, 19, 23, 25, 26, 28-31, 37, 47, 50, 51, 53, 55, 58, 60, 61, 63, 64, 69, 70, 76-80, 96, 110} one English guidance document that was deemed expert opinion¹¹¹ and one cohort study.⁹⁰ In accordance with SIGN50 methodology, 39 were graded SIGN50 level 3 evidence (38 outbreak studies,^{2, 3, 7-14, 17, 19, 23, 25, 26, 28-31, 37, 47, 50, 51, 53, 55, 58, 60, 61, 63, 64, 69, 70, 76-80, 96, 110} one cohort study⁹⁰) and one was graded SIGN50 level 4 evidence (expert opinion).¹¹¹

There are some general limitations to the evidence included within this research question. All of the studies are low quality, graded SIGN50 level 3 or level 4. Since the majority of studies (39 out of 41) are outbreak studies, there is a risk of publication bias as not all infection incidents are published in scientific journals. Moreover, outbreak studies are not controlled for and thus can only describe patient populations affected by water-associated incidents/outbreaks but not measure increased risk.

The patient populations most frequently affected by water system-associated incidents and outbreaks, and considered as high-risk patients, include haematology and oncology patients,^{2, 7-10, 25, 26, 28, 37, 58, 63, 77-79} cardiac surgery patients,^{7, 60, 61} bone marrow and stem cell transplant patients,^{3, 7, 31, 51, 70} neonatal,^{47, 80, 110} paediatric^{17, 76, 77} and adult ICU patients,^{12, 13, 50, 55, 60, 64, 90} transplant patients,^{7, 30} and any other patients that are severely immunocompromised through disease or treatment, for example burn patients,^{11, 13, 29} patients with compromised skin integrity and patients with chronic lung disease.^{3, 14, 19} Patients with non-intact skin or indwelling peripheral/central venous catheters may also be at risk.^{3, 23, 69, 96} Not only patients admitted to hospital are at risk, but also patients at outpatient facilities (for example oncology clinics).⁶³ Clinical judgement is required to assess individual patient risk for any patient not being managed in these high-risk settings.

The approved code of practice (L8) published by the Health and Safety Executive (HSE) discusses patients at higher risk for infection with *Legionella* spp. specifically.¹¹¹ These include patients aged over 45 years, those with respiratory disease, chronic kidney disease, diabetes, heart disease, or patients with an impaired immune system.

5. What types of infection can healthcare water system-associated organisms cause?

In total, 22 pieces of evidence were identified in relation to this research question which includes 17 outbreak studies,^{1, 3, 4, 7, 11, 23, 25, 26, 31, 33, 63, 67, 69, 73, 78, 79, 96} one cohort study,⁹⁰ two international guidelines (both deemed expert opinion^{94, 102}) and one surveillance study.⁸¹ In accordance with SIGN 50 methodology, 20 were graded level 3 evidence (17 outbreak studies,^{1, 3, 4, 7, 11, 23, 25, 26, 31, 33, 63, 67, 69, 73, 78, 79, 96} one cohort study,⁹⁰ and two surveillance studies^{81, 87}) and two were graded level 4 evidence (expert opinion).^{94, 102}

A general limitation is the low quality of evidence (all 22 studies are graded SIGN50 level 3 or level 4). Due to most studies (17 out of 22) being outbreak studies, there is a risk of publication bias as not all outbreaks/infection incidents are published in scientific journals and thus some (possibly unusual or rare) types of infection could be missed. However, at least two studies were identified for each type of infection

described below. Conversely, there is a possibility that rare or unusual types of infections are more likely to be published resulting in an overestimation of their risk.

Within the identified studies, the different types of infection described to be associated with water system organisms include bloodstream,³ respiratory (pneumonia, ventilator-associated pneumonia), skin and soft tissue (including insertion site infections around any invasive device), surgical site infection (endocarditis, wound infection),⁸⁷ urinary tract infection (UTI) and disseminated disease.^{7, 11, 23, 25, 26, 63, 69, 78, 79, 81, 90, 96, 102}

Pseudo-outbreaks, where positive clinical samples were identified but in the absence of clinical colonisation/infection, were described in six outbreak studies linking the contamination of patient samples to a contaminated water source.^{1, 4, 31, 33, 67, 73} The CDC advises that pseudo-outbreaks of *M. chelonae*, *M. gordonae*, and *M. xenopi* have been associated with both bronchoscopy and gastrointestinal endoscopy when contaminated tap water is used to provide irrigation to the site or to rinse off the viewing tip in situ, or when the instruments are inappropriately reprocessed with tap water in the final steps.⁹⁴

6. What are the incubation periods of healthcare water system-associated organisms?

Incubation period in the context of water-associated infection refers to the period between entry of the organisms into the body and onset of infection and depends on the microorganism involved, type of disease and patient factors.

The available evidence on this topic is very limited. One outbreak study,⁷¹ one surveillance study⁸⁷ and two guidance documents^{102, 112} categorised as expert opinions were identified in the literature search. In accordance with SIGN50 methodology, two were graded level 3 evidence (one outbreak study⁷¹ and one surveillance study⁸⁷) and two as level 4 evidence (two expert opinions^{102, 112}).

For most water system-associated organisms, it is challenging to determine an accurate incubation period and this is in part due to the difficulty in determining the exact exposure event and source, and in confirming a link between patient cases and an environmental source. Exceptions to this are for *Legionella* spp. and *Mycobacterium chimaera*.

For legionellosis, guidance from the World Health Organization (WHO) and the European Centres for Disease Control and Prevention (ECDC) advise an incubation period of 2-10 days which can extend up to 20 days in rare cases.^{102, 112} This information is informed by data from community-acquired outbreaks; there is less recent data available for healthcare-associated cases. There is a very low incidence of cases in the healthcare population in Scotland. In fact, there have been no hospital-acquired Legionnaires' disease cases in Scotland in the past ten years.¹¹³

Two reports specific to cardiopulmonary bypass-associated *M. chimaera* infections indicate an incubation period of between three months and five years for that specific organism and exposure scenario.^{71, 87}

In summary, the evidence base regarding incubation period is limited and the precise incubation period for most healthcare water system-associated organisms is varied and unknown. As previously mentioned, incubation periods may be fairly lengthy in some cases. However, very short incubation periods of less than the typically used 48 hours cut off for defining a healthcare associated infection may also be possible (see [chapter 3 'Healthcare Infection Incidents, Outbreaks and Data Exceedance'](#) of the National Infection Prevention and Control Manual). It must be noted that patients susceptible to infection with water system-associated organisms can clinically deteriorate rapidly following exposure.

7. What is the period of communicability for healthcare water system-associated organisms?

No evidence was identified to support this research question.

8. What are the known transmission routes of healthcare water system-associated organisms?

In total, 41 studies were identified in relation to this research question which includes 34 outbreak studies,^{1, 3, 7, 10, 12, 13, 15, 16, 19, 21-23, 25, 26, 29, 32, 33, 35, 57-60, 63, 67, 68, 70, 71, 76, 79, 82, 86, 96, 114, 115} two surveillance studies^{83, 87} and one cohort study.⁹⁰ Four guidelines were also included, of which two were Scottish guidelines^{116, 117}, and all were graded as SIGN50 level 4 expert opinion.^{94, 95, 116, 117} In accordance with SIGN50 methodology, 37 were graded level 3 evidence (34 outbreak studies,^{1, 3, 7, 10, 12, 13, 15,}

16, 19, 21-23, 25, 26, 32, 33, 35, 57-60, 63, 67, 68, 70, 71, 76, 82, 86, 96 two surveillance studies^{83, 87} and one cohort study).⁹⁰

Most studies identified in literature investigating the association between infection and water systems are outbreak studies (34 out of 41 studies) which may suggest a possible, indirect association between the water source and disease transmission. However, it remains challenging to confirm the exact mode of transmission. In many instances, an exact transmission mode from an identified environmental source or reservoir to a patient could not be determined.^{58, 82, 83} In such cases, multiple water uses present multiple possible transmission routes.

There is also a risk of publication bias within this research question as not all outbreaks/infection incidents are published in scientific journals and therefore there is the possibility that the evidence may not fully reflect what is being seen in practice. Moreover, the CDC guidelines are mostly based on studies published pre-2000 which is a limitation as it might not reflect current IPC practice.⁹⁴

Under favourable circumstances, water system-associated organisms have the ability to either proliferate in active growth or remain for long periods in highly stable environmentally resistant forms.⁹⁴ The different modes of transmission include direct contact, indirect contact, aerosolisation and aspiration.

Direct contact can occur through ingestion of contaminated water,^{7, 68, 70} or contact of contaminated water with any other portal of entry (for example surgical site wound, invasive devices, exposed or wounded skin).^{3, 7, 23, 25, 26, 29, 79, 96}

Indirect transmission can occur from the hands of healthcare workers after contacting a contaminated reservoir or source. Healthcare workers hands are often hypothesised as a transmission route in outbreak studies in ICUs where patients are bedbound, but this is challenging to confirm.^{15, 16, 55, 63, 86, 90, 114} Of seven *P. aeruginosa* strains isolated from HCW hands on a medical ICU, the genotype was the same as that from the last patient touched by the HCWs in six cases, and in the seventh was the same as the last tap water sample used.⁸⁶ Even where samples are taken from HCW hands, they may test positive, even when poor hand hygiene is observed.⁶³ At an Italian haematology unit, a contaminated soap dispenser (soap type 'Triclosan') was the source for onwards transmission via HCW hands.¹¹⁴

Indirect transmission can also occur when contaminated equipment comes into contact with patients. Examples of contaminated equipment include diagnostic equipment (bronchoscopes,^{33, 67} bronchoscope automatic washing machine^{1, 76}), medicine prep trays,¹⁰ surgical equipment (arthroscope),²² ventilator equipment (suction apparatus),³⁵ breast pump equipment,³² surgical drape that was re-used despite being single-use,¹⁹ and hydrotherapy shower mattresses.¹³ For example, contamination of infusion therapy procedure trays used to carry intravenous preparations to patient rooms was identified in an outbreak study as the link between contaminated taps and infected patients, with Hickman lines providing an entry route for organisms.¹⁰

Aerosolisation can occur through contaminated water generated from the process of water splashing or spraying onto or from clinical wash hand basins, drains, sinks, shower cubicles and when flushing toilets.^{16, 21, 57, 59, 60, 63, 94} Aerosols can also be released from contaminated water-based equipment for example cardiopulmonary bypass machines and heater-cooler units used during cardiac surgery,^{7, 71, 87, 95, 116} humidifiers within mechanical ventilators,^{32, 94} as well as room air humidifiers.⁹⁴

Finally, the aspiration of contaminated water can be another mode of transmission. Patients with nasogastric tubes and those requiring oral fluid replacement (both often intubated patients) may inhale contaminated water into the airways.¹¹⁵ The 2003 CDC guidelines (expert opinion) state that aspiration is a transmission mode, however the references provided are all in relation to *Legionella* spp. and all published before the year 2000.⁹⁴

In summary, the various transmission routes can be classed in four groups: direct contact, indirect contact (including via contaminated personnel and patients, environment, equipment, and medical products), aerosolization, and aspiration.

9. Which healthcare procedures present an increased risk of transmission of healthcare water system-associated organisms?

In total, 20 studies were identified in relation to this research question which includes 14 outbreak studies,^{3, 7, 10, 13, 23, 25, 26, 33, 57, 67, 69, 71, 79, 96} two Scottish guidance documents (expert opinion),^{116, 117} one English guidance document (expert opinion),⁹⁵ one international guideline (expert opinion),⁹⁴ one cohort study⁹⁰ and one

surveillance study.⁸⁷ In accordance with SIGN50 methodology, 16 were graded level 3 evidence (14 outbreak studies,^{3, 7, 10, 13, 23, 25, 26, 33, 67, 69, 71, 79, 96} one cohort study⁹⁰ and one surveillance study⁸⁷) and four were graded level 4 evidence (four expert opinions^{94, 95, 116, 117}).

A general limitation is the low quality of evidence (all 20 studies are graded SIGN50 level 3 or level 4). Due to the large number of studies (13 out of 20) being outbreak studies, there is a possibility of publication bias as not all outbreaks/infection incidents are published in scientific journals and thus the risk of transmission of organisms following some healthcare procedures might be underestimated. Moreover, the international guidelines included (CDC) are limited as they are mostly based on studies published pre-2000 and therefore might not reflect current IPC practices and the associated risks.⁹⁴

In theory, all diagnostic, treatment, and patient care procedures that involve a water source may present a risk of transmission of healthcare water system-associated organisms. Uses of water in procedures have been traced back as the potential transmission route to the patient in the literature, as follows: two outbreak reports,^{33, 67} one international guideline published by the CDC⁹⁴ (SIGN50 level 4) and one other expert opinion guidance¹¹⁷ provide evidence that reusable medical equipment (bronchoscopy, endoscopy) present a risk due to poor disinfection and inappropriate reprocessing of instruments with tap water.

Patient hygiene (bathing and washing) including wound care was evidenced in three outbreak reports and one cohort study.^{3, 7, 57, 90} Involvement of CVCs via submersion in water was evidenced in three outbreak reports^{25, 26, 96} and in CDC guidelines (SIGN50 level 4). Procedures involving CVC care including haemodialysis^{10, 23} was described in two outbreak reports. Two outbreak studies conducted case-control assessments which demonstrated CVCs to be significant risk factors for infection.^{69, 79} Hydrotherapy was evidenced in one outbreak report¹³ and CDC guidelines (SIGN50 level 4).

Oral care and enteral tube flushes was evidenced in one outbreak report.⁷

Use of cardiac heater cooler units during surgery was evidenced in four outbreak reports and one surveillance study and two guidance documents (both SIGN50 level 4).^{7, 71, 87, 95, 116}

In summary, the evidence was consistent in demonstrating that any diagnostic, treatment or patient care procedure that involves a water source (for example oral care, washing/bathing, enteral tube flushes, intravenous procedures including management, hydrotherapy, use of cardiac heater coolers during surgery) may present a risk of transmission.

3.1.2 Prevention and control of healthcare water system-associated infection:

10. What are the microbiological water testing requirements at commissioning?

In total, six pieces of evidence were identified to answer this research question which includes two guidance documents published by the British Standards Institution^{118, 119} (including one code of practice¹¹⁸), two Scottish guidance documents^{120, 121} (part of the Health Facilities Scotland Scottish Health Technical Memorandum (SHTM) 04-01 series on water safety), one British guidance document¹²² (part of the Department of Health, Health Technical Memorandum (HTM) 04-01 series on water safety) and one Scottish incident report.⁵² All six pieces were deemed to be expert opinions due to the lack of a rigorous methodology or evidence base in guidance development. In accordance with SIGN50 methodology, these six expert opinions are graded level 4 evidence.^{52, 118-122} The small volume of evidence and the lack of high quality evidence is a limiting factor and makes it challenging to answer this research question based on the published scientific articles and guidance documents alone.

Water samples should be obtained as standard UK practice at water system commissioning to ensure a safe handover of a newly constructed or refurbished water system from the contractor.^{52, 118, 120-122} However, there is no mention of specific microbiological water testing requirements at commissioning in the literature. It is mentioned in SHTM 04-01 (Water safety for healthcare premises, Part A) that after disinfection (which is also part of the pre-commissioning process), microbiological tests for bacteria colony counts at 37°C and coliform bacteria, including *Escherichia coli*, should be carried out to confirm that the water is of potable quality.¹²⁰

Scottish guidelines SHTM 04-01 (Water safety for healthcare premises, Part A) and the British Standard BS 7592:2022 state that the NHS board water safety group (WSG) should agree a sampling regime and appropriate parameters prior to tender, including microbiological, depending on the intended use of the system and vulnerability of the patients.^{118, 122} These guidance recommend that to confirm effective disinfection, samples should be taken no sooner than 48 hours after disinfection and immediately prior to handover.^{118, 122} The British Standards Institution PD 855468:2015 extends this period, stating that samples should be taken between two and seven days after disinfection to avoid false negative results.¹¹⁹ In the case of *Legionella*, Scottish guidance indicates that a period of three days – and preferably five – should be allowed following disinfection for the system to settle prior to sampling.¹²¹ It is recommended that sampling is undertaken by an accredited organisation independent of the contractor.¹²²

Due to the lack of evidence identified here, more research and inclusion of commissioning in current guidance or the development of new guidance is needed especially regarding specific microbiological water testing requirements.

11. What are the responsibilities of the IPC team in regards to water safety at commissioning?

In total, six pieces of evidence were identified in relation to this research question which includes three Scottish guidance documents,^{101, 123, 124} two British Standards^{125, 126} and one Scottish incident report.⁵² All six pieces were deemed to be expert opinions due to the lack of a rigorous evidence base underpinning and/or methodology in developing the guidance. In accordance with SIGN 50 methodology, these six expert opinions are graded level 4 evidence.^{52, 101, 123-126} The lack of high quality evidence is a limiting factor for answering this research question.

Throughout the planning and implementation process, ongoing input from a multidisciplinary team, which includes IPC professionals, is required to ensure that infection control remains at the forefront of the design, planning, construction refurbishment and maintenance of healthcare facilities.¹²³ The Healthcare Associated Infection System (for) Controlling Risk In the Built Environment (HAI-SCRIBE) procedure has been developed to identify, manage and record built

environment infection control risks.¹²⁴ It is a requirement for IPC teams to have involvement with the HAI-SCRIBE process.¹²⁴

The [SHTM 04-01 Water safety for healthcare premises, Part A](#), states that the water system should not be brought into service until the infection control team certifies that the water is of potable quality.¹²⁰ The [SHTM 04-01 \(Water safety for healthcare premises, Part B\)](#) includes the responsibilities for the WSG (which includes the Infection Control Manager, the Infection Prevention and Control Doctor and the Consultant Microbiologist) for the maintenance of water quality from the point it leaves the tap.¹⁰¹ They should also advise on infection control policy and this policy should be agreed with the Infection Prevention and Control Team.

IPC teams should be represented in WSGs within NHS boards who commission and develop a Water Safety Plan (WSP) as outlined in [SHTM 04-01](#) and [BS 8680](#) which includes a risk assessment and actions to mitigate risks.^{101, 123, 125} The British Standard ([BS 8580-2:2022](#)) also mentions the input of IPC teams during the development of a risk assessment to identify the types and location of healthcare water system associated infections which could be linked to water exposure and for assessment of surveillance practices.¹²⁶

In general, there is a lack of detail in extant guidance regarding the specific roles and responsibilities of the IPC team at commissioning, beyond certifying that the water is of potable quality.¹²⁰ There is consensus that a multidisciplinary team, which includes IPC professionals, should have ongoing input during commissioning.

12. Is routine water testing to detect healthcare water system-associated organisms recommended?

In total, 15 pieces of evidence were identified in relation to this research question which includes three guidance documents published by the British Standards Institution,^{105, 118, 126} two Scottish Health Technical Memorandums,^{101, 127} six other guidance documents that were classed as expert opinion (including two derived from Scotland, three from England, one from the Republic of Ireland, one CDC guidance document and one WHO guidance document)^{94, 102, 116, 117, 128-131} one outbreak study⁵³, Healthcare Infection Society (HIS) Working Party guidelines.^{94, 132} In accordance with SIGN 50 methodology, one was graded level 3 evidence (one

outbreak study)⁵³ and 12 were graded level 4 evidence (nine expert opinions)^{101, 102, 105, 118, 126-130} The HIS guidelines included in this section were graded using the AGREE tool as 'Recommend'.¹³²

The low quality of evidence is a general limitation of the included evidence (out of the 15 studies included, 13 are level 4 and one is level 3). Most of the included guidance documents are classed as expert opinion due to their limited methodology and/or lack of a rigorous search of evidence. The CDC guidelines included are mostly based on studies published pre-2000 and therefore might not reflect current IPC practices and the associated risks.⁹⁴

Routine water testing is currently recommended for *P. aeruginosa* in the UK and the Republic of Ireland in augmented care areas only (for example NNUs and ICUs).^{128, 130} This is because little reassurance can be gained from one-off samples which can give rise to false negative results, and may miss other contaminated water outlets. Since the clinical risks of severe disease are higher in augmented care, the benefits of routine water testing outweigh the disadvantages.

The CDC mentions that environmental surveillance involving periodic culturing of water samples for *Legionella* spp. from the hospital's potable water system can be an advantage as this is less costly than routine lab diagnostic testing for all patients who have healthcare associated pneumonia.⁹⁴ Routine sampling for the presence of *Legionella* is currently only recommended in England and Scotland when temperatures are not consistently attained or control methods other than heat are used, or where it is found to be necessary by the risk assessment (for example in high risk units and/or procedures).^{101, 118, 129, 130} The World Health Organization (WHO) also recommends testing for *Legionella* in wards with high-risk patients.¹⁰² The need for routine water testing other than *Legionella* and *P. aeruginosa* should also be based on risk assessment. Guidance on risk assessments relevant to water can be found in BS 8580-1 regarding *Legionella* and BS 8580-2 regarding *P. aeruginosa* and other healthcare water system-associated pathogens.^{105, 126}

Total Viable Counts (TVC) can provide evidence on general background microorganism levels and a number of guidance documents agree that routine TVC testing can be useful to indicate deteriorating water quality.^{101, 105, 127, 130} Any significant changes in monitored levels can provide an early warning of possible

emerging problems. The Department of Health, Health Technical Memorandum (HTM 04-01) only recommend monitoring of TVC levels in case of taste or odour problems and when doing so, it may be used to analyse trends.¹³⁰ Although not currently mandated in Scottish guidance, the SHTM 04-01 mentions that many estates management staff continue to test for TVCs and this can be especially important in high risk units and/or where high risk procedures are undertaken.^{101, 127} As an example, regular and consistent water testing (surveillance) resulted in timely recognition of elevated TVC levels in a Scottish outbreak study which successfully minimised the clinical impact of the outbreak.⁵³ However, no further studies were identified in literature that routinely tested for TVC levels. Further research, for example a pilot study in an NHSScotland healthcare facility, would be valuable to create a baseline for TVC testing.

Additional routine testing of water used in patient care procedures that use water separately from the main hot and cold water distribution system (for example HCUs, endoscopy, renal dialysis) is beneficial. Scottish guidance specific to cardiac HCUs recommended fortnightly water testing as HCUs are a known reservoir of healthcare water system-associated organisms.¹¹⁶ Scottish guidance specific to the management of endoscopy rinse water recommend weekly testing of endoscopy final rinse water as described in [SHTM 2030](#).¹¹⁷ The Healthcare Infection Society (HIS) Working Party have produced detailed guidelines on final rinse water where they recommend that TVC monitoring should be done weekly and testing for the presence of environmental mycobacteria and *P. aeruginosa* quarterly, which is in line with guidance from Public Health England.^{131, 132} Healthcare facilities are advised by the CDC guidelines and guidance documents from England and Republic of Ireland to sample dialysis fluids monthly as well as product water used to prepare dialysate using standard microbiologic assay methods for healthcare water system-associated microorganisms.^{94, 128, 131} Additionally, English and Republic of Ireland guidance recommend to sample hydrotherapy pool water weekly for *E.coli*, coliform bacteria, *P. aeruginosa* and English guidance adds quarterly testing for *Legionella* spp.^{128, 131} Republic of Ireland guidelines state that water provided by water dispensers, water coolers or filtered water unit taps and associated pipe work, which are commonly made of plastic and particularly prone to microbial biofilm contamination, should be subject to periodic microbiological testing to ensure good water quality.¹²⁸

It is important to note that the detection of low TVCs is an indication of the overall water quality and signifies a generally unfavourable environment for bacteria, but is not necessarily an indication of the absence of water system-associated organisms (including *Legionella* spp.).^{101, 105} Therefore, these results need to be interpreted carefully when they are being considered in a risk assessment.¹⁰⁵

To summarise, routine water testing is recommended for *P. aeruginosa* and *Legionella* spp. in high-risk areas (for example NNUs and ICUs) to protect vulnerable patients. Guidance on risk assessments to determine if routine water testing is needed for organisms other than *P. aeruginosa* and *Legionella* spp., can be found in BS 8580-1 (*Legionella* spp.) and BS8580-2 (*P. aeruginosa* and other water healthcare water system-associated pathogens). For organisms other than *P. aeruginosa* and *Legionella* spp. it can be valuable to monitor TVC levels and analyse trends as changes in TVC levels can highlight potential issues with the water system. Routine testing of water that is separate from the main hot and cold water distribution system is recommended for HCUs, endoscopy rinse water, water used for renal dialysis and hydrotherapy pool water.

13. What are the recommended microbiological limits for healthcare water system-associated organisms?

In total, 19 pieces of evidence were identified in relation to this research question which includes seven Scottish guidance documents,^{101, 104, 116, 117, 120, 127, 133} three English guidance documents,^{129, 131, 134} four British Standards,^{105, 119, 126, 135} one mandatory Scottish legislation,¹³⁶ one Republic of Ireland guidance document,¹²⁸ one international guidance document (WHO),¹⁰² one UK guidelines¹³² and one outbreak study.⁵³ In accordance with SIGN 50 methodology, one was graded level 3 evidence (one outbreak study⁵³) and 16 were graded level 4 (16 expert opinions^{101, 102, 104, 105, 116, 117, 119, 120, 126-129, 131, 134, 135}). The UK guidelines included in this section was graded using the AGREE tool as 'Recommend'.¹³²

Most of the included guidance documents (16 out of the 17) are classed as expert opinion due to their limited methodology and/or lack of a rigorous underlying evidence base. Moreover, the fact that 17 out of the 18 included studies are low

quality (one is graded SIGN50 level 3 and 15 SIGN50 level 4) is a limitation of the evidence base for this question.

Hot and cold water systems

Twelve sources provide evidence regarding limits for hot and cold water systems.^{53, 101, 102, 119, 120, 127-129, 131, 134-136} A water supply is not expected to be entirely free from healthcare water system associated organisms, but systems should be in place to avoid favourable conditions for microbial growth.¹²⁰ TVC testing results can indicate when the system itself is deteriorating or where there is a local contamination issue.^{101, 120, 135} Consequently, the microbiological limits are not defined for the hot and cold water system and monitoring over time is recommended by five evidence sources to capture any significant increase in TVC counts.^{119, 127, 135, 136} The British Standards Institution mention an increase in microbiological counts in their published document (PD855468:2015) as TVC results in excess of a 2 log difference (100 times) above that found in incoming water.¹¹⁹

Elevated TVCs following frequent water testing from various points within the water system and the clinical isolation of a rare pathogen *Cupriavidus pauculus* in a sterile aseptic pharmacy unit prompted an outbreak investigation. The unit had prior agreed TVC cut-off levels of <10 cfu/ml at 37°C and, <100 cfu/ml at 22°C, but on several occasions the TVCs were reported over 300 cfu/ml which the authors interpreted as being potentially associated with the incident.⁵³

In general, the mandatory Scottish Water Regulations 2014 states that water (for general use, not specific to health and care settings) must have 0 cfu/100 ml for Enterococci and Coliform bacteria (including *Escherichia coli*) to pass as potable, and must have 'no abnormal change' for TVCs in 1ml water sample at 22°C and 37°C.¹³⁶ This is also indicated in English and Republic of Ireland guidelines where microbiological limits of potable water are specified as 0 cfu/100 ml for Enterococci and Coliform bacteria (including *E. coli*) and no upper limit for other bacterial species except *P. aeruginosa*.^{128, 131} For *P. aeruginosa* in all areas, the recognised microbiological limit is 0 cfu/100ml.^{128, 131}

Specifically, the microbiological limits for *Legionella* spp. in the healthcare facilities' hot and cold water system are consistent in Scottish and English guidance to be no greater than 100 cfu/litre.^{101, 104, 127, 129, 131, 134} It is recommended by the WHO and

English guidelines, that in high-risk areas such as transplant units and ICUs, water from the outlet should be free of *Legionella* spp. (that is 0 cfu/litre water) in order to protect susceptible patients.^{102, 129, 134}

High-risk procedures

In addition to water systems, UK and Republic of Ireland guidance documents recommend specific microbiological limits for healthcare procedures that present an increased risk for contamination with healthcare water system-associated organisms (for instance HCU water, hydrotherapy water, endoscopy final rinse water, final rinse water in surgical instrument washer disinfectors and renal dialysis fluid/water).^{116, 117, 128, 131-133} These limits include endotoxin levels to measure the presence of gram-negative bacteria (<0.25 EU/ml in endoscopy and surgical instrument washer disinfectors final rinse water and <0.125 EU/ml in renal dialysis fluid/water) and TVC cut-off levels (<100 cfu/100 ml in HCU waters, <50 cfu/ml in renal dialysis fluid/water, <10 cfu/ml in hydrotherapy water, <10 cfu/100 ml in endoscopy final rinse water and <1 cfu/100 ml in final rinse water in surgical instrument washer disinfectors).^{116, 117, 128, 131-133} For HCU water and endoscopy final rinse water, a limit of 0 cfu/100 ml *Mycobacterium* spp. is also recommended.^{116, 128, 131, 132} Specific to hydrotherapy water, a limit of <20 cfu/litre for *Legionella* spp. is recommended by English guidance (PHE) and 0 cfu/100 ml for *Staphylococcus aureus*, only as part of wider investigations, which is in agreement with the Republic of Ireland HPSC guidance^{128, 131}

To summarise, extant guidance provides the following recommended microbiological limits for all water system testing in healthcare facilities:

- Coliform bacteria (incl. *Escherichia coli*): 0 cfu/100 ml
- Enterococci: 0 cfu/100 ml
- *P. aeruginosa*: 0 cfu/100 ml
- *Legionella* spp.: <100 cfu/litre in non-high risk units and 0 cfu/litre in high risk units and procedures

Additional microbiological limits are recommended for healthcare procedures that present an increased risk:

- Heater cooler unit water

- 0 cfu/100 ml *Mycobacterium* spp. ^{116, 131}
- TVC cut-off levels of <100 cfu/100 ml ¹¹⁶
- Hydrotherapy water
 - <20 cfu/litre for *Legionella* spp. ¹³¹
 - 0 cfu/100 ml for *Staphylococcus aureus* as part of wider investigations only (local decision) ^{128, 131}
 - TVC cut-off levels of <10 cfu/ml ^{128, 131}
- Endoscopy final rinse water
 - 0 cfu/100ml for *Mycobacterium* spp. ^{128, 131, 132}
 - TVC cut-off levels of <10 cfu/100 ml ^{117, 132}
 - Endotoxin limit of <0.25 EU/ml ^{128, 133}
- Final rinse water in surgical instrument washer disinfectors
 - TVC cut-off levels of <1 cfu/100 ml ¹³¹
 - Endotoxin limit of <0.25 EU/ml ¹³¹
- Renal dialysis fluid and water
 - TVC cut-off levels of <50 cfu/ml ^{128, 131}
 - Endotoxin limit of <0.125 EU/ml ^{128, 131}

Two British Standards advise that determination of acceptable limits for other locations (beyond augmented care/high-risk units) in the healthcare facility should be based on a risk assessment.^{105, 126} In general, there is a paucity of published literature to inform risk assessment requirements..

14. How frequently should routine water testing be conducted?

In total, 10 pieces of evidence were identified in relation to this research question which includes eight guidance documents that were deemed to be expert opinion (of which three were English^{130, 131, 134}),^{102, 128, 131, 134, 137} three British Standards^{118, 119, 126} and one before-after study.⁹¹ In accordance with SIGN50 methodology, one was graded level 3 evidence (one before and after study⁹¹) and nine were graded level 4 evidence (nine expert opinions^{102, 118, 119, 126, 128, 130, 131, 134, 137}).

All of the included guidance documents (nine in total) are classed as expert opinion due to their limited methodology and/or lack of a rigorous underlying evidence base. Moreover, no high quality evidence is identified (out of the 10 studies, nine are level 4 and one is level 3) which is a limitation of the evidence base for this question.

Most guidance on the frequency of microbiological water testing, including for *P. aeruginosa* and *Legionella* spp., do not define a specific time frame, but recommend that it should be based on a comprehensive risk assessment and in agreement with the WSG.^{118, 126, 128, 134} The WHO mentions that the frequency of testing for *Legionella* spp. depends on the status of the water system (for example variation in biocide treatment, storage or distribution temperatures).¹⁰²

English guidance recommends testing water outlets at least every six months for *P. aeruginosa*; however, these recommendations are based on expert opinion and do not have scientific studies referenced.^{130, 131} Six-monthly testing may be insufficient particularly in settings where contamination of tap outlets has been found.⁹¹

To determine the frequency of water testing, the growth rate of the organism needs to be considered.¹¹⁹ It is also important to have a sufficient frequency for trend analysis to establish evidence-based confidence that control measures remain effective.¹²⁶ Guidance from the WHO adds that the frequency also depends on the source of the water supply.¹³⁷ Once the frequency is established, British Standards guidance advises that it should be reviewed by the WSG based on sample findings.¹²⁶

15. When should routine water testing frequency be increased?

In total, eight pieces of evidence on this subject were identified which includes two Scottish guidance documents,^{101, 127} five other guidance documents^{102, 118, 128-130} and one outbreak study.⁸ All seven guidance documents were deemed to be expert opinions due to the lack of a rigorous search and/or methodology in developing the guidance. In accordance with SIGN50 methodology, one was graded level 3 evidence (one outbreak study⁸) and seven were graded level 4 evidence (seven expert opinions^{101, 102, 118, 127-130}). There was no primary scientific evidence identified to inform this research question.

The Scottish Health Technical Memorandum 04-01 recommends increasing the water sampling to a weekly frequency when a water system is brought back into use after a *Legionella* contamination has been resolved to closely monitor the water quality.¹²⁷ It mentions that where the results of three consecutive weekly water system samples remain below 100 cfu/litre in non-high risk units, those identified by the WSG (for example the Authorised Person (Water), Consultant Microbiologist, authorising engineer for water) would be informed and sampling would revert to a monthly sampling frequency.¹²⁷ Once three consecutive monthly samples remain below 100 cfu/litre, the sampling can be reverted to quarterly sampling (every three months).¹²⁷

A recent outbreak study presented implementation of changes to the water treatment strategy as the cause of a *Legionella* spp. outbreak and therefore recommended that microbiological levels should be assessed after implementing changes to the water system and/or its treatment strategy.⁸

UK guidance (including relevant British Standards), Republic of Ireland guidance and the WHO cover more situations when the routine water testing should be increased.

These situations are summarised below:

- after implementing changes to the water system and/or its treatment strategy (for example contamination has been resolved and system is brought back into use)^{8, 127, 130}
- during a suspected or confirmed outbreak or if surveillance identifies an increased incidence of infection^{101, 118, 128}
- pre-flush trend analysis demonstrates increasing cfu/100 ml for *P. aeruginosa*¹³⁰
- when control levels of the treatment regime (for example temperature or disinfectant concentrations) are not consistently achieved^{101, 102, 129}

16. Where should routine water samples be taken from (which outlets, how many samples)?

In total, 10 pieces of evidence were identified in relation to this research question which includes four Scottish guidance documents,^{101, 120, 127, 138} three documents published by the British Standards Institution,^{118, 119, 135} two other English guidance documents^{131, 134} and one Republic of Ireland guidance document.¹²⁸ All 10 pieces of evidence were deemed to be expert opinions due to the lack of a rigorous search and/or methodology in developing the guidance. In accordance with SIGN 50 methodology, these 10 expert opinions are graded level 4 evidence.^{101, 118-120, 127, 128, 131, 134, 135, 138} The lack of high quality evidence is a general limitation for this research question.

The British Standards Institute's BS 7592:2022 on *Legionella* sampling, which is considered best practice, advises that on new sites or where there is no established sampling plan, a survey of each water system is necessary, together with preparation of an up-to-date schematic diagram of each system.¹¹⁸ The results of this survey and any other available data should be used to develop a sampling plan and identify the sampling points, keeping in mind the risk factors within the water system for the growth of Legionellae (for instance temperatures between 20°C – 50°C, infrequent use, materials of construction and so on.).¹¹⁸ The identified sampling points should be noted on a simple room plan or site schematic to enable later resampling.¹¹⁸ BS 8554:2015 Code of Practice for the sampling and monitoring of hot and cold water services in buildings states that a sampling plan should also take into account the time water is resident in the building, residual disinfectant decay, storage capacity and residence time/water age, the effects of temperature, and other relevant factors likely to have an effect on water quality such as condition of components, which is in agreement with English guidance.^{131, 135} The sampling plan should identify equipment that constitutes a significant risk of infection because it produces an aqueous aerosol (see "[Which healthcare procedures present an increased risk of transmission of healthcare water system-associated organisms?](#)"), and areas where there is the potential for ingress, stagnation and biofilm build-up.¹³⁵ The plan should include fixed sampling points that can be included in a long-term sampling plan (for instance routine testing during operational management) to enable trend analysis.¹³⁵

The Republic of Ireland HPSC provides guidance regarding routine sampling for *Legionella* spp. and recommends that the number and types of sites that should be tested to detect *Legionella* spp. must be determined on an individual system basis because of the diversity of plumbing, heating, ventilation and air-conditioning systems in the various institutions that may be sampled.¹²⁸ Scottish and English guidance state that water samples should be taken from selected areas within the distribution system and this selection should be on the basis of risk assessments relating to system configuration or patient susceptibility.^{120, 127, 134} The Scottish Health Technical Memorandum 04-01 mentions that the following samples should be taken as a minimum:¹⁰¹

- from the cold water storage and the furthest outlet from the tank, on every loop
- from the calorifier flow, or the closest tap to the calorifier, and the furthest tap on the hot water service circulating system
- additional samples should be taken from the base of the calorifier where drain valves have been fitted
- additional random samples may also be considered appropriate where systems are known to be susceptible to colonisation

Examples of recommended sample sites for routine water testing are given in numerous UK guidance documents (including British Standards and Scottish guidance) and these are summarised in Table 1:

Table 1: Example sample sites for routine water sampling.^{101, 118, 127, 128, 131, 135}

System	Sample points
Cold water system	<ul style="list-style-type: none"> • Incoming main, close to meter, where facilities exist to do so • Storage tank (inlet and outlet) • Nearest, mid-point and furthest outlet from the storage tank, on every loop • Other outlets in areas considered to represent a particular risk for example hospital waters with 'at risk' patients

System	Sample points
Hot water system	<ul style="list-style-type: none"> • Calorifier outlet (or header cistern) or nearest tap to the calorifier outlet • Return supply or nearest outlet to the return supply • Base of calorifier where drain valves have been fitted • Furthest outlet from the calorifier (for instance sentinel outlet) • Return to calorifier • Other outlets in areas (for instance taps and showers) considered to represent a particular risk e.g. hospital wards with 'at-risk' patients
Other systems/sources	<ul style="list-style-type: none"> • Water supply points with removable hoses and devices • Hydrotherapy pool water (Furthest point away from inlets/outlets and balance tank) • Renal unit waters and dialysis fluids (end of distribution loop or the last machine in a dead-end system) • Evaporative cooling systems • Additional random samples may also be considered appropriate where systems are known to be susceptible to colonisation

English guidance further expands on the requirement to include samples from sites in the hot water system that are coolest and sites in the cold water system that are likely to be warmest (thus representing sites most likely to support the growth of *Legionella* spp.).¹³¹ Of note, this guidance and the British Standard BS 7592:2022 also mention that the first water delivered from the outlet (meaning pre-flush) should be used for routine monitoring.^{118, 131}

There is limited evidence to determine the appropriate number of samples that should be taken. [PD 855468:2015](#) recommends that samples should be sufficient in number to be fully representative of the distribution system, sub-branches, tanks and cisterns, as well as the condition to be evaluated for example efficacy of distribution of disinfectant.¹¹⁹ Examples of sampling frequencies for distribution networks are provided in PD 855468:2015, where samples would be taken from each branch and at suitable intervals along the run of pipes.¹¹⁹

Republic of Ireland *Legionella* guidance references Dutch guidance which lists a recommended number of outlets to sample that is dependent on the number of outlets the building has.¹²⁸ The numbers represent 0.75% to 4% of total outlets. A review of a Scottish hospital water testing commented that 5% of the total outlets in the hospital were sampled at commissioning.¹³⁸ There is no evidence in the literature to determine whether these percentages are sufficient or not.

Available guidance on how to take samples is provided in [SHTM 04-01 - Part C](#), [BS ISO 5667-24:2016](#), and [BS 8680:2020](#).

To summarise, samples should be taken from the proximal and distal ends of each water system with a number of sampling points in between (examples of sampling points are provided in Table 1) ensuring that areas identified as 'high risk' both in terms of supporting microorganism growth (for instance cooler parts of the hot water system, warmer parts of the cold water system) and patient susceptibility (for instance high risk units), are represented. Sample points should be noted in a sampling plan to enable resampling and trend analysis. The number of samples that should be taken depend on the number of outlets of the building, but in general this number should be sufficient to represent the entire water system.

17. When should water samples from further back in the system be taken?

Very limited evidence was found in relation to this research question. In total, only one outbreak study was identified to be relevant.¹⁴ In accordance with SIGN50 methodology, this outbreak study was graded level 3 evidence.¹⁴

The lack of evidence is a limiting factor and makes it challenging to answer this research question. Moreover, the outbreak study is specific to *P. aeruginosa* and thus their findings and conclusions may not be generalisable to other organisms.

When positive tests reoccur after removal of organisms from an initial reservoir, for example a tap, it could indicate a reservoir or source further down (distal) the pipes.¹⁴ Negative pre-flush and positive post-flush samples could also indicate contamination further back in the water system. In these situations, it might be beneficial to take water samples further back in the system.

18. Who should water test results be reported to?

There is limited evidence to inform recommendations regarding the reporting of water sample test results, especially who to report to. In total, seven pieces of evidence were identified which includes three Scottish guidance documents,^{101, 121, 127} two British Standards^{125, 135} and two English guidance documents.^{129, 134} All seven pieces of evidence were deemed to be expert opinions due to the lack of a rigorous search and/or methodology in developing the guidance. In accordance with SIGN50 methodology, these seven expert opinions were graded level 4 evidence.^{101, 121, 125, 127, 129, 134, 135} The small amount of evidence and lack of high quality evidence is a limiting factor and makes it challenging to answer this research question.

UK code of practice recommend that test results need to be recorded (either written or electronic) and reported in order to assist those interpreting the results (IPC Team as discussed in [“How should routine water test results be interpreted”](#)).^{125, 129, 135} However, in these documents/guidance it is not mentioned who it should be reported to. Scottish and English guidance on *Legionella* mention that the local WSG, which includes the Authorised Person (water), an infection control doctor/nurse and consultant medical microbiologist, must be informed and provided with copies of the samples in writing when water test results come back positive.^{127, 134} The water safety plan WSP includes pre-determined actions to mitigate risks including when non-compliant results occur as outlined in SHTM 04-01 and BS 8680 and thus it would be appropriate to document the procedure for reporting test results (including who and how) in this plan.^{101, 125}

During commissioning, it is recommended by SHTM 04-01 that the contractor supplies a full set of the water sample analysis to the site supervisor for approval before the system is put into use.¹²¹ The water sample analysis should be cascaded by the site supervisor to other relevant stakeholders such as the WSG members.

19. How should routine water test results be interpreted?

In total, eight pieces of evidence were identified in relation to this research question which includes three British Standards,^{118, 125, 135} three English guidance documents,^{119, 129, 131} one guidance from the Republic of Ireland¹²⁸ and one guidance published by the WHO.¹⁰² All eight pieces of evidence were deemed to be expert

opinions due to the lack of a rigorous search and/or methodology in developing the guidance. In accordance with SIGN 50 methodology, these eight expert opinions were graded level 4 evidence.^{102, 118, 119, 125, 128, 129, 131, 135}

As the growth and survival of organisms are dependent on a number of non-microbiological environmental factors, results should be interpreted alongside other quantifiable factors (known at the time of sampling) that relate to the water system, that is water temperature, pH, residual disinfectant, water softeners, water turnover.^{125, 135} These details should be recorded at the time of sampling to aid interpretation of results and reviewed along with the system's schematic diagram.^{102, 125, 135} In this way, the current results can be interpreted with previous recorded results to allow trends to be visible over time. Further to this, the HSE advises that monitoring of hot and cold water systems where thermostatic mixer valves (TMVs) are fitted needs careful consideration to ensure that results are interpreted in the context of the conditions in place at the time of sampling.¹²⁹

The British Standards Institution has recently updated their guidance on *Legionella* sampling ([BS 7592:2022](#)) to only recommend pre-flush samples as part of routine monitoring purposes.¹¹⁸ Pre-flush samples taken with no at-tap disinfection or adjustment of devices or inserts obtain a reflection of the water as it is used.¹¹⁸ Furthermore, when a sample of water is taken for analysis, results only reflect the quality of the sampled water and not the whole body of water. Therefore there are limitations in the conclusions that can be drawn from any single sample; multiple samples are required to provide confidence in the interpretation of the condition of the system as a whole.¹³⁵ This is particularly the case for microbiological samples where contamination can be intermittent.¹³⁵

If contamination is detected in the pre-flush samples, differentiation between local and systemic colonisation can be achieved by collecting post-flush samples and comparing bacterial counts between pre-flush and post-flush samples.^{118, 128} When a pre-flush sample is positive, but a post-flush sample is negative or has a significantly lower bacterial count, this may indicate a local colonisation of an outlet and/or associated pipework and fittings near to that outlet.^{118, 128} Positive post-flush samples may be an indication that the whole water system is contaminated.^{118, 128}

The British Standards Institution mention that for TVC sampling, results in excess of a 2 log difference above that found in incoming mains water may indicate that the system has deteriorated.¹¹⁹ [BS 8554:2015](#) further states that a significant increase in TVC counts could indicate failing disinfection and/or the establishment of biofilms which could in turn lead to the colonisation by other previously suppressed organisms.¹³⁵

Regarding *Legionella* spp. testing, there are challenges in interpreting results owing to the recognised limitations associated with test methods (poor recovery of *L. pneumophila* due to for example residual disinfectant, heat treatment to repress growth of other non-*Legionella* bacteria and addition of antibiotics to culture medium).¹⁰² Consequently, the HSE advises that a negative result is no guarantee that a system is free of *Legionella* spp.¹²⁹ Additionally, no direct relationship has been established between the number of *Legionella* bacteria detected in a water system and the risk of infection, which further limits interpretation of results.¹⁰² The HSE also advises that a positive *Legionella* test result may not always indicate a failure of controls, as *Legionella* spp. are present in almost all natural water sources.¹²⁹

English and UK guidance recommend that advice on the interpretation of results should be sought from a microbiologist with experience of the healthcare environment and that water test results should be interpreted by a competent person.^{129, 131} In practice, this would be the IPC team with input from the Infection Control Manager, the Infection Prevention and Control Doctor and the Consultant Microbiologist to ascertain there is microbiological knowledge, clinical expertise and an understanding of the installed water system.

To summarise, microbiological results should be interpreted alongside other quantifiable factors that are known at the time of sampling such as temperature and residual disinfectant and these should be recorded to allow for trend analysis. Differentiation between local and systematic colonisation can be achieved by collecting post-flush samples when pre-flush samples test positive. If post-flush samples test positive as well, it may indicate a systemic colonisation in the water supply. If the post-flush samples have significantly lower bacterial counts, it may indicate a local colonisation.

20. What are the water testing requirements following a positive water test result (in the absence of clinical cases)?

In total, eight pieces of evidence were identified in relation to this research question which includes two Scottish guidance documents,^{101, 120} two guidance documents published by the British Standards Institution,^{118, 119} three English guidance documents,^{130, 131, 134} and one guidance document from Republic of Ireland.¹²⁸ All eight pieces of evidence were deemed to be expert opinions due to the lack of a rigorous search and/or methodology in developing the guidance. In accordance with SIGN 50 methodology, these eight expert opinions were graded level 4 evidence.^{101, 118-120, 128, 131, 134}

In general, re-sampling is typically carried out after any remedial actions, as an assurance that said actions have been effective. The SHTM 04-01 part A recommends that microbiological tests for bacteria colony counts at 37°C and coliform bacteria, including *Escherichia coli*, should be carried out after disinfection to establish that the work has been satisfactorily completed.¹²⁰

Where *P. aeruginosa* and/or coliforms are identified in individual sampling points, [PD 855468:2015](#) recommends that the sampling point should be cleaned externally, flushed and re-sampled.¹¹⁹ If non-compliant results persist, investigation and subsequent remedial actions should follow. Regarding *P. aeruginosa* in augmented care, the Department of Health, Health Technical Memorandum (HTM 04-01) guidance mentions that following a positive pre-flush and remedial actions, re-testing the outlet using pre- and post-flush sampling until three consecutive negative samples is recommended at an interval of three days, two weeks and four weeks.¹³⁰ In non-high risk areas, English and Republic of Ireland guidance recommend to resample when there is a low count of *P. aeruginosa* found (1-10 cfu in 100 ml) and when the count is above 10 cfu/100 ml, remedial actions should take place and resampling should be done after three weeks.^{128, 131}

Specific to *Legionella* spp., guidance on testing requirements after a positive *Legionella* test result depend on the level of cfu/litre. If *Legionella* results are between 100 and 1000 cfu/litre in the minority of samples, re-sampling should be carried out.^{101, 128, 131, 134} The reasons for this are not given. It could be to ensure that the result is not a false-positive or to determine if the count has risen further while

the *Legionella* plates were being cultured which may affect the clinical risk. If *Legionella* results are >1000 cfu/litre, guidance across the UK recommend that the system should be re-sampled and remedial actions should take place.^{101, 128, 131, 134} Re-sampling should be undertaken following between two and seven days after disinfection, and at frequent intervals thereafter until a satisfactory level of control has been achieved.¹⁰¹

The updated guidance on *Legionella* sampling from British Standards Institution recommends that initially only a pre-flush is necessary, but when the pre-flush sample is positive, disinfected post-flush samples should be collected to determine whether the contamination is local or systemic.¹¹⁸ This has also been discussed above in "[How should routine water test results be interpreted?](#)".

In conclusion, the system/outlet should be resampled following a positive water test result and, when remedial actions have taken place to ensure the actions have been effective and thus the system is not contaminated anymore. When only a minority of sampling points test positive and contain a low level of microbial counts, resampling could ensure the results are true (that is no false-positives or false-negatives). Resampling can also confirm the extent of microbial growth that has taken place while awaiting initial results. To help determine if the contamination is local or systemic, pre- and post-flush samples should be collected.

21. What actions (remedial and/or clinical) should be taken following a positive water test result (in the absence of clinical cases)?

In total, 10 pieces of evidence were identified in relation to this research question which includes one Scottish guidance document,¹⁰¹ two guidance documents published by the British Standards Institution,^{119, 126} four English guidance documents,^{129-131, 134} one guidance document from the Republic of Ireland¹²⁸ and two international guidelines (WHO and CDC).^{94, 137} All 10 guidance documents were deemed to be expert opinions and in accordance with SIGN 50 methodology, these 10 expert opinions were graded level 4 evidence.^{101, 119, 126, 128-131, 134, 137}

There are some limitations to the evidence as it is mainly low quality (all 10 are SIGN level 4). The included guidance documents that were deemed expert opinion lack a

rigorous search and/or methodology while developing the guidance and often refer to the same references/guidance. The CDC guidelines are mostly based on studies published pre-2000 which is a limitation as it might not reflect current IPC practices.⁹⁴

There is limited guidance to inform remedial/clinical actions specifically in response to water samples testing positive (or out with acceptable limits). All UK guidance mention that disinfection should be considered, but that an immediate review of control measures and risk assessment should be carried out to identify any other remedial action required.^{101, 128, 129, 131, 134} These UK guidance documents do not specify remedial actions that can be taken. The [British Standard 8580-2:2022](#) states that the WSG advises on the remedial actions required when water systems or outlets are found to be contaminated.¹²⁶ The WHO states in their guidance that the entire distribution system, including water-using devices, point-of-use and end-of-pipe devices will need to be flushed and possibly disinfected or decontaminated.¹³⁷ They also mention that small point-of-use (POU) filters could harbour contamination and may need replacing.¹³⁷

In general, remedial actions will be specific to the water system in question and will depend on the level and location of contamination. As microbial growth and survival are dependent on a number of environmental factors, remedial actions should be determined based on consideration of the water test results in context with the water system as a whole, for instance considering other control measures (for example temperature control, pressure control, flushing) as well as chemical and potability analysis results. The British Standards Institution briefly discusses remedial actions in [PD 855468:2018](#) and state that where system disinfection fails to remove established biofilm, consideration should be given for continuous supplementary dosing of disinfectants or removal of affected pipes and fittings for cleaning or replacement.¹¹⁹ It also advises that where *Legionella* spp. have been identified following disinfection, the system should be reassessed as defined in [HSG 274 Part 2](#).¹²⁹ Regarding clinical actions, the CDC recommends diagnostic *Legionella* testing for all patients with health-care associated pneumonia when a water sample is found to be *Legionella* culture-positive.⁹⁴

English guidance provides a list of engineering-based actions for when a routine sample tests positive for *P. aeruginosa* or *Legionella* spp. in a high risk unit.¹³⁰ These

include checking for any system dead legs, ensuring appropriate materials have been installed, and checking that connections to TMVs are appropriate.¹³⁰

In conclusion, remedial actions will be specific per water system and depend on the contamination level and location. Guidance advises an immediate review of control measures and risk assessment to identify remedial actions required.

22. Is routine environmental testing for healthcare water system-associated organisms recommended?

In total, five pieces of evidence were identified in relation to this research question which includes one Scottish guidance document,¹¹⁶ one guidance document published by the British Standards Institution,¹²⁶ two English guidance documents^{131, 134} and one international guidelines (CDC).⁹⁴ All five guidance documents were deemed to be expert opinions and in accordance with SIGN 50 methodology, these five expert opinions were graded level 4 evidence.^{94, 116, 126, 131, 134}

There are some limitations to the evidence as it is low quality (all five are SIGN level 4). The included guidance documents that were deemed expert opinion lack a rigorous search and/or methodology while developing the guidance and often refer to the same references/guidance. Moreover, the CDC guidelines are mostly based on studies published pre-2000 which is a limitation as it might not reflect current IPC practices.

Routine air sampling is recommended fortnightly for cardiac HCUs as this is a known reservoir of healthcare water system-associated organisms dispersed in aerosols which can indirectly infect patients undergoing cardiac surgery. For specific testing requirements, see the NHSScotland Guidance for Decontamination and testing of Cardiac Heater Cooler Units (HCUs).¹¹⁶

English guidance and the BS code of practice state that the frequency and sites for routine environmental sampling of *Legionella* spp., *P. aeruginosa* and other healthcare water system-associated organisms in healthcare facilities should be based on a comprehensive risk assessment and should be part of an overall management strategy.^{126, 134} Guidance on risk assessments relevant to healthcare water system-associated organisms can be found in [BS 8580](#).^{105, 126}

Environmental sampling can be expensive and time-consuming and therefore the CDC does not recommend routine environmental sampling except in the situations where sampling is directed by epidemiological findings and results can be applied directly to infection control decisions.⁹⁴ English guidance advises that routine sampling of environmental surfaces in healthcare environments is not usually indicated, because regulations state that cleaning of the hospital environment is essential and would prevent any type of surface contamination.¹³¹ However, as demonstrated in the section [“What are the causes/sources of environmental contamination with healthcare water system-associated organisms?”](#), environmental reservoirs exist for these organisms and these are not routinely cleaned (examples being sink and shower drains). In this regard, there is currently inconsistency between extant guidance (currently no recommendation for environmental testing) and the primary scientific literature. Outbreak studies demonstrate that healthcare water fittings and fixtures can be environmental reservoirs for water system-associated organisms and may persist as reservoirs if the contamination is not eliminated. Regular testing of potential environmental sources of infection such as sinks, drains, shower trays and toilet cisterns could provide very valuable information in the event of a trigger breach, cluster or outbreak. This is discussed in the section [“What are the environmental testing requirements during a water-associated incident/outbreak?”](#)

23. Are there any specific actions required if an outlet tests positive pre-flush but negative post-flush?

There is limited evidence available that specifically mention outlets that test positive pre-flush but negative post-flush. Most guidance discusses lower or reduced post-flush counts compared to pre-flush counts instead. Four pieces of evidence were identified to inform the recommendations including two guidance documents published by the British Standards Institution,^{118, 119} one other English guidance document,¹³⁰ and one guidance document from the Republic of Ireland.¹²⁸ All four pieces of evidence were deemed to be expert opinions due to the lack of a rigorous search and/or methodology in developing the guidance.^{118, 119, 128, 130} In accordance with SIGN 50 methodology, these four expert opinions were graded level 4

evidence.^{118, 119, 128, 130} The small amount and low quality of evidence identified is a limitation of the evidence base for this question.

As mentioned previously, the British Standards Institution recommends that when pre-flush tests results are positive, disinfected post-flush samples should be collected to determine whether the contamination is local or systemic.¹¹⁸ Post-flush samples that are negative or have low counts would indicate a local contamination.¹³⁰ It is therefore recommended that remedial measures should be directed towards the tap and associated pipework and fittings near to that outlet.^{128,}

130

The sampler needs to be aware of the possibility that the test can fail to detect the organisms and/or contaminated water outlets can be missed. The results are representing the taken samples and not the entire water system. When samples are taken immediately after a disinfection process, false negative results might arise.^{118,}
¹¹⁹ Biocides can continue their action after sample collection and might result in lower counts or false negative test results and therefore may not be truly representative of the safety of the system at the time of sampling.¹¹⁸ To prevent this, extant guidance advises that in systems where biocides are present, sterile bottles containing suitable neutralizers should be used to stop the action of the biocide at the time of collection.¹¹⁸

24. Are there any recommended methods for the removal of healthcare water system contamination?

In total, 48 pieces of evidence were included to answer this research question which includes 41 outbreak studies,^{7, 8, 12-16, 18, 20, 21, 25, 26, 28-42, 44-46, 49, 50, 54, 56, 57, 62-64, 66, 78, 86} two case reports,^{92, 103} two intervention studies,^{55, 91} two guidance documents,^{128, 139} and one international guideline.⁹⁴ The 41 outbreak studies, two case reports and two intervention studies were graded SIGN50 level 3. Three guidance documents (SHTM 04-01 Part D¹³⁹, HPSC IPC water guidelines¹²⁸ and CDC guidelines⁹⁴) were graded as SIGN50 level 4 expert opinion due to a lack of systematic supporting evidence.

This research question is not concerned with the routine management of healthcare water systems to maintain safe water however it is acknowledged that in response to an infection incident or outbreak, efforts may focus on improvements to routine

management (for example where noncompliance or failure of routine processes has been identified). Water and environmental sampling in response to an infection incident or outbreak may indicate both that contamination is present and inform the disinfection approach taken. For further details see research questions 31 [‘What are the water testing requirements during a water-associated incident/outbreak?’](#) and 32. [‘What are the environmental testing requirements when investigating healthcare water system-associated incidents/outbreaks?’](#).

Aside from two intervention studies^{55, 91} most of the evidence sources for this research question consisted of outbreak studies (n=41) where more than one method of removal was implemented often at the same time (or as a result of the first attempt having failed), and removal methods implemented at the same time as other IPC remedial measures. Publication bias is also a concern. Consequently, this body of evidence was unable to determine a superior method(s) for removing microorganisms from environmental sources. A summary of this evidence base is provided below.

Thirty-seven studies (all SIGN level 3) describe physical removal of sinks, pipes, taps and associated fittings.^{7, 8, 12, 14-16, 18, 20, 21, 25, 26, 28, 30-34, 36-42, 44, 46, 49, 50, 54, 56, 57, 63, 64, 78, 91, 92, 103} Tap replacement was described in 13 studies;^{15, 16, 25, 30, 44, 49, 55, 64, 78, 91, 92, 103} four of these detailed installation of taps or drains with inbuilt disinfection systems or taps that could be easily dismantled for disinfection.^{16, 55, 64, 91} Sensor taps were replaced with conventional mixer taps in 3 studies^{25, 44, 92} Sink replacement was described in eight studies although detail as to specific sink model and design was limited.^{14, 18, 38-40, 50, 56, 63} Replacement and/or redesign of drains was described in eight studies.^{12, 20, 21, 28, 32, 41, 42, 46} Features included lockable P-traps and shut-off valves; in an outbreak of *P. aeruginosa*, P-traps were changed at patient discharge whenever a patient stay exceeded 1 week.²⁸ Modifications to shower and/or shower drainage was described in three studies.^{26, 54, 57} Six studies described multiple engineering modifications to the plumbing system.^{7, 8, 26, 33, 36, 63} Two studies mentioned replacement of aerators^{31, 34} and one study detailed installation of rimless toilet bowls in response to a CPE outbreak.³⁷ There was no trend observed with regards to the type of microorganism involved and the method of removal attempted across the studies.

Twenty-nine studies (all SIGN level 3) describe chemical disinfection either of the outlet(s) or the water system itself. Hyperchlorination of the water system was described in 8 studies.^{8, 12, 32, 34, 49, 54, 92, 103} Three of these were related to *Legionella* spp. contamination.^{8, 92, 103} Three were in relation to *P. aeruginosa*.^{32, 34, 54} One study described an outbreak of ESBL *Enterobacter cloacae* where chlorination of the water supply was carried out.⁴⁹ One study described heat treatment alongside chlorination of the main water tank and terminal points, in an attempt to reduce transmission of *S. marcescens*.¹² The concentration and frequency of hyperchlorination varied across these studies. Silver nitrate disinfection of the water system was part of the response to an outbreak of *P. aeruginosa*.⁴⁴

Whole system water disinfection may be carried out in addition to local (distal) outlet disinfection when contamination is identified throughout a water system (not just isolated to the outlet).^{32, 34, 44} For example, hyperchlorination of the entire water system was carried out when both tap water and environmental swabs of taps and drains were positive with *P. aeruginosa*.³⁴ Hyperchlorination was also carried out prior to the sampling results, then repeated once results were available. The outbreak was considered over when both water and swab samples were negative. Similarly, hyperchlorination was carried out following identification of both water and environmental contamination in response to a *P. aeruginosa* NICU outbreak.³² Although the hyperchlorination was associated with negative post-flush *P. aeruginosa* samples, pre-flush tap water samples remained positive, indicating an ongoing contamination issue at the outlet. In another outbreak study, hyperchlorination was implemented after *P. aeruginosa* continued to be present at outlets following outlet-focused control measures (in this case replacement of shower heads).⁵⁴ This coincided with installation of POU filters therefore it was not possible to determine the impact of the hyperchlorination in isolation. In some outbreak studies, it is not clear why whole system disinfection was implemented as specific details of the water sampling protocol are not provided.⁴⁹ It may be as a precautionary measure when the extent of the system contamination is unknown. However, whole system water disinfection is not designed to resolve biofilm accumulation, therefore is unlikely to have any impact where biofilms may be present in drains.^{12, 49}

Twenty-one studies described chemical disinfection of outlets and associated plumbing. This included drains in 13 studies, using various methods (pouring disinfectants down drains, steam cleaning, physical scrubbing).^{13-15, 18, 21, 26, 28, 29, 41, 42, 45, 46, 62} In response to an outbreak of *A. baumannii* in an ICU, all sinks were filled with sodium hypochlorite and sink plugs pulled simultaneously to synchronise the drain flushing to occur at the same time; this was carried out daily for seven days and then weekly thereafter.¹⁸ Before the bleaching intervention, 18 patients over 10 months were infected or colonised with *A. baumannii*. After the intervention, this decreased to 19 patients over 28 months, a statistically significant decrease ($P < 0.01$). The bleaching protocol was initiated after both sink autoclaving and sink replacement failed to prevent ongoing drain colonisation. In an *K. oxytoca* outbreak, a drain flushing protocol using biguanide 1.6% (a quaternary ammonium compound) was initiated on a weekly basis and left to sit for 30 minutes (by closing valves), followed by running hot water (70°C) for 5 minutes.⁴¹ This (plus the initial complete replacement of the entire drainage system) was associated with negative environmental samples and no further patient cases of *K. oxytoca* in the following 6 months. Bleach (undisclosed concentration) was poured into drains in an attempt to remove an environmental reservoir of *P. aeruginosa* in a burns unit.¹³ Combined with other remedial measures (including active environmental surveillance), this was associated with a decreased incidence of *P. aeruginosa* recovered from clinical samples from 44.7 per 1000 admissions in 2011 to 35.6 in 2012. Acetic acid (24%) was poured weekly into sink drains and left for 30 minutes before flushing in an attempt to remove environmental reservoirs of *P. aeruginosa*.¹⁴ This was instituted as a temporary measure whilst awaiting sink replacement but became a routine measure every three months after sinks became recolonised after replacement. Pipework further downstream from the sinks was found to be colonised. Follow up at 21 months with routine environmental sampling showed sinks remained negative.

Drain disinfection proved unsuccessful in an outbreak of *K. pneumoniae* in an ICU, where drains were vaporised with a steam cleaner, followed by pouring a combination of 0.1% sodium hypochlorite, 0.1% sodium hydroxide, and 0.1% C12-C16 alkyl-dimethyl amine oxide into drains.⁴² Sink drains remained colonised when tested two months later and the drains were eventually replaced. Attempts to remove biofilm by physically cleaning deep drains (which required hospital plumbers

to remove screwed down sink traps) and chemical cleaning with a chlorine-based product was unsuccessful at removing the environmental CPE reservoir in a burns unit.²⁹ The drain cleaning was paired with pre-and post-environmental screening. Thrice daily disinfection of sink drains using accelerated hydrogen peroxide was associated with a decreased number of infections but failed to eradicate ESBL-producing *K. oxytoca* from an ICU.⁴⁶ Drains were eventually replaced.

Similar chemical disinfection measures were described for contaminated taps.^{21, 46, 86} Twice monthly chlorine disinfection (aqueous solution (4.5%)) of sodium hypochlorite injected into taps with a 60mL syringe for 15 minutes was associated with a decrease in the positivity rate of tap water.⁸⁶ *P. aeruginosa* was found in 34 out of 180 (18.8%) samples before and in 22 of 288 (7.6%) after tap disinfection was implemented ($P < 0.01$).

Ten of the 45 studies described some form of heat treatment. This included whole system heat treatment in 3 studies.^{12, 92, 103} Two of these described infection incidents with *Legionella* spp., where heat treatment (reheating water to 58°C, and maintaining hot water at 70°C) was combined with hyperchlorination.^{92, 103} Main water tanks were heat treated (and hyperchlorinated) in response to an outbreak of *S. marcesens*.¹² Two studies described localised heat treatments facilitated through flushing (flushing with 70°C hot water for five minutes following water system disinfection;⁴¹ flushing with 90°C hot water for five minutes at high pressure¹⁴). Pressurised steam was used to disinfect grates and drains at 170°C in an attempt to eliminate CRE.⁶² Thermal disinfection, or pasteurisation, of taps was described in three studies;^{35, 64, 91} specific methods included thermal disinfection of removable taps,⁹¹ installation of self-heating taps,⁶⁴ and heating taps in situ.³⁵ Two of these studies were intervention studies, the first in a UK ICU, involving installation of detachable taps that could be decontaminated in a benchtop washer-disinfector.⁹¹ Counts of *P. aeruginosa* at the tap were compared with control taps. A negative binomial regression model showed that *P. aeruginosa* counts from the test taps were significantly lower ($P < 2 \times 10^{-16}$) than those of control taps. The second intervention study took place in a Dutch ICU and involved installation of disinfection devices in sink drains that apply repeated heating (to at least 85°C) and electromechanical vibration, designed to prevent biofilm formation.⁵⁵ Colonisation in the drain with MDR *P. aeruginosa* decreased to 5.1% ($P < 0.001$) from 51.2%. The number of positive

cultures from patients significantly decreased from 4.8 per 1000 patient-days in the pre-intervention period to 2.1 per 1000 days in the first intervention period ($P < 0.001$).

Six of the 45 studies used all three methods (physical removal, chemical disinfection, and heat treatment)^{12, 14, 41, 64, 92, 103} and the organisms included *Legionella* spp.,^{92, 103} *K. oxytoca*,⁴¹ *P. aeruginosa*,¹⁴ *S. marcescens*,¹² and ESBLs (*C. freundii*, *R. planticola*, *E. cloacae*).⁶⁴ Both the *Legionella* spp. incidents were single patient cases, the other studies described outbreaks (multiple patients).

Installation of point of use (POU) filters was described in nine studies alongside other disinfection methods.^{7, 8, 16, 28, 32, 34, 45, 54, 92} However it must be noted that POU filters do not remove microbial contamination, they only prevent microorganisms from leaving the tap.

Three guidance documents were included which are discussed below.^{94, 128, 139} The guidance documents that were graded SIGN50 level 4 expert opinion lack a rigorous search and/or methodology for developing the guidance. Moreover, the CDC guidelines are mostly based on studies published pre-2000 and thus might not reflect current IPC practices.

Guidelines published by CDC (graded SIGN50 level 4) states that 'the principal approaches to disinfection of potable systems are heat flushing using temperatures 160°F–170°F (71°–77°C), hyperchlorination, and physical cleaning of hot-water tanks.' CDC advises that potable water systems are easily recolonised and may require continuous intervention, which many of the included outbreak studies for this research question demonstrated.

Expert opinion guidance on the disinfection of domestic water systems for the control of *Legionella* spp. (graded SIGN50 level 4) published by HFS (04-01 Part D) advises that 'when considering the most suitable method of disinfection for a healthcare facility a number of parameters have to be taken into consideration, factors to be considered include the condition of estate, the health of the occupants, the quality of the public water supply, finance, and the availability of resources to implement a particular regime'.¹³⁹ Disinfection methods that are covered include heat and flush, continuous chlorination, chlorine dioxide, ultraviolet light, copper silver ionisation, silver catalysed hydrogen peroxide, and ozone and chloramines. This guidance is

mainly focused on routine disinfection but does indicate where specific methods may be suitable for emergency response (for outbreaks).

Expert opinion guidance (graded SIGN50 level 4) published by the Republic of Ireland HPSC describes 'systemic continuous disinfection' (temperature control, chlorine dioxide, monochloramines, copper-silver ionisation, electrochemically activated water), 'systematic intermittent disinfection' (superheat and flush, shock hyperchlorination, shock chlorine dioxide, silver catalysed hydrogen peroxide) and 'focal continuous disinfection' (ultraviolet light, ozone) methods.¹²⁸ Focal disinfection is described as only involving a portion of the water distribution system, 'acting at the point of application with no residual effect'. Systemic intermittent methods are advised during or following an outbreak of Legionnaires' disease or other waterborne microorganisms.

In summary, extant guidance is mainly focused on routine disinfection of water systems for the control of *Legionella*. There is limited information in guidance on emergency disinfection in response to outbreaks involving microorganisms other than *Legionella* spp., and on disinfection of distal outlets and drains. When considering the most suitable method of water system disinfection, the advantages and disadvantages should be considered – limited guidance is provided in the Scottish Health Technical Memorandum ([SHTM](#)) 04-01 part D 'Disinfection of Domestic Water Systems'.¹³⁹ In addition to heat and chemical treatment of water systems, physical cleaning may be required to help eliminate built-up of scale and sediment that can protect microorganisms from the biocidal effects of disinfection systems. For emergency disinfection of outlets in response to infection incidents and outbreaks, published outbreak literature was unable to demonstrate a superior or universal disinfection method (or bundle of methods). This is in part due to the limitations of the evidence base, as most outbreak studies fail to appropriately evaluate whether interventions were successful. It must also be acknowledged that disinfection methods work at their optimal performance within different parameters, and this variation in parameters is high across the different healthcare settings described in the literature.

25. What flushing regimes are recommended for healthcare settings?

In total, eight pieces of evidence were identified in relation to this research question which includes two Scottish guidance documents,^{101, 140} two guidance documents published by the British Standards Institution,^{119, 126, 129, 141} two other English guidance documents,^{119, 126, 129, 141} one guidance document from the Republic of Ireland,¹²⁸ and one environmental surveillance study.¹⁴² All included guidance documents were deemed to be expert opinions and in accordance with SIGN50 methodology, these seven expert opinions were graded level 4 evidence.^{101, 119, 126, 128, 129, 140, 141} The environmental surveillance study was graded level 3 evidence using the SIGN50 methodology.¹⁴²

The main limitation of the evidence base included in this section is the low quality of evidence. The included guidance documents that were deemed expert opinion lack a rigorous search and/or methodology while developing the guidance, often refer to the same references and guidance or do not elaborate on their conclusions and provide no indication of a regular schedule of guidance update.

Flushing of outlets is undertaken to control the temperature and maintain a flow of water to reduce the risk of microbial growth. Gavalda et al performed an eight-year longitudinal study looking at the importance of flushing among other things to control *Legionella* spp. colonisation of the healthcare water system.¹⁴² This study showed that daily-used taps in facilities with a horizontal design (lowest floor of the studied Spanish healthcare hospital) were significantly ($p=0.009$) less colonised with *Legionella* spp. compared to taps that were not used daily.¹⁴²

There is consensus in Scottish, English and Republic of Ireland guidance that in augmented care, all outlets that are not used frequently (for instance multiple times per day) should be flushed at least daily and a record should be kept of when they were flushed.^{126, 128, 140, 141} The English Health Technical Memorandum Part C, Republic of Ireland and Scottish guidance all recommend that flushing should be for a period of one minute, first thing in the morning.^{128, 141} Scottish guidance adds that this should be at the maximum flow rate that does not give rise to any splashing beyond the basin to avoid wider contamination.¹⁴⁰

UK guidance recommends to have a twice-weekly flushing regime in healthcare facilities outside of augmented care settings.^{119, 129} Republic of Ireland guidelines mention a weekly flushing regime as a minimum and acknowledge that there may be significant variances in each healthcare facility with types of taps and showers, water pressure and contamination levels and thus recommend to perform a local risk assessment.¹²⁸ If outlets are used less than weekly, removal of the outlet could be considered.¹⁰¹

In terms of the length of flushing, English guidance mention flushing for several minutes, whereas Republic of Ireland guidance mention flushing for three minutes.^{128, 129} Scottish guidance specifically mention twice-weekly flushing of WC cisterns and opening of all outlets for three minutes in a scenario when wards or departments are temporarily closed, but add that regular flushing applies to all sporadically used outlets.¹⁰¹ Republic of Ireland guidelines specify that the cold and hot water outlets need to be run separately and the timing should start once the temperature is comparable with the supply.¹²⁸

Finally, it is worth noting that if the outlet is fitted with a POU filter, the filter should not be removed in order to flush the tap unless the manufacturer's instructions advise otherwise.¹⁴¹

In conclusion, there is consensus that daily flushing for one minute in high-risk settings is required. Different frequencies and lengths outwith high-risk settings are mentioned in the included guidance documents, varying between weekly and twice-weekly for several minutes to three minutes. Performing a risk assessment would be valuable, taking into account the local water pressure and flow rate.

26. Who should be responsible for flushing?

A limited amount of evidence is available in relation to this research question. In total, four pieces of evidence were identified which includes two Scottish guidance documents,^{101, 140} one British Standard¹²⁶ and one guidance document from the Republic of Ireland.¹²⁸ All included guidance documents were deemed to be expert opinions and in accordance with SIGN 50 methodology, were graded level 4 evidence.^{101, 126, 128, 140} Regarding the flushing responsibilities within Scottish health

and care settings, it is appropriate to only include Scottish and UK guidance documents and thus not having wider evidence is not a limitation.

Republic of Ireland advises that the Senior Charge Nurse or Clinical Lead responsible for the area must ensure that flushing is being performed as specified.¹²⁸

To ensure this task is carried out regularly, the [British Standard 8580-2:2022](#) mentions that flushing could be incorporated into the local cleaning schedule together with the training of all relevant staff.¹²⁶

The WSG should have oversight and provide an assurance to the NHS board on compliance with requirements including flushing.^{101, 140}

27. What actions can be undertaken to reduce the risk of infection/colonisation associated with direct water usage?

In total, 34 pieces of evidence were identified in relation to this research question. The evidence base on this subject consists of 19 outbreak studies,^{3, 30, 31, 34, 37, 39, 44, 45, 50, 51, 58, 60, 62, 64, 75, 110, 143-146} four Scottish guidance documents,^{101, 120, 147, 148} four other guidance documents^{128, 141, 149, 150} three before and after studies,^{91, 151, 152} two letters to editor (expert opinion),¹⁵³ one British Standard,¹²⁶ and one international guideline.⁹⁴ Nine guidance documents are assessed as expert opinion.^{94, 101, 120, 128, 141, 147-150} According to the SIGN50 methodology, 22 were graded level 3 evidence (19 outbreak studies^{3, 30, 31, 34, 37, 39, 45, 50, 51, 58, 60, 62, 64, 110, 143, 144, 146} and three before and after studies^{91, 151, 152}) and 12 were graded level 4 evidence (11 expert opinions^{44, 94, 101, 120, 128, 141, 147-150, 153} and the British Standard¹²⁶).

There are some limitations to the evidence that is included in this research question. The evidence is mainly low quality (all 34 studies are either SIGN50 level 3 or level 4) and the guidance documents that were deemed expert opinion lack a rigorous evidence base and/or methodology while developing the guidance and often refer to the same references/guidance. Moreover, the CDC guidelines are mostly based on studies published pre-2000 which is a limitation as it might not reflect current IPC practices.⁹⁴ Since not all outbreaks/infection incidents are published in scientific journals and numerous of the studies included here (19 out of 34) are outbreak studies, there is a risk of publication bias.

In order to reduce the risk of infection/colonisation associated with direct water usage, actions are focused on a) reducing the risk of contamination at the source and b) breaking the chain of transmission from source to patient. Direct water usage refers to uses such as bathing, oral care and drinking, whereby transmission occurs through contact and inhalation of droplets and mists. The available evidence has been summarised in different categories below covering education, sink use and design (for example preventing splash risk), engineering controls (for example use of rimless toilet bowls and removal of unused outlets), POU filters, hand hygiene (for example use of hand rub), patient exposure to tap water (for example use of sterile water for high-risk patient care), water-free care/removal of outlets, and environmental cleaning.

Education

Republic of Ireland guidance recommends that health and care staff should be trained to be aware of the potential risk of HAI from water sources and water outlets.¹²⁸ Patients also need to be informed of the risks related to healthcare water systems, and the below relevant actions they (and their care takers) can take to reduce the risk. In response to a case of *Mycobacterium mucogenicum* in a bone marrow transplant patient, staff and patients were educated on safe showering and changes were made to ensure that shower heads were left hanging straight without loops to reduce build up of stagnant water inside the shower hose.³ In practice, it may not be possible to avoid looped shower hoses as Scottish technical guidance advises that shower heads must not be capable of being accidentally immersed in water, come into contact with drains or other potential sources of contamination.¹²⁰

Appropriate sink use

Three studies identified inappropriate use of clinical wash hand sinks as a risk factor for source contamination; notably none of these studies describe actions following the outbreak events to improve good practice around sink use.^{60, 62, 143} Sinks in patient rooms of a Korean ICU were identified as a reservoir for carbapenemase-producing Enterobacterales (CPE); dialysis solution and patient/caregiver drinks were being emptied into handwashing sinks and may have acted as a nutritional source for biofilm.⁶⁰ This study did not detail any actions to reduce inappropriate sink use. Kotsanas et al. also identified poor clinical hand sink

practice during an investigation into a CPE outbreak on an Australian ICU - residual antibiotics and clinical waste were being disposed of into hand wash sinks creating a suitable environment for biofilm growth.⁶² The exact transmission route was not identified however it was hypothesised that contaminated healthcare worker hands may have transmitted infection during direct patient care for example maintenance of central venous catheters. Again, attempts to reduce inappropriate sink use were not detailed in this outbreak study. In another two studies, poor sink practice was also identified as a possible contributor to transmission (for example disposal of patient waste water, nasogastric tube waste, oral medications and/or body fluids).^{50, 143} Republic of Ireland guidance advises that clinical wash hand sinks should be dedicated for the purposes of hand washing only, and that alternative sinks and sluices should be used for other purposes.¹²⁸ Garvey et al. advises disposal of patient waste water directly into the sluice or macerator after using absorbent gel sheets.⁹¹ HTM 04-01 Part C also advises that clinical wash hand sinks should be used solely for hand washing, and that the spout should not be touched when washing hands.¹⁴¹

Sink design

Poor sink design has been identified as a risk factor for contamination in a number of studies.^{30, 58, 62} There is a lack of information in the literature detailing the most effective sink design to reduce contamination and splash risk however it is evident that sinks should not be designed such that water from the tap directly hits the drain hole. A combination of poor sink design causing severe splashing around the sink, and poor practice of staff using towels to prevent overflow, contributed to an outbreak of *Acinetobacter baumannii* in a paediatric ICU in Korea.³⁹ Further, sink basins should be deep enough to allow hand hygiene to be performed without making contact with the basin or taps.³⁰ In a French outbreak study, taps were found to be too close to the sink collar making it challenging to wash hands without touching the taps while also having a risk of splashback and this likely contributed to cross contamination.³⁰ In an Australian outbreak study, the sink design created splashing from the drain which likely contaminated surrounding surfaces; the sink design was not compliant with Australian regulations.⁶²

The British Standard (BS) 8580-2:2022 Part 2: Risk assessments for *Pseudomonas aeruginosa* and other waterborne pathogens - Code of practice, advises that liquid soap dispensers should not be placed directly above the sink as it can lead to soap drips on the sink surfaces that may support bacterial growth.¹²⁶

Engineering controls

Sink design is just one example of how infection risk could be designed out of healthcare settings. Further engineering measures to reduce risk associated with direct water usage include regular replacement of tap parts. This was implemented after a pseudo-outbreak of *Mycobacterium chimaera*, where biofilms were detected on flow straighteners of handwashing sinks in patient rooms.³¹ [HTM 04-01 Part C](#) advises that flow straighteners should be avoided altogether, as they can present a surface area for colonisation of microorganisms.¹⁴¹

Two studies describe replacement of taps in response to outbreaks. Replacing taps was found to coincide with a decrease in the acquisition of *P. aeruginosa* on an ICU; however holistic measures were implemented at the same time (new tap cleaning protocol, and improved waste water management).⁹¹ Wolf et al. also implemented tap replacement in response to patient colonisation with ESBLs found in the sink; siphons from sinks in the ICU including hand wash sinks were replaced with self-disinfecting siphons, samples taken for the eight months following installation were all negative.⁶⁴ The authors state hand wash sinks were also used to discard patient waste water and to rinse medical instrumentation prior to decontamination – it is not clear whether there was a change to this practice following the outbreak. There was no evidence identified in the literature to support a schedule of regular tap replacement outwith outbreak management.

Remodelling of sanitary and water supply systems such as installing newly designed shower drains with covers and replacing standard toilet bowls with rimless bowls was highlighted as a control measure in a German outbreak study.⁵¹ Rimless toilet bowls were also used as a measure in a CPE outbreak study; whilst a direct link from the toilets to patients could not be confirmed, the rimless bowls facilitated easier cleaning and therefore reduced the risk of a reservoir within the toilet.³⁷ Both UK [Health Building Note 00-10](#) and [Scottish Health Technical Memorandum 64](#) advise that hospital toilets should be rimless.^{148, 149} HBN 00-10 states that toilet seats

should not have a cover however if covers are to be considered, consultation should take place with the infection control team at the planning stage; toilet covers are typically not recommended for independent wheelchair and assisted toilets, as they prevent the use of the backrest.¹⁴⁹ There is no clear consensus in literature regarding aerosolisation/splash risk from flushed toilets and whether covers should be installed as standard; further research is required in this area. Practical issues for consideration include the need for regular cleaning/decontamination of toilet covers and associated parts (for example hinges). There may also be a requirement for anti-ligature fixtures and fittings.¹⁵⁴

Engineering controls to reduce the risk of contamination of water systems and thus subsequent onward transmission are covered in more detail in technical guidance published by Health Facilities Scotland.¹²⁰

Point-of-use filters

Point-of-use (POU) filters are frequently installed during outbreak management as a short-term control measure (see [“Should point-of-use \(POU\) filters be fitted in response to water-associated incidents/outbreaks?”](#)). However, they are sometimes used as a long-term solution to reduce transmission risk, outside of outbreaks.

Kinsey et al. installed POU filters to reduce the risk of transmission from contaminated tap water. In their NNU outbreak, patients had higher odds of having received care in a room with no POU filters installed on the sink tap during the seven days before positive *P. aeruginosa* culture (eOR, 37.55; 95% CI, 7.16–∞).³⁴

All 31 case patients were in rooms without POU filters during the seven days before positive *P. aeruginosa* culture, compared with 14 (45%) control patients. Further, [HTM 04-01](#) part C advises that unless water testing has shown absence of *P. aeruginosa* in augmented care units, water (and ice) should either be sterile or should be supplied through a POU filter which suggests long-term use of POU filters for certain water uses.¹⁴¹

Hand hygiene

Use of hand rub after hand washing has been implemented during outbreaks.^{34, 44} If there are ongoing concerns around water safety it could be used as a long-term approach to reducing risk of transmission from tap water. However, hand washing

rather than hand rub is required for outbreaks/incidents of spore-forming infectious agents (for example *Clostridioides difficile*) and gastrointestinal (GI) viruses (for example norovirus) therefore a full switch to hand rub should be assessed on a case-by-case basis, taking into consideration this additional risk.

Minimise patient exposure to tap water

Avoidance of tap water is frequently employed as a control measure during infection incidents until the contamination and/or transmission route can be removed. There is less evidence to inform tap water avoidance for prevention of infection incidents/outbreaks. There is inconsistency in current guidance regarding the use of tap water for specific patient groups. Republic of Ireland guidance advises that tap water may be used for washing adult and paediatric augmented care patients, provided there are no current incidents suggesting water system contamination.¹²⁸ HTM 04-01 Part C advises that only sterile water or water supplied through a point of use filter should be used for augmented care patients, unless the water has been shown to be free of *P. aeruginosa*.¹⁴¹ The CDC advises that tap water should be avoided for immunocompromised patients but this is specific to *Legionella* spp. only.⁹⁴ For neonatal units, HPSC Ireland advise that sterile water or saline should be used for washing non-intact or fragile skin of neonates, including nappy changes. Tap water can be used for bathing other high risk infants with intact skin and that do not require placement in a humidified incubator.¹²⁸

Republic of Ireland guidance advises that if a powdered infant formula feed is required, it should be prepared using boiled potable water in accordance with manufacturer's instructions.¹²⁸ There is consensus in UK and Republic of Ireland guidance that tap water should not be used in neonatal units for the process of defrosting frozen breast milk.^{128, 141} Frozen breast milk may be defrosted using a warming device, defrosted in a fridge, or defrosted at room temperature and any excess discarded. Milk must never be warmed by placing the container in tap water, unless the water has first been boiled.¹²⁸

[HTM 04-01 part C](#) further advises that single use cleaning wipes should be considered for patient hygiene on augmented care units; the guidance also advises that use of water for wet shaving and washing of patients should be reconsidered but there are no details provided for alternatives.¹⁴¹ The use of cleaning wipes is not

without risk; factory-level contamination with *P. aeruginosa* was responsible for more than 300 patient cases country-wide in Norway in 2022.¹⁴⁴

In response to a case of *Mycobacterium mucogenicum* in a bone marrow transplant patient, staff and patients were educated on safe showering to reduce CVC contamination (disconnecting IV catheters prior to bathing, covering connections with waterproof materials).³

In an US outbreak study, the ice machine was found to be the likely source for colonisation of 40 patients at a HIV ward.⁷⁵ There is inconsistency in UK and Republic of Ireland guidance about the use of ice making machines in high-risk units.^{128, 141} In two outbreak studies, ice used for treatment purposes (bronchoalveolar lavage, bronchoscopy) was linked to pseudo-outbreaks in immunocompromised patients.^{145, 146} Where ice is needed for treatment purposes, [HTM 04-01 Part C](#) advises it should be made using water obtained through a microbiological POU filter or boiling water in sterile ice trays or ice bags.¹⁴¹ HBN 00-09 'Infection Control in the Built Environment' advises that ice for consumption by immunocompromised patients should be made by putting drinking water into single-use ice-making bags and into a conventional freezer.¹⁵⁰ Republic of Ireland HPSC guidance advises that an automatic dispenser should be used and the use of open chest freezer storage compartments should be avoided.¹²⁸

Water-free care/removal of outlets

Complete unit-wide avoidance of tap water for patient care combined with or without removal of sinks as a preventative measure has been documented in three studies.^{110, 151, 152} Hopman et al. introduced 'water-free' patient care in a Dutch ICU in response to an outbreak of extended-spectrum β -lactamase (ESBL)-producing *Enterobacter cloacae*.¹⁵² All patient care related activities that take place in the patient room and that would normally involve the use of tap water were adapted to a 'water-free' alternative. Sinks were removed from patient rooms and hand washing was replaced with wipes followed by hand rub. Hair was washed with a rinse-free shampoo cap, bathing was carried out with moistened disposable wash gloves. Dental care and medicine preparation used bottled water. The overall gram-negative bacteria (GNB) colonisation rate significantly dropped from 26.3 to 21.6 GNB/1000 ICU admission days (colonisation rate ratio 0.82; 95% CI 0.67–0.99; P = 0.02). This

effect was more pronounced in patients with a longer length of stay. The ICUs had to purchase mobile handwash sinks to use in the event of a *C. difficile* outbreak, acknowledging the low efficacy of hand rub against spore-forming bacteria. In an American hospital, strict tap water avoidance where sinks remained in place across 4 ICUs was associated with a significant decrease in respiratory acquisition of NTM.¹⁵¹ The prevalence of positive environmental biofilm cultures for NTM was not significantly different over the study period, which provides support for the observed decrease in clinical acquisition being as a direct result of the intervention. Sterile water was used instead of tap water for routine care activities such as oral care, rinsing of suction catheters, and enteral tube irrigation. Patients were restricted from showering; bathing was performed with waterless bath products or sterile water. Ice use was avoided and not provided for consumption or patient care activities. A similar intervention was implemented in an attempt to control an Enterobacteriales outbreak in an Australian NICU; initially six of the eight sinks in the unit were decommissioned and all bathing was replaced with sterile water or disposable wipes, and handwashing replaced with hand rub.¹¹⁰ Prior to the outbreak, sinks were used for hand hygiene and to fill and empty baths for washing the less unwell infants. These interventions coincided with a decrease in cases of gram-negative colonisations/infections which was sustained. Following this, all sinks were removed (only unit entry and exit sinks remained), and the unit continues to have a minimal water use strategy in place (correspondence with author). [HTM 04-01 part C](#) recommends the permanent removal of existing outlets (for example showers and sinks) in settings where they are not being used.¹⁴¹ Scottish guidance recommends that the most effective management of showers will be achieved by the removal of unnecessary ones; no further detail is provided regarding removal of other outlet types.¹⁰¹ In a letter to the editor, an audit of shower utilisation across four wards (general medical ward, mixed medical speciality ward, mixed general acute ward, rehab ward) within two Scottish hospitals demonstrated an average daily non-use of showers of 86%.¹⁵³ The letter does not state the percentage of showers that were unused, but does indicate that the requirement for showers is low in these ward types. The authors argue for a move away from ensuite provision in all rooms, to provision of pre-determined shower facilities per ward (located out with patient rooms) in a bid to reduce the risk of plumbing system contamination and its associated burdens.

Further research, for example a pilot study of water-free (or reduced water) care in a Scottish setting, would be beneficial. Considerations for water-free care include the potential unintended harms resulting from disposal of wipes (for example blocked drains), use of mobile hand wash sinks, risk of infection from extrinsically contaminated water-free patient hygiene products, as well as consideration of patient dignity and comfort associated with water-free practices.

Environmental cleaning

HPSC Ireland advise that clinical wash hand sinks should be routinely cleaned in a manner that minimises the risk of contamination of the tap from organisms in the basin trap/drain.¹²⁸ [HTM 04-01 Part C](#) also advises this, stating that cleaning staff should be adequately trained to be aware of infection risks related to improper cleaning.¹⁴¹ As identified in "[What are the causes/sources of environmental contamination with healthcare water system-associated organisms?](#)" transmission can occur due to splashing from contaminated outlets therefore patient care equipment and patient care items should not be stored on or near sinks or other outlets. Kotsanas et al. highlighted improper sink drain cleaning whereby the same brush had been used to clean all the sink drains on the ICU, without disinfecting the brush between drains – this can facilitate spread and seeding of drains across a ward.⁶² In another outbreak study, it was found that contamination of surface cleaning equipment (for example cloths, mops and cleaning solutions) contributed to an outbreak of *P. aeruginosa*.⁴⁵ The [NHS Scotland National Cleaning Specification](#) provides instructions for cleaning sinks, wash hand basins and baths; it advises that new clean disposable cloths are used for separately cleaning the tap and the basin, however there are no instructions for cleaning taps fitted with POU filters.¹⁴⁷ The Cleaning Specification does not provide any information for cleaning staff regarding the risk of cross-contamination associated with cleaning.

This review identified the need to develop an effective method for drain decontamination for elimination of biofilm. Methods to disinfect drains such as pouring disinfectants down the drain, applying steam, or replacement of sink plumbing have had very limited success in eliminating biofilm from outlets.⁶² Decontamination of contaminated outlets is covered in "[Are there any recommended methods for the removal of healthcare water system contamination?](#)".

There is [existing guidance](#) in place to reduce the risk of contamination associated with dental unit waterlines.

28. What actions can be undertaken to reduce the risk of infection/colonisation associated with indirect water usage?

In total, 15 pieces of evidence were identified in relation to this research question which includes eight guidance documents that were deemed expert opinion (including two Scottish^{116, 117} and one British standard¹²⁶),^{94, 95, 116, 117, 126, 128, 141, 155} six outbreak studies^{1, 54, 73, 76, 80, 86, 144} and one case-control study.¹⁵⁶ According to the SIGN 50 methodology, one was graded level 2 evidence (case-control study),¹⁵⁶ six were graded level 3 evidence (six outbreak studies),^{1, 54, 73, 76, 80, 86} and eight were graded level 4 evidence (seven expert opinions).^{94, 95, 116, 117, 126, 128, 141, 155}

There are some limitations to the evidence that is included in this research question. The evidence is mainly low quality (14 out of the 15 studies are either level 3 or level 4) and the guidance documents that were deemed expert opinion lack a rigorous search and/or methodology while developing the guidance. Additionally, there are a few outbreak studies included which creates a potential risk of publication bias as not all outbreaks/infection incidents are published in scientific journals.

Indirect water usage refers to coming into contact with water through other means, for example via contaminated equipment, contaminated environment or water-based equipment and thus transmission occurs through indirect contact. The available evidence is summarised within different categories below including clinical control measures (for example use of sterile water), management of the care environment (for example splash risk, the risk of refillable spray bottles), management of patient equipment (for example endoscopes, HCUs, incubators) and decontamination processes.

Clinical control measures

Contaminated mains water and associated outlets have been highlighted as sources for contamination in multiple outbreak studies (See "[What are the known transmission routes of water system-associated organisms in healthcare settings?](#)"). For all patient groups, Republic of Ireland guidance advise that only sterile water

must be used when water is required for administering any medication or treatment requiring water for example intravenous medications, nebulisers.¹²⁸

A closed system must be used for infants that require therapeutic cooling; sterile water must be used in the system.¹²⁸

Management of the care environment

Splash risk from contaminated outlets has been highlighted as a risk factor in multiple outbreak studies (See "[What are the known transmission routes of water system-associated organisms in healthcare settings?](#)"). UK guidance advises that preparation areas for aseptic procedures and drug preparation and any associated sterile equipment should not be located where they are at risk of splashing or contamination from water outlets.¹⁴¹ Further, it is advised that all surfaces on which aseptic procedures are to be performed are decontaminated prior to commencing a procedure. The British Standards Institute also advises that items of equipment and drug and food preparation areas should be in a location that splash contamination cannot occur.¹²⁶ It may be appropriate to consider removal of sinks altogether in these areas where this is possible, to eliminate the risk altogether.

Preparation of refillable disinfectant-detergent spray bottles with contaminated tap water was linked to a *P. aeruginosa* and *P. putida* outbreak in a paediatric haemato-oncology unit, the disinfectant-detergent spray was being used to clean perfusion bottles and the laminar flow hood prior to preparation of parenteral perfusions.⁵⁴ The refillable spray bottles were replaced with ready-to-use bottles and no further cases were detected in the subsequent two-year period. CDC guidance (graded SIGN50 level 4) advises against the use of refillable fluid containers (for example spray bottles used for cleaning).¹²⁸ The risk with refillable spray bottles is the difficulty to effectively decontaminate and dry all parts prior to reuse, therefore they may act as a reservoir for contamination. There was no published literature describing infection incidents/outbreaks in non-acute settings linked to reusable spray bottles. However, non-acute settings typically do not have surveillance systems in place and are reliant on case ascertainment to detect water system-associated incidents.

Management of patient equipment

As outlined in “[What are the known transmission routes of water system-associated organisms in healthcare settings?](#)”, indirect transmission can occur from contaminated patient equipment (for instance surgical devices, nebuliser cups, suction apparatus for ventilated patients), diagnostic equipment (for example bronchoscopy, ERCP), aspiration tubes for neonates, patient feeding items including containers for nutrition solutions, tube feeding equipment and milk bottles. HPSC Ireland specifically recommends that medical equipment and patient care equipment should not be placed in, or washed in, clinical wash hand basins.¹²⁸ Healthcare equipment (non-invasive) should be cleaned, decontaminated, dried and stored in accordance with local policy and based on manufacturer’s instructions.¹²⁸ The NIPCM provides guidance for management of patient care equipment in [Chapter 1](#). Republic of Ireland guidance and UKHSA guidance¹⁵⁵ regarding the management of humidified incubators states that sterile water should be used for humidified incubators and the reservoir and water should be changed daily.¹²⁸ Reusable water reservoirs of humidified incubators must be sterilised between uses in a central decontamination unit. Republic of Ireland provides advice regarding maintenance of non-humidified incubators stating they must be completely dismantled, cleaned, decontaminated and thoroughly dried before being used again as per locally agreed procedure; sterile water is not required for this process.¹²⁸ UK guidance advises that detergent wipes are suitable for cleaning incubators.¹⁴¹ An outbreak of *Klebsiella pneumoniae* in a French NNU identified contaminated incubators and incubator mattresses. Steam cleaning of the mattresses resulted in residual moisture which is likely to have supported ongoing contamination.⁸⁰ The decontamination policy for mattresses switched to chemical disinfection without steam cleaning which coincided with no further cases detected but low level contamination of incubators and mattresses persisted.

Republic of Ireland guidance advises that sterile water must be used for humidifiers in ventilator circuits and continuous positive airway pressure (CPAP) units.¹²⁸

Decontamination processes

Endoscopes (bronchoscopes, duodenoscopes) and automatic endoscope reprocessors (AERs) have been involved in a number of outbreaks and incidents in healthcare settings.^{1, 73, 86, 156} Nine patients were identified in a pseudo-outbreak of *Mycobacterium fortuitum* following contamination of bronchoscopes with contaminated mains water.¹ The bronchoscope washer disinfectant did not have a terminal filter, and the water supplying the machine was not filtered. It is essential to ensure that endoscopes are adequately decontaminated to avoid transmission of infectious agents to patients. Further guidance is provided in “NHSScotland Guidance for the interpretation and clinical management of endoscopy final rinse water”.¹¹⁷

Cardiac Heater Cooler Units (HCUs) are a known potential reservoir of healthcare water system-associated organisms that can indirectly infect patients undergoing cardiac surgery⁹⁵ and for this reason, specific guidance on operational procedures covering decontamination of heater cooler units used during cardiac surgeries, microbiological testing and associated actions based on water and air results is available - see NHSScotland [Guidance for Decontamination and testing of Cardiac Heater Cooler Units \(HCUs\)](#).¹¹⁶

Washing neonatal clothing in a domestic washing machine led to transmission of *Klebsiella oxytoca* to new-borns; the washing machine parts (for example detergent drawer, rubber sealant) were found to be contaminated and may have provided the conditions for biofilm growth.⁷⁶ Specific details regarding the laundering of healthcare linen is covered in the [NIPCM safe management of linen literature review](#) and [National Guidance for Safe Management of Linen in NHSScotland Health and Care Environments - For laundry services/distribution](#).

29. What actions can be undertaken to facilitate the earliest possible detection and preparedness for clinical cases of water-associated colonisation or infection?

There is limited evidence available regarding actions that can be undertaken to facilitate earliest possible detection and preparedness for clinical cases of water-associated colonisation or infection. In total, six pieces of evidence were identified

which includes one Scottish guidance document,¹²⁷ one outbreak study,⁴⁷ one surveillance study,⁸² one British Standard¹²⁶ and two other guidance documents.^{128, 131} All guidance documents were deemed to be expert opinions due to the lack of a rigorous search and/or methodology in developing the guidance. In accordance with SIGN 50 methodology, two were graded level 3 evidence (one outbreak study,⁴⁷ one surveillance study⁸²) and the four expert opinions were graded level 4 evidence.^{126-128, 131}

English and Scottish guidance agree that significant changes in monitored microbiological levels of water test results can provide an early identification of water contamination.^{126, 127, 131} Besides microbiological surveillance of water test results, surveillance of clinical samples could also aid in the early detection of colonisation/infection of water-associated organisms.⁴⁷ In absence of an outbreak, Zhou et al prospectively monitored patients for *P. aeruginosa* colonisation/infection in two surgical ICUs by active screening (also environmental screening when *P. aeruginosa* was isolated from clinical samples) to gain knowledge of the sources and patterns of *P. aeruginosa* colonisation/infection.⁸² This can be beneficial for designing optimal infection prevention and control strategies. Republic of Ireland guidelines mention that the IPC team should have an active surveillance programme in place in each healthcare facility to detect alert organisms, clusters of infection, outbreaks, unexpected antimicrobial resistance mechanisms and unexpected infections.¹²⁸ Patient isolates of gram-negative bacteria (for example *P. aeruginosa*, *Acinetobacter* spp., *Stenotrophomonas maltophilia* and *Serratia marcescens*) from high-risk units and isolates of *Legionella* spp. from all care settings should be monitored as alert organisms as per [appendix 13 of the NIPCM](#).¹²⁸ As detailed in the section "[Which organisms associated with healthcare water systems are responsible for colonisation/infection of patients?](#)", there are many organisms associated with healthcare water systems that can pose a clinical risk.

Being alert to the possibility that immunocompromised patients (see "[Which patient populations are considered as being at increased risk of colonisation/infection with a healthcare water system-associated organism?](#)") are at increased risk of colonisation/infection could also contribute to the early detection and preparedness for clinical cases. Good communication processes between IPC teams, laboratories,

estates and facilities teams and WSG will help ensure earliest possible identification and preparedness for clinical cases of water associated colonisation or infection.

3.1.3 Outbreak/incident management

30. How should water-associated incidents be assessed and reported locally and nationally?

Very limited evidence was found in relation to this research question. In total, two pieces of evidence were included which consists of one Scottish guidance document that was deemed to be expert opinion¹⁵⁷ and an independent report from Northern Ireland, both graded SIGN50 level 4.¹⁵⁸

The “Management of Public Health Incidents: Guidance on the Roles and Responsibilities of NHS Led Incident Management Teams” which is applicable to Scotland advises that following detection/recognition of an incident, the IPC team or HPT team should undertake an initial risk assessment. Limited detail of this risk assessment is provided in the guidance.

Following a series of *P. aeruginosa* outbreaks at four neonatal units in Northern Ireland, an independent report concluded that single cases of *P. aeruginosa* should be assessed in neonatal intensive care and high dependency units and possible causes investigated.¹⁵⁸ The independent report, although specific to neonatal cases of *P. aeruginosa*, recommended a nationally agreed approach to reporting of infection incidents.

At the time of writing, an assessment tool to undertake a risk assessment is provided within Chapter 3 of the NIPCM, in the form of the Healthcare Infection Incident Assessment (HIIAT) tool. The guidance in Chapter 3 of the NIPCM is in line with the “Management of Public Health Incidents: Guidance on the Roles and Responsibilities of NHS Led Incident Management Teams”¹⁵⁷ and is informed by a systematic literature review on [healthcare infection incidents and outbreaks in Scotland](#). The HIIAT tool supports assessment of the impact of a healthcare infection incident/outbreak on patients, services and public health. It also indicates the national communication and reporting that is required based on the risk assessment.

31. What are the water testing requirements during a water-associated incident/outbreak?

There is limited guidance available regarding water testing requirements during a water-associated incident/outbreak. Three guidance documents were identified to inform recommendations on this subject which includes one Scottish guidance document,¹⁰¹ one British Standard¹¹⁸ and one guidance document from the Republic of Ireland.¹²⁸ All were deemed to be expert opinions due to the lack of a rigorous search and/or methodology in developing the guidance and in accordance with SIGN50 methodology, these three expert opinions were graded level 4 evidence.^{101, 118, 128}

In general, the principles are similar to those described previously for routine water testing and are also covered in relevant guidance for instance [BS 7592:2022 Sampling for Legionella bacteria in water systems – Code of practice](#), [BS EN ISO 19458:2006 Water quality – Sampling for microbiological analysis](#) and [Scottish Health Technical Memorandum 04-01: Water safety for healthcare premises: Part C: TVC Testing Protocol](#). It is recommended by Scottish guidance, Republic of Ireland guidance and relevant British Standards to increase routine water testing during a suspected or confirmed outbreak or if surveillance identifies an increased incidence of infection.^{101, 118, 128}

An overall investigation plan, which includes sampling, should be drawn up by the outbreak investigation team to identify and prioritize potential sources taking account of the geographical distribution of the infected cases.^{118, 128} If the cases are clustered to a specific area, initial efforts should be concentrated on potential sources within that area.¹¹⁸ Scottish guidance mentions that the outbreak investigation team may request that water samples are taken before any emergency disinfection is undertaken.¹⁰¹

Republic of Ireland guidelines mention that in the event of a suspected outbreak, additional testing by swabbing water outlets to obtain strains for typing may provide a means of assessing a water outlet, but this does not replace water sampling (see [“What are the environmental testing requirements during a water-associated incident/outbreak?”](#)).¹²⁸

It is also recommended to use pre-flush samples as these represent the water the patient would have been exposed to.¹¹⁸ If contamination is detected in the pre-flush samples, differentiation between local and systemic colonisation can be achieved by collecting post-flush samples and comparing bacterial counts between pre-flush and post-flush samples.^{118, 128}

32. What are the environmental testing requirements when investigating healthcare water system-associated incidents/outbreaks?

In total, 21 pieces of evidence were identified in relation to this research question which includes 14 outbreak studies,^{16, 19, 34, 42, 48, 50, 57, 61-63, 66, 69, 70, 76} five guidance documents categorised as expert opinion (including one Scottish,¹⁰⁴ one English¹³¹, one from the Republic of Ireland,¹²⁸ one international guideline⁹⁴ and two British Standards^{118, 126}) and one surveillance study.⁸¹ In accordance with SIGN 50 methodology, 15 were graded level 3 evidence (14 outbreak studies,^{16, 19, 34, 50, 57, 61, 63, 66, 69, 70, 76} one surveillance study⁸¹) and six were graded level 4 evidence (six expert opinions^{104, 118, 126, 128, 131}).

There are some limitations to the evidence that is included in this research question. The evidence is mainly low quality (all 21 studies are either level 3 or level 4) and the guidance documents that were deemed expert opinion lack a rigorous search and/or methodology while developing the guidance and often refer to the same references/guidance. Moreover, the CDC guidelines are mostly based on studies published pre-2000 which is a limitation as it might not reflect current IPC practices.⁹⁴ Additionally, there are numerous outbreak studies included (14 out of the 21 studies) which creates a potential risk of publication bias as not all outbreaks or infection incidents are published in scientific journals and therefore there is the possibility that the evidence may not fully reflect what is being seen in practice.

Water system-associated organisms are commonly found in moist areas and have been associated with environmental reservoirs in hospitals.^{126, 128} As mentioned previously in [“What are the known transmission routes of healthcare water system-associated organisms in healthcare settings?”](#), transmission of healthcare water system-associated organisms can occur via direct and indirect contact as well as

aerosolisation. Therefore, removing contaminated environmental reservoirs could limit the exposure and transmission to vulnerable patients thus preventing prolonged outbreaks.¹²⁸

Environmental sampling is advised when investigating the source of hospital acquired cases and/or outbreaks.^{94, 104, 118, 131} An overall investigation plan should be drawn up by the outbreak investigation team to identify and prioritize potential sources taking account of the geographical distribution of the infected cases.^{118, 126, 128} Where several infected people have visited one particular location or received one particular procedure, this area and/or the used equipment should be the focus of initial investigations. The number of samples to collect is therefore difficult to assess in advance as this is dependent on the nature and size of the outbreak and thus the available epidemiological information should continually be reassessed and updated.¹¹⁸

Where possible, it is recommended to compare patient isolates with the environmental samples to investigate the potential source of the infection and modes of transmission of the organism(s).^{94, 104, 126, 128} To do so, the CDC advises to analyse the samples to species level at a minimum but beyond if possible. The British Standards Institution mentions in [BS 8580-2:2022](#) that molecular typing is crucial to understand if transmission has occurred and to support interventions to prevent further transmission.^{104, 126} However, if typing results do not match, it does not exclude the water system as a source of infection as environmental outbreaks can be polymicrobial and/or polyclonal.¹²⁶ It is not uncommon for environmental sampling to reveal multi-organism contamination of an outlet (for example a sink drain) suggestive of a biofilm which may only be microbiologically linked to a patient by a single organism isolate.⁸¹ This highlights the complex nature of biofilms which can pose challenges to the interpretation of environmental sampling during outbreak studies. Picking and typing of several isolates from cultures increases the likelihood of detecting the relevant hazard.

Several outbreak studies reported successful containment of an outbreak after environmental sampling revealed the environmental source(s).^{16, 19, 34, 42, 48, 57, 61, 63, 66, 69, 70, 76} Exposed sources linked to nosocomial cases included among others a washing machine, faucet aerator, sinks, chilled water dispenser, dialysis station wall boxes, siphons and drains. Although outbreak studies are generally considered as

low quality evidence, here they demonstrate the positive effect of environmental sampling in revealing the source and contributing to control the outbreak. However, environmental sampling can be challenging, for example due to resource limitations, and may not always provide clear evidence regarding the source or transmission mode in an incident/outbreak and thus typing, including whole genome sequencing, should be used to include but not exclude a source.

The species responsible for colonisation/infection in the patient may be an indicator for where to direct environmental sampling. As evidenced in the research question [‘What are the causes/sources of environmental contamination with healthcare water system-associated organisms?’](#), Enterobacteriaceae and *Pseudomonas* species are typically identified at the distal outlet/within drainage systems therefore environmental sampling (swabbing) of sink and shower drains and associated pipework may assist in identifying an environmental reservoir. In an outbreak involving CRE *Klebsiella pneumoniae*, five patients who had no overlap in hospital stay but were admitted to the same single room, were found to have the same outbreak strain which was genetically matched to the organism found in the sink and shower drain of the room.⁴² In another report, the genotypic diversity of patient isolates in an outbreak involving 43 patients was an indicator that a single common source was not responsible. Environmental sampling revealed that a third of the sink drains in the haematology ward harboured ESBL-producing *E. cloacae*; all water samples were negative.⁴⁸ Similarly, a cluster of CRE outbreaks occurring over a 30 month period at an ICU were linked to sink drains where *S. marcescens* was recovered persistently, even after six attempts to decontaminate the drains of eight of the 11 central sinks in the ICU.⁶² Tap spout and water cultures were negative for CRE. All patient cases were negative on admission.

In addition to source investigation, guidance from PHE and CDC recommend that environmental sampling can be used to verify the impact of cleaning procedures or other infection-control measures.^{94, 131} However, incorporating this into business-as-usual could have significant logistical and cost implications.

To summarise, environmental sampling is advised during a water-associated incident/outbreak. To help with the identification and prioritising of sources, an investigation plan should be developed; the species responsible for patient

colonisation/infection may direct sampling efforts to focus on specific locations (for example drains and associated pipework for Enterobacteriaceae). Molecular typing can be a valuable tool to compare patient and environmental isolates and ideally several isolates should be analysed to increase the chance of identification. Due to the challenges associated with molecular typing, it should only be used to support confirmation of a source and not to exclude it.

33. How and by whom should water-associated incidents be investigated?

In total, two pieces of evidence were identified and all three are guidance documents categorised as expert opinion.^{128, 157} [Chapter 3 of the NIPCM “Healthcare Infection Incidents, Outbreaks and Data Exceedance”](#) outlines how a healthcare incident or outbreak should be investigated and is in line with the “Management of Public Health Incidents: Guidance on the Roles and Responsibilities of NHS Led Incident Management Teams”.¹⁵⁷ Detailed information on how to conduct the investigation, as well as relevant templates, checklists and other tools are available in the NIPCM Chapter 3. The NIPCM literature review regarding healthcare infection incidents and outbreaks in Scotland ([Version 2.0, June 2022](#)) covers the investigation and management of healthcare infection incidents and outbreaks in hospital/acute settings.

It is the responsibility of the NHS board to establish whether an IMT is necessary to further investigate a healthcare infection incident.¹⁵⁷ The IMT is a multi-disciplinary, multi-agency group with responsibility for investigating and managing the incident and its membership will vary depending on the nature of the incident, but will normally include a NHS board Chair, HP team representatives, IPC team representatives, other relevant clinical staff, a communications officer and administrative support.¹⁵⁷ It is essential that Estates and Facilities staff are included in IMTs for incidents involving the built environment. In a healthcare setting, the IMT can be chaired by suitably experienced staff, for example the consultant in public health medicine (CPHM) or the Infection Control Doctor (ICD), depending on the circumstances and this should be agreed in advance and documented in the incident/outbreak plan.¹⁵⁷ As part of the IMT, a case definition(s) must be established. In addition, ongoing data relating to epidemiological and microbiological

investigations should be received and discussed, as well as any necessary control measures.^{128, 157}

Specific to water associated incidents, investigations should also consider how water is used in the clinical areas where the patient has been cared for, how water was used by the patient and healthcare workers, the history of invasive device use, including antibiotic administrations and how drugs, particularly IV drugs, are prepared in the clinical area.¹²⁸

34. Should point-of-use (POU) filters be fitted in response to water-associated incidents/outbreaks?

In total, 15 pieces of evidence were identified in relation to this research question which includes nine guidance documents that were deemed expert opinion (including three Scottish,^{101, 120, 159} three English,^{129, 130, 141} one British Standard¹²⁶ and one from Republic of Ireland¹²⁸), six outbreak studies,^{2, 8, 34, 51, 54, 77} and one before and after study.¹⁶⁰ In accordance with SIGN 50 methodology, seven were graded level 3 evidence (six outbreak studies,^{2, 8, 34, 51, 54, 77} one before and after study¹⁶⁰) and eight were graded level 4 evidence (eight expert opinions^{101, 120, 126, 128-130, 141, 159}).

All studies included to answer this research question are low quality evidence, either level 3 or level 4. The guidance documents included are all deemed expert opinion (level 4) due to the lack of a rigorous search and/or methodology while developing the guidance and often refer to the same references and guidance. Moreover, by including outbreak studies (6 out of 15) there is a potential risk of publication bias as not all outbreaks/infection incidents are published in scientific journals.

Point-of-use (POU) filters are primarily recommended as a temporary control measure while awaiting a permanent safe engineering solution, although long-term use may be needed in some situations when there is no effective alternative.^{126, 128-130} The installation and use of POU filters, including procedures for fitting, changing and cleaning filters should be agreed by the WSG and documented.^{126, 130, 159} It is recommended to record the start date and lifespan of the POU filters installed and to replace them according to the manufacturer's recommendations.¹²⁹ The English and Scottish Health Technical Memorandums on operational management add to this that changing POU filters should be done at least once monthly and [SHTM 04-01](#)

[part A](#) mentions that the frequency depends on the usage of the outlets.^{101, 120, 130}

However, for certain POU filters manufacturer's instructions could recommend a frequency exceeding 30 days in which case the changing frequency might be extended.

A POU filter is defined in English guidance as a filter with a maximal pore size of 0.2 µm applied at the outlet, which removes bacteria from the water flow.^{129, 130, 141} Filters that are effective barriers of healthcare water system-associated organisms range in size from 0.2 µm to 0.65 µm.¹²⁸ Most guidance, including two UK codes of practice, recommend filters with a pore size no greater than 0.2 µm,^{126, 128-130, 141} but the Scottish Health Technical Memorandum recommends a pore size of 0.1 µm or less.¹²⁰ Scottish guidance warns that filters do not eradicate the organism, but prevent discharge to the environment from the filtered outlet only and that it may be possible for the organisms to multiply and regressively 'seed' other parts of the distribution system when retaining the organism within the pipework.¹²⁰

Installation of POU filters should be subject to risk assessment and domestic staff and ward staff should be aware of the associated risks of installation, cleaning and removal of POU filters.¹²⁶ These risks include poor flow from filters which increases the likelihood of removal and a false sense of security which could result in reduced compliance with other prevention measures such as regular flushing, hand hygiene and safe discarding of contaminated fluids.¹²⁶ Cross-contamination is also a serious risk and can occur due to poor fitting allowing leakage around the fitting or by removing, changing or cleaning POU filters when retained organisms get released and resulting in re-seeding of the environment.^{126, 141} Therefore, POU filters should not be re-attached once removed.¹²⁶ Appropriate training of staff is necessary and manufacturer's instructions should be followed at all times.^{101, 130}

The use of POU filters has mostly been mentioned in the literature as part of a bundled approach of IPC measures and therefore it is difficult to determine which measure was responsible for the impact.^{2, 8, 51, 54} However, a few outbreak studies reported specifically that the use of POU filters resulted in the control of the outbreak.^{34, 77} In a neonatal ICU, POU filters provided a short-term solution during a *P. aeruginosa* outbreak attributed to hospital tap water. This study included a case-control element and showed that patients receiving care in a room without POU filters installed had significantly higher odds to be infected with *P. aeruginosa*.³⁴ In

another outbreak study of invasive fusariosis in a children's cancer hospital, multiple control measures were tried before POU filters were installed 1 year after the first case and the outbreak was finally controlled.⁷⁷ Moreover, a before-and-after study looked at the intervention of POU filters and compared the infection rate before and after the installation of the POU filters.¹⁶⁰ POU filters were shown to be effective and a significant reduction (56%, $P < 0.0003$) of chronically endemic *P. aeruginosa* infections was measured on a surgical ICU.¹⁶⁰

In summary, POU filters can be used in response to water-associated incidents/outbreaks. However, guidance suggests that their risks needs to be considered in a risk assessment before installation and the WSG should agree on their installation and use.

35. When can POU filters be removed?

In total, six pieces of evidence were identified in relation to this research question which includes two Scottish guidance documents,^{101, 159} one British Standard,¹²⁶ one guidance document from the Republic of Ireland¹²⁸ and two other UK guidance documents.^{129, 130} All included guidance documents were deemed to be expert opinion and in accordance with SIGN 50 methodology, these six expert opinions were graded level 4 evidence.^{101, 126, 128-130, 159} The lack of high quality evidence is a limiting factor for answering this research question.

Since extant guidance recommends that POU filters are fitted in response to water associated outbreaks while awaiting a permanent solution, this suggests that removal is only appropriate when this permanent solution has been installed.^{126, 128-130} Guidance do not specifically mention when exactly the POU filter can be removed, only that its removal would be a clinical decision and that amendments to plumbing and taps should have been made. The [British Standard 8580-2:2022](#) recommend that pre-determined criteria for when filters can be removed should be in place and Scottish guidance recommend that the WSG will have to confirm that they are satisfied that the affected outlet and pipework can be removed or disinfected without compromising the rest of the water.^{126, 159}

It is important to note that where POU filters are no longer required, the outlet and associated pipework should be cleaned and disinfected to remove any accumulated

debris before the system is returned to service. Manufacturer's instructions should be followed at all times.^{101, 130}

3.1.4 Organisational Management:

36. Whose responsibility is it to carry out any of the above actions?

In total, five pieces of evidence were identified including two Scottish guidance documents,^{101, 159} one British Standard,¹²⁶ one guidance document from the Republic of Ireland¹²⁸ and one English guidance document.¹³¹ All included guidance documents were deemed to be expert opinion and in accordance with SIGN50 methodology, these five expert opinions were graded level 4 evidence.^{101, 126, 128, 131, 159} Regarding the responsibilities within Scottish health and care settings, it is appropriate to only include Scottish/UK guidance documents and thus not having wider evidence is not a limitation.

Full description on roles and responsibilities within NHSScotland regarding water safety for healthcare premises can be found in [SHTM 04-01, Part B: Operational management](#). Within NHS boards, SHTM 04-01 and British Standards Institute guidance recommend that a multidisciplinary team (Water Safety Group) needs to be appointed to carry out risk assessments and develop a water safety plan (WSP) to manage the identified risks associated with water.^{101, 126} WSGs will be led and chaired, as a minimum, by the Responsible Person (Water) who will ensure that responsibility is taken for microbiological hazards and are identified by appropriate Group members.¹⁰¹ They will assess risks, identify and monitor control measures and develop incident protocols.¹⁰¹ The WSG should be a sub-group of and report to the Chair of the hospital Infection Control Committee and ensure a coordinated approach exists between Infection Prevention and Control Teams, clinical staff and Estates & Facilities on all water issues including the communication of positive environmental and water test results to the appropriate staff and teams.¹⁰¹ There should be a clear line of responsibility to the Chief Executive Officer (CEO).¹⁰¹

The WSG should have oversight regarding flushing responsibilities and agree frequencies for each area – operationally this may be the Senior Charge Nurse, Clinical Lead, Domestic staff or Estates and Facilities (See "[Who should be responsible for flushing?](#)").

Scottish guidance advises that the WSG (which includes the Infection Control Manager, the Infection Prevention and Control Doctor and the Consultant Microbiologist) should advise on infection control policy (in agreement with the IPC team) and are responsible for the maintenance of water quality from the point it leaves the tap.¹⁰¹

English and Republic of Ireland guidance mention that sampling should be undertaken by appropriately trained staff to minimise contamination whereas testing should be carried out by a laboratory that is UKAS-accredited to perform the specified test.^{128, 131} More information on the organisational structure for NHS boards for the management and control of risk from potential exposure to *Legionella* spp., *Pseudomonas* spp. and other similar harmful bacteria can be found in [SHTM 04-01 part G: Operational procedures and Exemplar Written Scheme](#).¹⁵⁹

3.2 Implications for research

This systematic literature review has identified gaps in literature in various subjects regarding IPC related aspects/impacts of the healthcare water system. More research and/or separate pieces of work are required to ascertain: safe use of drains in terms of IPC, safe commissioning, incubation periods for water system-associated organisms, infectious doses of organisms, design features that limit transmission of organisms from their source and reservoir to external surroundings, water testing methodologies and techniques, methodology and interpretation of environmental sampling tests. Moreover, dental units were not extensively mentioned in this review as this is covered by a separate piece of work "[Literature Review and Recommendations: Management of Dental Unit Waterlines](#)" which covers the management (including decontamination) of dental unit waterlines for the prevention of HAI in general dental practices, community dental clinics and dental hospitals waterlines.

Much of the evidence base in this literature review is composed of outbreak investigation studies where infection control strategies are bundled together making it difficult to determine which intervention(s) was/were responsible for successfully ending the outbreak. More research on single interventions would be beneficial to strengthen the evidence base. This includes water-free care and within this review it

has been highlighted that a pilot study undertaken in a Scottish ICU or NNU to trial water-free care with removal of sinks/outlets would be beneficial. More primary research for non-acute settings is also required. Overall, improved publication of outbreak studies and their management and resolutions would increase the tools for controlling and mitigating risk of water system-associated infections.

Limited robust literature was identified by this review regarding the incubation period and the period of communicability of water system-associated organisms, although there is acknowledgement that transmission can take place as long as the source is present. The incubation period is difficult to determine without the knowledge of the source and time of exposure. Investigations should be carried out to examine the potential incubation period and the linkage to organisms.

It has been mentioned by experts that the interpretation of TVC test results is difficult and that more research is needed to inform recommendations. A pilot study in an NHS health board would be useful to create a baseline for TVC monitoring. Within this pilot study, regular TVC samples should be collected, interpreted and compared with wider microbiological testing results to establish any link between results. This would help in understanding the value of TVCs and could lead into a new suite of guidance that includes among others the testing frequency, number of samples needed, sample locations and microbiological limits. There is no clear consensus in literature regarding aerosolization or splash risk from flushed toilets and whether covers should be installed as standard. Further research is required in this area as toilet covers and associated parts (for example hinges) can give rise to other contamination issues.

Moreover, there is a clear gap in literature regarding accredited testing and microbiological water testing requirements at commissioning. Limited UKAS accredited tests are available for environmental organisms. Regarding testing requirements at commissioning, guidance states that water samples are obtained as standard practice at water system commissioning to ensure a safe handover of the water system from the contractor. However, the water testing requirements and appropriate microbiological parameters are not specified. This must be agreed prior to tender, but advice on the sampling regime and microbiological parameters would be very valuable. Therefore, more research and inclusion of commissioning in

current guidance or the development of new guidance is needed especially regarding specific microbiological water testing requirements.

In a non-systematic review, it was discussed that many of the sinks involved in outbreaks do not adhere to the recommended standards despite the fact that sink design is the primary driver behind sink-related healthcare water system-associated infections. This could be due to the age of healthcare facilities and the high expense of retrofitting.¹⁶¹ However, it does reflect the overlooked importance of IPC in healthcare design and this can be addressed in further research and guidance into design elements of healthcare facilities. Education on the importance of water management is also essential for awareness and understanding compliance of healthcare staff including clinicians, which was highlighted in an outbreak study on Legionnaires' disease.²

It is also important to note that there is a range of other environmental organisms that cause a risk to vulnerable patients in addition to water system-associated organisms as their optimum environment are warm damp areas. These organisms may not be directly found in water but can be found in moist areas such as showers (walls, basins), external parts of taps or shower outlets and near leaks or splashes. Opportunistic fungi such as *Aspergillus* spp. have been reported to be present in environmental water sampling.¹⁶² The primary mode of nosocomial transmission is thought to be via airborne spores, but moulds can reside in water sources within the hospital and aerosolise after water activities.^{163, 164} For example, *Aspergillus fumigatus* was recovered from a shower wall in a patient's room that matched the clinical *A. fumigatus* strain of the occupying patient.¹⁶⁵ Conversely, water system-associated organisms such as *P. aeruginosa* can be transmitted through the air which was shown by an environmental surveillance study in a UK cystic fibrosis (CF) centre revealing that 80% of the air samples inside the patient's room were positive for the endemic strain and *P. aeruginosa* was still detected in the air for one to three hours after patients' discharge.¹⁶⁶ More research is required to determine whether these air samples are viable and whether there is an associated exposure risk.

References

1. Campos-Gutierrez S, Ramos-Real MJ, Abreu R, et al. Pseudo-outbreak of *Mycobacterium fortuitum* in a hospital bronchoscopy unit. *American Journal of Infection Control* 2020; 48: 765-769.
2. Francois Watkins LK, Toews KAE, Harris AM, et al. Lessons from an Outbreak of Legionnaires' Disease on a Hematology-Oncology Unit. *Infection Control and Hospital Epidemiology* 2017; 38: 306-313.
3. Kline S, Cameron S, Streifel A, et al. An outbreak of bacteremias associated with *Mycobacterium mucogenicum* in a hospital water supply. *Infection Control and Hospital Epidemiology* 2004; 25: 1042-1049.
4. El Sahly HM, Septimus E, Soini H, et al. *Mycobacterium simiae* pseudo-outbreak resulting from a contaminated hospital water supply in Houston, Texas. *Clinical Infectious Diseases* 2002; 35: 802-807.
5. Bedard E, Levesque S, Martin P, et al. Energy Conservation and the Promotion of *Legionella pneumophila* Growth: The Probable Role of Heat Exchangers in a Nosocomial Outbreak. *Infection Control & Hospital Epidemiology* 2016; 37: 1475-1480. Research Support, Non-U.S. Gov't.
6. Conger NG, O'Connell RJ, Laurel VL, et al. *Mycobacterium simiae* outbreak associated with a hospital water supply. *Infection Control & Hospital Epidemiology* 2004; 25: 1050-1055.
7. Baker AW, Lewis SS, Alexander BD, et al. Two-phase hospital-associated outbreak of *Mycobacterium abscessus*: Investigation and mitigation. *Clinical Infectious Diseases* 2017; 64: 902-911.
8. Kessler MA, Osman F, Marx J, Jr., et al. [Hospital-acquired Legionella pneumonia outbreak at an academic medical center: Lessons learned.](#) *American journal of infection control* 2021; 49: 1014-1020.
9. Inkster T, Peters C, Seagar AL, et al. Investigation of two cases of *Mycobacterium chelonae* infection in haemato-oncology patients using whole-genome sequencing and a potential link to the hospital water supply. *J Hosp Infect* 2021; 114: 111-116. 2021/05/05. DOI: 10.1016/j.jhin.2021.04.028.

10. Garvey MI, Bradley CW and Holden E. Waterborne *Pseudomonas aeruginosa* transmission in a hematology unit? *American Journal of Infection Control* 2018; 46: 383-386.
11. Garvey MI, Bradley CW, Tracey J, et al. Continued transmission of *Pseudomonas aeruginosa* from a wash hand basin tap in a critical care unit. *Journal of Hospital Infection* 2016; 94: 8-12.
12. Regev-Yochay G, Smollan G, Tal I, et al. Sink traps as the source of transmission of OXA-48-producing *Serratia marcescens* in an intensive care unit. *Infection control and hospital epidemiology* 2018; 39: 1307-1315.
13. Tissot F, Blanc DS, Basset P, et al. New genotyping method discovers sustained nosocomial *Pseudomonas aeruginosa* outbreak in an intensive care burn unit. *Journal of Hospital Infection* 2016; 94: 2-7.
14. Stjerne Aspelund A, Sjostrom K, Olsson Liljequist B, et al. Acetic acid as a decontamination method for sink drains in a nosocomial outbreak of metallo-beta-lactamase-producing *Pseudomonas aeruginosa*. *Journal of Hospital Infection* 2016; 94: 13-20.
15. Knoester M, de Boer MGJ, Maarleveld JJ, et al. An integrated approach to control a prolonged outbreak of multidrug-resistant *Pseudomonas aeruginosa* in an intensive care unit. *Clinical Microbiology and Infection* 2014; 20: O207-O215.
16. Schneider H, Geginat G, Hogardt M, et al. *Pseudomonas aeruginosa* outbreak in a pediatric oncology care unit caused by an errant water jet into contaminated siphons. *Pediatric Infectious Disease Journal* 2012; 31: 648-650.
17. Lucero CA, Cohen AL, Trevino I, et al. Outbreak of *Burkholderia cepacia* complex among ventilated pediatric patients linked to hospital sinks. *American Journal of Infection Control* 2011; 39: 775-778.
18. La Forgia C, Franke J, Hacek DM, et al. Management of a multidrug-resistant *Acinetobacter baumannii* outbreak in an intensive care unit using novel environmental disinfection: A 38-month report. *American Journal of Infection Control* 2010; 38: 259-263.

19. Pena C, Dominguez MA, Pujol M, et al. An outbreak of carbapenem-resistant *Pseudomonas aeruginosa* in a urology ward. *Clinical Microbiology and Infection* 2003; 9: 938-943.
20. Amoureux L, Riedweg K, Chapuis A, et al. Nosocomial Infections with IMP-19-Producing *Pseudomonas aeruginosa* Linked to Contaminated Sinks, France. *Emerging Infectious Diseases* 2017; 23: 304-307.
21. Hota S, Hirji Z, Stockton K, et al. Outbreak of multidrug-resistant *Pseudomonas aeruginosa* colonization and infection secondary to imperfect intensive care unit room design. *Infection Control & Hospital Epidemiology* 2009; 30: 25-33. DOI: 10.1086/592700.
22. Tosh PK, Disbot M, Duffy JM, et al. Outbreak of *Pseudomonas aeruginosa* surgical site infections after arthroscopic procedures: Texas, 2009. *Infection Control & Hospital Epidemiology* 2011; 32: 1179-1186.
23. Nasser RM, Rahi AC, Haddad MF, et al. Outbreak of *Burkholderia cepacia* bacteremia traced to contaminated hospital water used for dilution of an alcohol skin antiseptic. *Infection Control & Hospital Epidemiology* 2004; 25: 231-239.
24. Walker JT, Jhutti A, Parks S, et al. Investigation of healthcare-acquired infections associated with *Pseudomonas aeruginosa* biofilms in taps in neonatal units in Northern Ireland. *Journal of Hospital Infection* 2014; 86: 16-23. DOI: 10.1016/j.jhin.2013.10.003.
25. Livni G, Yaniv I, Samra Z, et al. Outbreak of *Mycobacterium mucogenicum* bacteraemia due to contaminated water supply in a paediatric haematology-oncology department. *Journal of Hospital Infection* 2008; 70: 253-258. DOI: 10.1016/j.jhin.2008.07.016.
26. Baird SF, Taori SK, Dave J, et al. Cluster of non-tuberculous mycobacteraemia associated with water supply in a haemato-oncology unit. *J Hosp Infect* 2011; 79: 339-343. 2011/09/09. DOI: 10.1016/j.jhin.2011.07.006.
27. Snitkin ES, Zelazny AM, Thomas PJ, et al. Tracking a hospital outbreak of carbapenem-resistant *Klebsiella pneumoniae* with whole-genome sequencing. *Sci Transl Med* 2012; 4: 148ra116. 2012/08/24. DOI: 10.1126/scitranslmed.3004129.

28. Gbaguidi-Haore H, Varin A, Cholley P, et al. A Bundle of Measures to Control an Outbreak of *Pseudomonas aeruginosa* Associated With P-Trap Contamination. *Infection Control & Hospital Epidemiology* 2018; 39: 164-169. DOI: 10.1017/ice.2017.304.
29. Leung GH, Gray TJ, Cheong EY, et al. Persistence of related bla-IMP-4 metallo-beta-lactamase producing Enterobacteriaceae from clinical and environmental specimens within a burns unit in Australia - a six-year retrospective study. *Antimicrob Resist Infect Control* 2013; 2: 35. 2013/12/19. DOI: 10.1186/2047-2994-2-35.
30. Ambrogi V, Cavalie L, Manton B, et al. Transmission of metallo-beta-lactamase-producing *Pseudomonas aeruginosa* in a nephrology-transplant intensive care unit with potential link to the environment. *J Hosp Infect* 2016; 92: 27-29. 2015/11/26. DOI: 10.1016/j.jhin.2015.09.007.
31. Nakamura S, Azuma M, Sato M, et al. Pseudo-outbreak of *Mycobacterium chimaera* through aerators of hand-washing machines at a hematopoietic stem cell transplantation center. *Infection Control and Hospital Epidemiology* 2019; 40: 1433-1435.
32. Weng MK, Brooks RB, Glowicz J, et al. Outbreak investigation of *Pseudomonas aeruginosa* infections in a neonatal intensive care unit. *American Journal of Infection Control* 2019; 47: 1148-1150.
33. Zhang Y, Zhou H, Jiang Q, et al. Bronchoscope-related *Pseudomonas aeruginosa* pseudo-outbreak attributed to contaminated rinse water. *American Journal of Infection Control* 2020; 48: 26-32.
34. Kinsey CB, Koirala S, Solomon B, et al. *Pseudomonas aeruginosa* outbreak in a neonatal intensive care unit attributed to hospital tap water. *Infection Control and Hospital Epidemiology* 2017; 38: 801-808.
35. Bukholm G, Tannaes T, Kjelsberg ABB, et al. An outbreak of multidrug-resistant *Pseudomonas aeruginosa* associated with increased risk of patient death in an intensive care unit. *Infection Control and Hospital Epidemiology* 2002; 23: 441-446.

36. Umezawa K, Asai S, Ohshima T, et al. Outbreak of drug-resistant *Acinetobacter baumannii* ST219 caused by oral care using tap water from contaminated hand hygiene sinks as a reservoir. *American Journal of Infection Control* 2015; 43: 1249-1251. Research Support, Non-U.S. Gov't.
37. Jolivet S, Couturier J, Vuillemin X, et al. [Outbreak of OXA-48-producing Enterobacterales in a haematological ward associated with an uncommon environmental reservoir, France, 2016 to 2019](#). *Euro surveillance : bulletin Europeen sur les maladies transmissibles = European communicable disease bulletin* 2021; 26.
38. Wendel AF, Kolbe-Busch S, Ressina S, et al. Detection and termination of an extended low-frequency hospital outbreak of GIM-1-producing *Pseudomonas aeruginosa* ST111 in Germany. *American Journal of Infection Control* 2015; 43: 635-639. DOI: 10.1016/j.ajic.2015.02.024.
39. Hong KB, Oh HS, Song JS, et al. Investigation and control of an outbreak of imipenem-resistant *acinetobacter baumannii* infection in a pediatric intensive care unit. *Pediatric Infectious Disease Journal* 2012; 31: 685-690.
40. Tofteland S, Naseer U, Lislevand JH, et al. A long-term low-frequency hospital outbreak of KPC-producing *Klebsiella pneumoniae* involving intergenus plasmid diffusion and a persisting environmental reservoir. *PLoS ONE* 2013; 8 (3)
41. Vergara-Lopez S, Dominguez MC, Conejo MC, et al. Wastewater drainage system as an occult reservoir in a protracted clonal outbreak due to metallo-beta-lactamase-producing *Klebsiella oxytoca*. *Clinical Microbiology and Infection* 2013; 19: E490-E498.
42. Seara N, Oteo J, Carrillo R, et al. Interhospital spread of NDM-7-producing *Klebsiella pneumoniae* belonging to ST437 in Spain. *International Journal of Antimicrobial Agents* 2015; 46: 169-173.
43. Lalande V, Barbut F, Varnerot A, et al. Pseudo-outbreak of *Mycobacterium gordonae* associated with water from refrigerated fountains. *Journal of Hospital Infection* 2001; 48: 76-79. DOI: doi:10.1053/jhin.2000.0929.

44. Durojaiye OC, Carbarns N, Murray S, et al. Outbreak of multidrug-resistant *Pseudomonas aeruginosa* in an intensive care unit. *Journal of Hospital Infection* 2011; 78: 154-155. Letter.
45. Engelhart S, Krizek L, Glasmacher A, et al. *Pseudomonas aeruginosa* outbreak in a haematology-oncology unit associated with contaminated surface cleaning equipment. *Journal of Hospital Infection* 2002; 52: 93-98.
46. Lowe C, Willey B, O'Shaughnessy A, et al. Outbreak of extended-spectrum beta-lactamase-producing *Klebsiella oxytoca* infections associated with contaminated handwashing sinks. *Emerging Infectious Diseases* 2012; 18: 1242-1247.
47. Davis RJ, Jensen SO, Van Hal S, et al. Whole genome sequencing in real-time investigation and management of a *pseudomonas aeruginosa* outbreak on a neonatal intensive care unit. *Infection Control and Hospital Epidemiology* 2015; 36: 1058-1064.
48. Chapuis A, Amoureux L, Bador J, et al. Outbreak of extended-spectrum beta-lactamase Producing *Enterobacter cloacae* with high MICs of quaternary ammonium compounds in a hematology ward associated with contaminated sinks. *Frontiers in Microbiology* 2016; 7 (JUL) (no pagination).
49. Bousquet A, van der Mee-Marquet N, Dubost C, et al. Outbreak of CTX-M-15-producing *Enterobacter cloacae* associated with therapeutic beds and syphons in an intensive care unit. *Am J Infect Control* 2017; 45: 1160-1164. 2017/06/03. DOI: 10.1016/j.ajic.2017.04.010.
50. De Geyter D, Blommaert L, Verbraeken N, et al. The sink as a potential source of transmission of carbapenemase-producing *Enterobacteriaceae* in the intensive care unit. *Antimicrob Resist Infect Control* 2017; 6: 24. 2017/02/28. DOI: 10.1186/s13756-017-0182-3.
51. Kossow A, Kampmeier S, Willems S, et al. Control of Multidrug-Resistant *Pseudomonas aeruginosa* in Allogeneic Hematopoietic Stem Cell Transplant Recipients by a Novel Bundle Including Remodeling of Sanitary and Water Supply Systems. *Clin Infect Dis* 2017; 65: 935-942. 2017/05/19. DOI: 10.1093/cid/cix465.

52. Health Protection Scotland (HPS). Summary of Incident and Findings of the NHS Greater Glasgow and Clyde. Queen Elizabeth University Hospital/Royal Hospital for Children water contamination incident and recommendations for NHSScotland. 2018.
53. Inkster T, Peters C, Wafer T, et al. [Investigation and control of an outbreak due to a contaminated hospital water system, identified following a rare case of *Cupriavidus pauculus* bacteraemia](#). Journal of Hospital Infection 2021; 111: 53-64.
54. Aumeran C, Paillard C, Robin F, et al. Pseudomonas aeruginosa and Pseudomonas putida outbreak associated with contaminated water outlets in an oncohaematology paediatric unit. Journal of Hospital Infection 2007; 65: 47-53. DOI: 10.1016/j.jhin.2006.08.009.
55. de Jonge E, de Boer MGJ, van Essen EHR, et al. Effects of a disinfection device on colonization of sink drains and patients during a prolonged outbreak of multidrug-resistant Pseudomonas aeruginosa in an intensive care unit. Journal of Hospital Infection 2019; 102: 70-74.
56. Starlander G and Melhus A. Minor outbreak of extended-spectrum beta-lactamase-producing Klebsiella pneumoniae in an intensive care unit due to a contaminated sink. Journal of Hospital Infection 2012; 82: 122-124. Case Reports.
57. Raun-Petersen C, Toft A, Nordestgaard MM, et al. [Investigation of an Enterobacter hormaechei OXA-436 carbapenemase outbreak: when everything goes down the drain](#). Infection Prevention in Practice 2022; 4: 100228.
58. Leitner E, Zarfel G, Luxner J, et al. Contaminated handwashing sinks as the source of a clonal outbreak of KPC-2-producing Klebsiella oxytoca on a hematology ward. Antimicrobial Agents and Chemotherapy 2015; 59: 714-716.
59. Heireman L, Hamerlinck H, Vandendriessche S, et al. Toilet drain water as a potential source of hospital room-to-room transmission of carbapenemase-producing Klebsiella pneumoniae. Journal of Hospital Infection 2020; 106: 232-239.

60. Jung J, Choi HS, Lee JY, et al. Outbreak of carbapenemase-producing Enterobacteriaceae associated with a contaminated water dispenser and sink drains in the cardiology units of a Korean hospital. *Journal of Hospital Infection* 2020; 104: 476-483.
61. Decraene V, Phan HTT, George R, et al. A large, refractory nosocomial outbreak of klebsiella pneumoniae carbapenemase-producing Escherichia coli demonstrates carbapenemase gene outbreaks involving sink sites require novel approaches to infection control. *Antimicrobial Agents and Chemotherapy* 2018; 62 (12) (no pagination).
62. Kotsanas D, Wijesooriya WRPLI, Korman TM, et al. "Down the drain": Carbapenem-resistant bacteria in intensive care unit patients and handwashing sinks. *Medical Journal of Australia* 2013; 198: 267-269.
63. Yablon BR, Dantes R, Tsai V, et al. Outbreak of Pantoea agglomerans bloodstream infections at an oncology clinic - Illinois, 2012-2013. *Infection Control and Hospital Epidemiology* 2017; 38: 314-319.
64. Wolf I, Bergervoet PWM, Sebens FW, et al. The sink as a correctable source of extended-spectrum beta-lactamase contamination for patients in the intensive care unit. *Journal of Hospital Infection* 2014; 87: 126-130.
65. Ito K, Honda H, Yoshida M, et al. A metallo-beta-lactamase producing Enterobacteriaceae outbreak from a contaminated tea dispenser at a children's hospital in Japan. *Infect Control Hosp Epidemiol* 2019; 40: 217-220. 2018/12/28. DOI: 10.1017/ice.2018.331.
66. Lv Y, Xiang Q, Jin YZ, et al. Faucet aerators as a reservoir for Carbapenem-resistant Acinetobacter baumannii: A healthcare-associated infection outbreak in a neurosurgical intensive care unit. *Antimicrobial Resistance and Infection Control* 2019; 8 (1) (no pagination).
67. Botana-Rial M, Leiro-Fernandez V, Nunez-Delgado M, et al. A Pseudo-Outbreak of Pseudomonas putida and Stenotrophomonas maltophilia in a Bronchoscopy Unit. *Respiration* 2016; 92: 274-278.
68. Guyot A, Turton JF and Garner D. Outbreak of Stenotrophomonas maltophilia on an intensive care unit. *Journal of Hospital Infection* 2013; 85: 303-307.

69. Novosad SA, Lake J, Nguyen D, et al. Multicenter Outbreak of Gram-Negative Bloodstream Infections in Hemodialysis Patients. *American Journal of Kidney Diseases* 2019; 74: 610-619. Multicenter Study.
70. Wong V, Levi K, Baddal B, et al. Spread of *Pseudomonas fluorescens* due to contaminated drinking water in a bone marrow transplant unit. *J Clin Microbiol* 2011; 49: 2093-2096. 2011/04/01. DOI: 10.1128/JCM.02559-10.
71. Sax H, Bloemberg G, Hasse B, et al. Prolonged Outbreak of *Mycobacterium chimaera* Infection After Open-Chest Heart Surgery. *Clin Infect Dis* 2015; 61: 67-75. 2015/03/13. DOI: 10.1093/cid/civ198.
72. Carbonne A, Brossier F, Arnaud I, et al. Outbreak of nontuberculous mycobacterial subcutaneous infections related to multiple mesotherapy injections. *Journal of Clinical Microbiology* 2009; 47: 1961-1964.
73. Chroneou A, Zimmerman SK, Cook S, et al. Molecular typing of *Mycobacterium chelonae* isolates from a pseudo-outbreak involving an automated bronchoscope washer. *Infect Control Hosp Epidemiol* 2008; 29: 1088-1090. 2008/10/22. DOI: 10.1086/591451.
74. Vijayaraghavan R, Chandrashekar R, Sujatha Y, et al. Hospital outbreak of atypical mycobacterial infection of port sites after laparoscopic surgery. *J Hosp Infect* 2006; 64: 344-347. 2006/10/19. DOI: 10.1016/j.jhin.2006.07.021.
75. Gebo KA, Srinivasan A, Perl TM, et al. Pseudo-outbreak of *Mycobacterium fortuitum* on a human immunodeficiency virus ward: Transient respiratory tract colonization from a contaminated ice machine. *Clinical Infectious Diseases* 2002; 35: 32-38.
76. Schmithausen RM, Sib E, Exner M, et al. The Washing Machine as a Reservoir for Transmission of Extended-Spectrum-Beta-Lactamase (CTX-M-15)-Producing *Klebsiella oxytoca* ST201 to Newborns. *Applied and environmental microbiology* 2019; 85.
77. Litvinov N, da Silva MTN, van der Heijden IM, et al. An outbreak of invasive fusariosis in a children's cancer hospital. *Clinical Microbiology and Infection* 2015; 21: 268.e261-268.e267.

78. Ashraf MS, Swinker M, Augustino KL, et al. Outbreak of *Mycobacterium mucogenicum* bloodstream infections among patients with sickle cell disease in an outpatient setting. *Infection Control and Hospital Epidemiology* 2012; 33: 1132-1136. Review.
79. Cooksey RC, Jhung MA, Yakrus MA, et al. Multiphasic approach reveals genetic diversity of environmental and patient isolates of *Mycobacterium mucogenicum* and *Mycobacterium phocaicum* associated with an outbreak of bacteremias at a Texas hospital. *Applied & Environmental Microbiology* 2008; 74: 2480-2487.
80. Cadot L, Bruguière H, Jumas-Bilak E, et al. Extended spectrum beta-lactamase-producing *Klebsiella pneumoniae* outbreak reveals incubators as pathogen reservoir in neonatal care center. *European journal of pediatrics* 2019; 178: 505-513. 2019/01/24. DOI: 10.1007/s00431-019-03323-w.
81. Constantinides B, Chau KK, Phuong Quan T, et al. Genomic surveillance of *Escherichia coli* and *Klebsiella* spp. in hospital sink drains and patients. *Microbial Genomics* 2020; 6: 4-16.
82. Zhou Z, Hu B, Gao X, et al. Sources of sporadic *Pseudomonas aeruginosa* colonizations/infections in surgical ICUs: Association with contaminated sink trap. *Journal of Infection and Chemotherapy* 2016; 22: 450-455.
83. Halstead FD, Niebel M, Garvey M, et al. [Pseudomonas aeruginosa infection in augmented care: the molecular ecology and transmission dynamics in four large UK hospitals](#). *Journal of Hospital Infection* 2021; 111: 162-168.
84. De Geyter D, Vanstokstraeten R, Crombe F, et al. [Sink drains as reservoirs of VIM-2 metallo-beta-lactamase-producing Pseudomonas aeruginosa in a Belgian intensive care unit: relation to patients investigated by whole-genome sequencing](#). *The Journal of hospital infection* 2021; 115: 75-82.
85. Coppy M, Leroyer C, Saly M, et al. Exogenous acquisition of *Pseudomonas aeruginosa* in intensive care units: a prospective multi-centre study (DYNAPYO study). *Journal of Hospital Infection* 2020; 104: 40-45.

86. Rogues AM, Boulestreau H, Lasheras A, et al. Contribution of tap water to patient colonisation with *Pseudomonas aeruginosa* in a medical intensive care unit. *Journal of Hospital Infection* 2007; 67: 72-78.
87. Chand M, Lamagni T, Kranzer K, et al. Insidious Risk of Severe *Mycobacterium chimaera* Infection in Cardiac Surgery Patients. *Clin Infect Dis* 2017; 64: 335-342. 2016/12/09. DOI: 10.1093/cid/ciw754.
88. Inkster T, Wilson G, Black J, et al. *Cupriavidus* spp. and other waterborne organisms in healthcare water systems across the UK. *J Hosp Infect* 2022; 123: 80-86. 2022/02/20. DOI: 10.1016/j.jhin.2022.02.003.
89. Kizny Gordon AE, Mathers AJ, Cheong EYL, et al. The Hospital Water Environment as a Reservoir for Carbapenem-Resistant Organisms Causing Hospital-Acquired Infections - A Systematic Review of the Literature. *Clinical Infectious Diseases* 2017; 64: 1436-1444. Review.
90. Reuter S, Sigge A, Wiedeck H, et al. Analysis of transmission pathways of *Pseudomonas aeruginosa* between patients and tap water outlets. *Critical Care Medicine* 2002; 30: 2222-2228.
91. Garvey MI, Wilkinson MAC, Holden KL, et al. Tap out: reducing waterborne *Pseudomonas aeruginosa* transmission in an intensive care unit. *Journal of Hospital Infection* 2019; 102: 75-81.
92. Brulet A, Nicolle MC, Giard M, et al. Fatal nosocomial *Legionella pneumophila* infection due to exposure to contaminated water from a washbasin in a hematology unit. *Infect Control Hosp Epidemiol* 2008; 29: 1091-1093. 2008/10/22. DOI: 10.1086/591739.
93. Jaubert J, Mougari F, Picot S, et al. A case of postoperative breast infection by *Mycobacterium fortuitum* associated with the hospital water supply. *Am J Infect Control* 2015; 43: 406-408. 2015/04/04. DOI: 10.1016/j.ajic.2014.12.023.
94. Sehulster L and Chinn RY. Guidelines for environmental infection control in health-care facilities. Recommendations of CDC and the Healthcare Infection Control Practices Advisory Committee (HICPAC). *Mmwr* 2003; Recommendations and reports / Centers for Disease Control. 52: 1-42.

95. Public Health England. Infections associated with heater cooler units used in cardiopulmonary bypass and ECMO - Information for healthcare providers in the UK - Version 2. 2017.
96. Tagashira Y, Kozai Y, Yamasa H, et al. A cluster of central line-associated bloodstream infections due to rapidly growing nontuberculous mycobacteria in patients with hematologic disorders at a Japanese tertiary care center: An outbreak investigation and review of the literature. *Infection Control and Hospital Epidemiology* 2015; 36: 76-80.
97. Walker J and Moore G. *Pseudomonas aeruginosa* in hospital water systems: biofilms, guidelines, and practicalities. *Journal of Hospital Infection* 2015; 89: 324-327. Review.
98. Takajo I, Iwao C, Aratake M, et al. Pseudo-outbreak of *Mycobacterium paragordoniae* in a hospital: possible role of the aerator/rectifier connected to the faucet of the water supply system. *Journal of Hospital Infection* 2020; 104: 545-551.
99. Falkinham JO, 3rd. Surrounded by mycobacteria: nontuberculous mycobacteria in the human environment. *J Appl Microbiol* 2009; 107: 356-367. 2009/02/21. DOI: 10.1111/j.1365-2672.2009.04161.x.
100. Denoncourt AM, Paquet VE and Charette SJ. Potential role of bacteria packaging by protozoa in the persistence and transmission of pathogenic bacteria. *Front Microbiol* 2014; 5: 240. 2014/06/07. DOI: 10.3389/fmicb.2014.00240.
101. Health Facilities Scotland. Scottish Health Technical Memorandum (SHTM) 04-01. Water safety for healthcare premises Part B: Operational management. 2014 (accessed 16th May 2023).
102. The World Health Organization (WHO). LEGIONELLA and the prevention of legionellosis. 2007.
103. Nakade J, Nakamura Y, Katayama Y, et al. [Systematic active environmental surveillance successfully identified and controlled the Legionella contamination in the hospital](#). *Journal of infection and chemotherapy: official journal of the Japan Society of Chemotherapy* 2023; 29: 43-47.

104. Health Protection Network. Guideline on the management of Legionella cases, incidents, outbreaks and clusters in the community. Health Protection Network Scottish Guidance 2 (2014 Edition). Health Protection Scotland, 2014. 2014.
105. The British Standards Institution. BS 8580-1:2019. Water quality - Risk assessments for Legionella control - Code of practice. 2019.
106. Health and Safety Executive (HSE). Legionnaires' disease. L8: The control of legionella bacteria in hot and cold water systems. 2013.
107. Moghaddam S, Nojoomi F, Dabbagh Moghaddam A, et al. [Isolation of nontuberculous mycobacteria species from different water sources: a study of six hospitals in Tehran, Iran](#). BMC microbiology 2022; 22: 261.
108. Naze F, Jouen E, Randriamahazo RT, et al. Pseudomonas aeruginosa outbreak linked to mineral water bottles in a neonatal intensive care unit: fast typing by use of high-resolution melting analysis of a variable-number tandem-repeat locus. Journal of Clinical Microbiology 2010; 48: 3146-3152.
109. Conger NG, O'Connell RJ, Laurel VL, et al. Mycobacterium simiae outbreak associated with a hospital water supply. Infection Control and Hospital Epidemiology 2004; 25: 1050-1055.
110. Tracy M, Ryan L, Samarasekara H, et al. Removal of sinks and bathing changes to control multidrug-resistant Gram-negative bacteria in a neonatal intensive care unit: a retrospective investigation. Journal of Hospital Infection 2020; 104: 508-510. Note.
111. Health and Safety Executive (HSE). Legionnaires' disease. The control of legionella bacteria in water systems Approved Code of Practice and guidance on regulations L8. 2013.
112. European Centre for Disease Prevention and Control. Legionnaires' disease outbreak investigation toolbox - Incubation period. 2022.
113. Health Protection Scotland. Legionella infections in Scotland - biennial reports 2022-2016, <https://www.hps.scot.nhs.uk/a-to-z-of-topics/legionella/#data> (2016, accessed 12 August 2022).
114. Lanini S, D'Arezzo S, Puro V, et al. Molecular epidemiology of a Pseudomonas aeruginosa hospital outbreak driven by a contaminated disinfectant-soap

- dispenser. PLoS One 2011; 6: e17064. 2011/03/02. DOI: 10.1371/journal.pone.0017064.
115. Eckmanns T, Oppert M, Martin M, et al. An outbreak of hospital-acquired *Pseudomonas aeruginosa* infection caused by contaminated bottled water in intensive care units. Clin Microbiol Infect 2008; 14: 454-458. 2008/02/26. DOI: 10.1111/j.1469-0691.2008.01949.x.
 116. Health Protection Scotland (HPS). NHSScotland Guidance for Decontamination and testing of Cardiac Heater Cooler Units (HCUs). 2019.
 117. Health Protection Scotland (HPS). NHSScotland Guidance for the interpretation and clinical management of endoscopy final rinse water. 2019.
 118. The British Standards Institution. BS 7592:2022. Sampling for Legionella bacteria in water systems - Code of practice. 2022.
 119. The British Standards Institution. PD 855468:2015. Guide to the flushing and disinfection of services supplying water for domestic use within buildings and their curtilages. 2015.
 120. Health Facilities Scotland. Scottish Health Technical Memorandum (SHTM) 04-01. Water safety for healthcare premises Part A: Design, installation and testing. 2014 (accessed 16th May 2023).
 121. Health Facilities Scotland. Scottish Health Technical Memorandum (SHTM) 04-01. The control of Legionella, hygiene, 'safe' hot water, cold water and drinking water systems Part E: Alternative materials and filtration. 2014 (accessed 16th May 2023).
 122. Department of Health. Health Technical Memorandum 04-01: Safe water in healthcare premises Part A: Design, installation and commissioning. 2016.
 123. Health Facilities Scotland. SHFN 30 Part A: Manual. 2014.
 124. Health Facilities Scotland. SHFN 30 Part B: HAI-SCRIBE. 2014.
 125. The British Standards Institution. BS 8680:2020. Water quality - Water safety plans - Code of practice. 2020.

126. The British Standards Institution. BS 8580-2:2022. Water quality Part 2: Risk assessments for *Pseudomonas aeruginosa* and other waterborne pathogens - Code of practice. 2022.
127. Health Facilities Scotland. Scottish Health Technical Memorandum (SHTM) 04-01. Water safety for healthcare premises Part C: TVC Testing Protocol. 2014 (accessed 16th May 2023).
128. Health Protection Surveillance Centre (HPSC). Guidelines for the Prevention and Control of Infection from Water Systems in Healthcare Facilities. 2015.
129. Health and Safety Executive (HSE). Legionnaires' disease. Part 2: The control of legionella bacteria in hot and cold water systems. 2014.
130. Department of Health. Health Technical Memorandum 04-01: Safe water in healthcare premises Part B: Operational management. 2016.
131. Public Health England. Examining food, water and environmental samples from healthcare environments. Microbiological guidelines. 2020.
132. Walker JT, Bak A, Marsden G, et al. Final rinse water quality for flexible endoscopy to minimize the risk of post-endoscopic infection. Report from Healthcare Infection Society Working Party. *J Hosp Infect* 2022; 124: 79-96. 2022/03/12. DOI: 10.1016/j.jhin.2022.02.022.
133. Health Facilities Scotland. Scottish Health Technical Memorandum 01-06: Decontamination of thermolabile flexible endoscopes and Transoesophageal echocardiograph (TOE) ultrasound probes in Endoscope Decontamination Units. Part D: Automated endoscope washer disinfectors. 2023.
134. Public Health England. Responding to the detection of legionella in healthcare premises Guidance for PHE Health Protection Teams. 2015.
135. The British Standards Institution. BS 8554:2015. Code of practice for the sampling and monitoring of hot and cold water services in buildings. 2015.
136. Scottish Government. The Public Water Supplies (Scotland) Regulations. 2014.
137. The World Health Organization (WHO). Water Safety in Buildings 2011.
138. NSS Health Facilities Scotland & Health Protection Scotland. NHS Lothian - Royal Hospital for Children and Young People & Department of Clinical

- Neurosciences. NHS National Services Scotland – Review of: Water, Ventilation, Drainage and Plumbing Systems. 2019.
139. Health Facilities Scotland. Scottish Health Technical Memorandum (SHTM) 04-01. The control of Legionella, hygiene, 'safe' hot water, cold water and drinking water systems Part D: Disinfection of Domestic Water Systems. 2011 (accessed 16th May 2023).
 140. Scottish Government. CEL 08 Water sources and potential infection risk to patients in high risk units – revised guidance. 2013.
 141. Department of Health. Health Technical Memorandum 04-01: Safe water in healthcare premises Part C: Pseudomonas aeruginosa – advice for augmented care units. 2016.
 142. Gavaldà L, Garcia-Nuñez M, Quero S, et al. Role of hot water temperature and water system use on Legionella control in a tertiary hospital: An 8-year longitudinal study. *Water research (Oxford)* 2019; 149: 460-466. DOI: 10.1016/j.watres.2018.11.032.
 143. Landelle C, Legrand P, Lesprit P, et al. Protracted outbreak of multidrug-resistant *Acinetobacter baumannii* after intercontinental transfer of colonized patients. *Infection Control & Hospital Epidemiology* 2013; 34: 119-124.
 144. Gravningen K, Kacelnik O, Lingaas E, et al. *Pseudomonas aeruginosa* countrywide outbreak in hospitals linked to pre-moistened non-sterile washcloths, Norway, October 2021 to April 2022. *Euro Surveill* 2022; 27 2022/05/07. DOI: 10.2807/1560-7917.Es.2022.27.18.2200312.
 145. Bringhurst J, Weber DJ, Miller MB, et al. A bronchoscopy-associated pseudo-outbreak of *Mycobacterium mucogenicum* traced to use of contaminated ice used for bronchoalveolar lavage. *Infect Control Hosp Epidemiol* 2020; 41: 124-126. 2019/11/16. DOI: 10.1017/ice.2019.317.
 146. Schuetz AN, Hughes RL, Howard RM, et al. Pseudo-outbreak of *Legionella pneumophila* serogroup 8 infection associated with a contaminated ice machine in a bronchoscopy suite. *Infect Control Hosp Epidemiol* 2009; 30: 461-466. 2009/03/27. DOI: 10.1086/596613.

147. Health Facilities Scotland. The NHSScotland National Cleaning Services Specification. Healthcare Associated Infection Task Force 2016.
148. Health Facilities Scotland. Scottish Health Technical Memorandum 64. Sanitary Assemblies 2009.
149. Department of Health. Health Building Note 00-10. Part C: Sanitary assemblies. 2013.
150. Department Of Health. Health Building Note 00-09 Infection control in the built environment. 2013.
151. Baker AW, Stout JE, Anderson DJ, et al. Tap Water Avoidance Decreases Rates of Hospital-onset Pulmonary Nontuberculous Mycobacteria. *Clin Infect Dis* 2021; 73: 524-527. 2020/08/24. DOI: 10.1093/cid/ciaa1237.
152. Hopman J, Tostmann A, Wertheim H, et al. Reduced rate of intensive care unit acquired gram-negative bacilli after removal of sinks and introduction of 'water-free' patient care. *Antimicrobial resistance and infection control* 2017; 6: 59-59. DOI: 10.1186/s13756-017-0213-0.
153. Walker J, Wilson B, Laing-Herridge K, et al. A default to standardised 100% single rooms in new hospital builds: a high cost strategy with the average non-use of showers in medical wards at 86% daily. *J Hosp Infect* 2023 2023/04/20. DOI: 10.1016/j.jhin.2023.04.002.
154. Department of Health. Health Building Note 03-02 Facilities for child and adolescent mental health services (CAMHS). 2017.
155. UK Health Security Agency. Good IPC practice for the cleaning and handling of incubators and other equipment in neonatal units. 27 October 2022 2022.
156. Yetkin F, Ersoy Y, Kuzucu Çd, et al. An outbreak associated with multidrug-resistant *Pseudomonas aeruginosa* contamination of duodenoscopes and an automated endoscope reprocessor. *Journal of Biomedical Research* 2017; 28: 6064-6070.
157. Scottish Government. Management of Public Health Incidents: Guidance on the Roles and Responsibilities of NHS led Incident Management Teams. 2020.

158. The Regulation and Quality Improvement Authority. Independent review of incidents of *Pseudomonas aeruginosa* infection in neonatal units in Northern Ireland- Final report. 2012.
159. Health Facilities Scotland. Scottish Health Technical Memorandum (SHTM) 04-01. Water safety for healthcare premises Part G: Operational procedures and Exemplar Written Scheme. 2015 (accessed 16th May 2023).
160. Trautmann M, Halder S, Hoegel J, et al. Point-of-use water filtration reduces endemic *Pseudomonas aeruginosa* infections on a surgical intensive care unit. *Am J Infect Control* 2008; 36: 421-429. 2008/08/05. DOI: 10.1016/j.ajic.2007.09.012.
161. Parkes LO and Hota SS. Sink-Related Outbreaks and Mitigation Strategies in Healthcare Facilities. *Current Infectious Disease Reports* 2018; 20 (10) (no pagination). Review.
162. Warris A, Klaassen CH, Meis JF, et al. Molecular epidemiology of *Aspergillus fumigatus* isolates recovered from water, air, and patients shows two clusters of genetically distinct strains. *J Clin Microbiol* 2003; 41: 4101-4106. 2003/09/06. DOI: 10.1128/jcm.41.9.4101-4106.2003.
163. Anaissie EJ, Penzak SR and Dignani MC. The hospital water supply as a source of nosocomial infections: a plea for action. *Archives of Internal Medicine* 2002; 162: 1483-1492. Meta-Analysis.
164. Decker BK and Palmore TN. The role of water in healthcare-associated infections. *Current Opinion in Infectious Diseases* 2013; 26: 345-351. Review.
165. Anaissie EJ, Stratton SL, Dignani MC, et al. Pathogenic molds (including *Aspergillus* species) in hospital water distribution systems: a 3-year prospective study and clinical implications for patients with hematologic malignancies. *Blood* 2003; 101: 2542-2546. 2002/12/07. DOI: 10.1182/blood-2002-02-0530.
166. Panagea S, Winstanley C, Walshaw MJ, et al. Environmental contamination with an epidemic strain of *Pseudomonas aeruginosa* in a Liverpool cystic fibrosis centre, and study of its survival on dry surfaces. *Journal of Hospital Infection* 2005; 59: 102-107.

Appendices

Appendix 1: Specific standards relating to water systems

This appendix provides a non-exhaustive list of standards pertaining to water systems. The standards listed represent the most recent versions available at the time of writing. Please note, however, standards are subject to amendments and the most recent versions should always be sourced and used in practice.

Standard	Title	Description	Publication date
BS EN 806	Specifications for installations inside buildings conveying water for human consumption	This European Standard specifies requirements gives recommendations on the design, installation, alteration, testing, maintenance and operation of potable water installations within buildings and, for certain purposes, pipework outside buildings but within the premises. This standard consists of 5 parts as follows: Part 1: General; Part 2: Design; Part 3: Pipe sizing — Simplified method; Part 4: Installation; Part 5: Operation and maintenance.	2000 - 2015
BS 7592:2022	Sampling for Legionella bacteria in water systems – Code of practice	This standard gives recommendations and guidance on the sampling of water	February 2022

Standard	Title	Description	Publication date
		and related materials for the investigation of the presence of organisms of the genus <i>Legionella</i> . The standard is applicable to the selection of sampling sites and the methods of sampling for the purposes of routine monitoring, validation, commissioning, investigating a problem, or outbreak investigation.	
BS 8554:2015	Code of practice for the sampling and monitoring of hot and cold water services in buildings	This British Standard gives guidance and recommendations for investigative and planned collection of hot and cold water samples during the life of a building, including sampling locations and the selection of laboratory or on-site testing for those samples.	September 2015
BS 8558:2015	Guide to the design, installation, testing and maintenance of services supplying water for domestic use within buildings and their curtilages – Complementary guidance to BS EN 806	This standard provides complementary guidance to BS EN 806. It is a guide to the design, installation, alteration, testing, operation and maintenance of services supplying water for domestic use within buildings and their curtilages. BS EN 806 does not cover underground pipework, but this British Standard gives guidance on underground pipework within the curtilage of a building.	September 2015

Standard	Title	Description	Publication date
BS 8580-1:2019	Water quality – Risk assessments for Legionella control – Code of practice	This standard gives recommendations and guidance on Legionella risk assessment relevant to water systems.	January 2019
BS 8580-2:2022	Water quality Part 2: Risk assessments for <i>P. aeruginosa</i> and other waterborne pathogens — Code of practice	This standard gives recommendations and guidance on how to carry out risk assessments for <i>P. aeruginosa</i> (PA) and other waterborne pathogens whose natural habitat is within constructed water systems and the aqueous environment (autochthonous) rather than those being present as a result of a contamination event. It includes those pathogens that can colonize and grow within water systems and the associated environment, with the exception of Legionella which is covered in BS 8580-1:2019.	January 2022
BS 8680:2020	Water quality — Water safety plans — Code of practice	This standard gives recommendations and guidance for the development of a water safety plan (WSP) for water systems which can pose a risk to those exposed, either from the water itself, aerosols derived from it or the surrounding environment.	May 2020

Standard	Title	Description	Publication date
PD 855468:2015	Guide to the flushing and disinfection of services supplying water for domestic use within buildings and their curtilages	This Published Document, not to be regarded as a British Standard, provides guidance on cleaning, flushing and disinfection of services supplying water for domestic purposes within buildings and their curtilages.	September 2015
BS ISO 5667-24:2016	Water quality — Sampling — Part 24: Guidance on the auditing of water quality sampling	This standard provides an audit protocol to monitor conformity with declared, or assumed, practices in all areas of water quality sampling. It is applicable to the audit of sampling activities from the development of a sampling manual through to the delivery of samples to the laboratory.	April 2016

Legend:

BS = British Standards produced by the British Standards Institution (www.bsigroup.co.uk)

EN = European Standards (European Norm) produced by the European Committee for Standardisation (www.cen.eu)

ISO = International Standards produced by the International Standards Organization (www.iso.org)

EN standards are gradually being replaced by ISO standards – when these are adopted in the UK they are prefixed with BS (e.g. BS EN; BS EN; BS EN ISO). This is usually to accommodate UK legislative or technical differences or to allow for the inclusion of a UK annex or foreword.

Appendix 2: Levels of Evidence


Grade	Description
1++	High quality meta analyses, systematic reviews of RCTs, or RCTs with a very low risk of bias
1+	Well conducted meta analyses, systematic reviews of RCTs, or RCTs with a low risk of bias
1-	Meta analyses, systematic reviews of RCTs, or RCTs with a high risk of bias
2++	High quality systematic reviews of case-control or cohort studies. High quality case-control or cohort studies with a very low risk of confounding, bias, or chance and a high probability that the relationship is causal
2+	Well conducted case control or cohort studies with a low risk of confounding, bias, or chance and a moderate probability that the relationship is causal
2-	Case control or cohort studies with a high risk of confounding, bias, or chance and a significant risk that the relationship is not causal
3	Non-analytic studies, for example case reports, case series
4	Expert opinion

Appendix 3: PRISMA Flow Diagram

For more information, visit: <http://www.prisma-statement.org/>



PRISMA 2009 Flow Diagram

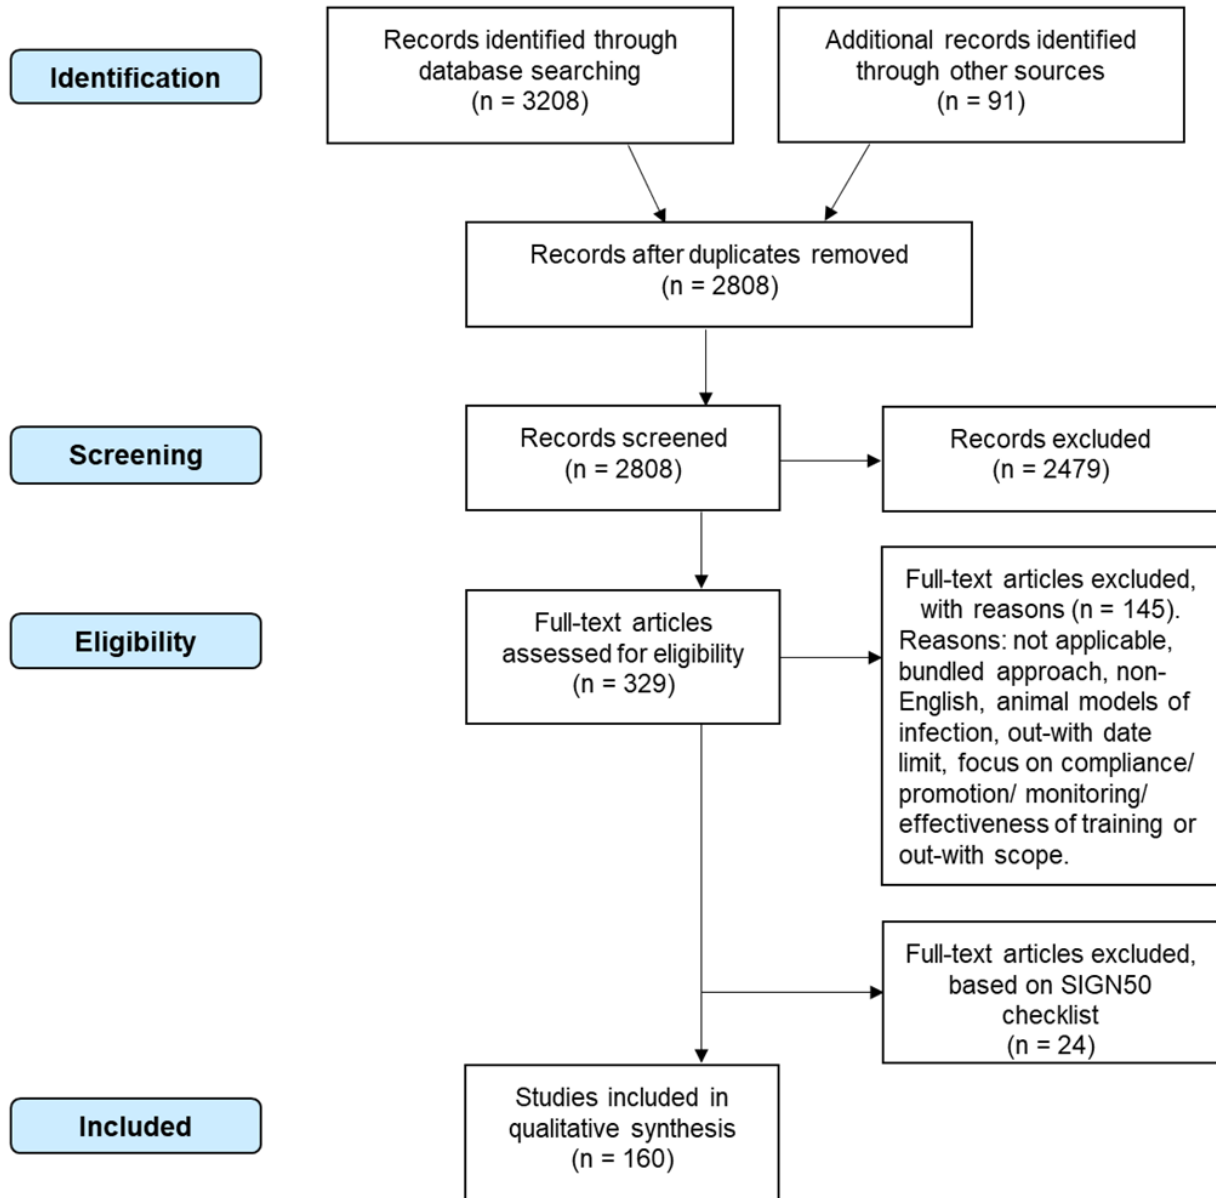

Appendix 4: Excluded studies

The following studies were excluded during critical appraisal based on their limitations according to the SIGN50 checklist:

- Turner C, Mosby D, Partridge D, et al. A patient sink tap facilitating carbapenemase-producing enterobacteriales transmission. *Journal of Hospital Infection* 2020; 104: 511-512. Letter.
- Ross B, Krull M, Rath P, et al. Dialysis drains as a possible source for carbapenem-resistant pathogens causing an ICU outbreak. *Infection* 2019; 47: 233-238.
- Grabowski M, Lobo JM, Gunnell B, et al. Characterizations of handwashing sink activities in a single hospital medical intensive care unit. *Journal of Hospital Infection* 2018; 100: e115-e122.
- Nagpal A, Wentink JE, Berbari EF, et al. A cluster of *Mycobacterium wolinskyi* surgical site infections at an academic medical center. *Infection Control and Hospital Epidemiology* 2014; 35: 1169-1175.
- Johansson E, Welinder-Olsson C and Gilljam M. Genotyping of *Pseudomonas aeruginosa* isolates from lung transplant recipients and aquatic environment-detected in-hospital transmission. *Apmis* 2014; 122: 85-91.
- Decker BK and Palmore TN. The role of water in healthcare-associated infections. *Current Opinion in Infectious Diseases* 2013; 26: 345-351.
- Williams MM, Chen TH, Keane T, et al. Point-of-use membrane filtration and hyperchlorination to prevent patient exposure to rapidly growing mycobacteria in the potable water supply of a skilled nursing facility. *Infection Control and Hospital Epidemiology* 2011; 32: 837-844.
- Cuttelod M, Senn L, Terletskiy V, et al. Molecular epidemiology of *Pseudomonas aeruginosa* in intensive care units over a 10-year period (1998-2007). *Clinical Microbiology and Infection* 2011; 17: 57-62.
- Cholley P, Thouverez M, Floret N, et al. The role of water fittings in intensive care rooms as reservoirs for the colonization of patients with *Pseudomonas aeruginosa*. *Intensive Care Medicine* 2008; 34: 1428-1433.

- Gillespie TA, Johnson PRE, Notman AW, et al. Eradication of a resistant *Pseudomonas aeruginosa* strain after a cluster of infections in a hematology/oncology unit. *Clinical Microbiology and Infection* 2000; 6: 125-130.
- Perkins KM, Reddy SC, Fagan R, et al. Investigation of healthcare infection risks from water-related organisms: Summary of CDC consultations, 2014-2017. *Infection Control & Hospital Epidemiology* 2019; 40: 621-626.
- Jeanvoine A, Meunier A, Puja H, et al. Contamination of a hospital plumbing system by persister cells of a copper-tolerant high-risk clone of *Pseudomonas aeruginosa*. *Water Research* 2019; 157: 579-586.
- Shepherd MJ, Moore G, Wand ME, et al. *Pseudomonas aeruginosa* adapts to octenidine in the laboratory and a simulated clinical setting, leading to increased tolerance to chlorhexidine and other biocides. *Journal of Hospital Infection* 2018; 100: e23-e29.
- Breathnach AS, Cubbon MD, Karunaharan RN, et al. Multidrug-resistant *Pseudomonas aeruginosa* outbreaks in two hospitals: association with contaminated hospital waste-water systems. *Journal of Hospital Infection* 2012; 82: 19-24.
- Crivaro V, Di Popolo A, Caprio A, et al. *Pseudomonas aeruginosa* in a neonatal intensive care unit: molecular epidemiology and infection control measures. *BMC Infectious Diseases* 2009; 9: 70.
- Fanci R, Bartolozzi B, Sergi S, et al. Molecular epidemiological investigation of an outbreak of *Pseudomonas aeruginosa* infection in an SCT unit. *Bone Marrow Transplantation* 2009; 43: 335-338. Research Support, Non-U.S. Gov't.
- Livni G, Yaniv I, Samra Z, et al. Outbreak of *Mycobacterium mucogenicum* bacteraemia due to contaminated water supply in a paediatric haematology-oncology department. *Journal of Hospital Infection* 2008; 70: 253-258. DOI: 10.1016/j.jhin.2008.07.016.

- Baker AW, Stout JE, Anderson DJ, et al. Tap water avoidance decreases rates of hospital-onset pulmonary nontuberculous mycobacteria. *Clin Infect Dis* 2021; 73: 524-527. 2020/08/24. DOI: 10.1093/cid/ciaa1237.
- Sasahara T, Ogawa M, Fujimura I, et al. Efficacy and effectiveness of showerheads attached with point-of-use (POU) filter capsules in preventing waterborne diseases in a Japanese hospital. *Biocontrol science* 2020; 25: 223-230. DOI: <https://dx.doi.org/10.4265/bio.25.223>.
- Qiao F, Wei L, Feng Y, et al. Handwashing sink contamination and Carbapenem-resistant *Klebsiella* infection in the intensive care unit: a prospective multicenter study. *Clinical infectious diseases: an official publication of the Infectious Diseases Society of America* 2020; 71: S379-S385. DOI: <https://dx.doi.org/10.1093/cid/ciaa1515>.
- Park SC, Parikh H, Vegesana K, et al. Risk factors associated with Carbapenemase-Producing Enterobacterales (CPE) positivity in the hospital wastewater environment. *Applied and environmental microbiology* 2020; 86. DOI: <https://dx.doi.org/10.1128/AEM.01715-20>.
- Johnson JK, Smith G, Lee MS, et al. The role of patient-to-patient transmission in the acquisition of imipenem-resistant *Pseudomonas aeruginosa* colonization in the intensive care unit. *The Journal of infectious diseases* 2009; 200: 900-905. 2009/08/14. DOI: 10.1086/605408.
- Backman L, Dumigan DG, Oleksiw M, et al. A cluster of gram-negative bloodstream infections in Connecticut hemodialysis patients associated with contaminated wall boxes and prime buckets. *American Journal of Infection Control* 2022. DOI: <https://dx.doi.org/10.1016/j.ajic.2022.08.007>.
- Pulusu CP, Manivannan B, Raman SS, et al. Localized outbreaks of *Pseudomonas aeruginosa* belonging to international high-risk clones in a south Indian hospital. *Journal of medical microbiology* 2022; 71. DOI: <https://dx.doi.org/10.1099/jmm.0.001500>.
- Russell CD, Claxton P, Doig C, et al. Non-tuberculous mycobacteria: a retrospective review of Scottish isolates from 2000 to 2010. *Thorax* 2014; 69: 593-595. 2013/08/30. DOI: 10.1136/thoraxjnl-2013-204260.